

INSTRUCTION MANUAL

Instruction-HX-v.2.a 92,12.07.OGA

ELECTRONIC BALANCES

MODELS: HX-100

HX-400

HX-3000

HX-6000



Table of Contents

Section A • Set-Up		
Unpacking Your HX	page	A•2
Best Conditions For Weighing	page	A•3
Setting Up Your HX Balance	page	A•4
Power Supply Notes	page	A•6
Display OFF State	page	A•6
Display ON & Power Errors	page	A•6
Setting and Confirming the Built-in Clock	page	A•8
Confirming and Altering the time	page	A•8
Confirming and Altering the Date	page	A•10
Section B • Introduction	2	
Welcome!	page	B•2
Specifications	page	B•3
Features	page	B•5
Accessories & Options	page	B•5
Standby and Operating Modes	page	B•6
C-Parameters	page	B•6
ACAI Automatic Counting Accuracy Improvement	page	B•6
The Display and Keyboard	page	B•7
The ON:OFF Key	page	B•8
The SAMPLE Key	page	B•8
The MODE Key	page	B•9
The CAL Key	page	B•10
The PRINT Key	page	B•10
The RE-ZERO Key		
Selecting Weighing Units	page	B•12
To Turn Weighing Units OFF or ON	page	B•12
Weighing Units and Their Conversions	page	B•14
Separating the Display Units	page	B•15
Detaching the Display Unit	page	B•15
Using the Glass Breeze Break Conveniently	Dage	R-18

Section C • Calibration	•	
Intelligent Calibration	page	C•2
One Touch Calibration	page	C•2
Manual Calibration	page	C•3
Entering a Different CAL Mass Value	page	C•4
Calibration Notes and Errors	page	C•5
Section D • Weighing Mode	a	
Simple Weighing		D•2
Weighing Errors		D•5
Using RE-ZERO to Tare (or TARE key on RK)	-	D•6
Weighing into a Container		D•6
Weighing Out of a Container		D•7
Weighing Out, Goal Remains in Container		D•8
Deviational Weighing (Difference from an Ideal)		D•9
Underhook Weighing Density Determination	page	D•10
Underhook Weighing Example	page	D•11
Section E • Counting Mode	.	
'cnt' Counting Mode		E•2
Counting Mode Notes		
-		E•4
To Increase The Counting Accuracy		E•4
Using ACAI		E•5
ACAI Notes		E•7
		E•7
Counting Errors	page	E•8
Section F • Percent Mode		
'%' Percentage Mode		F•2
Percentage Mode Notes		F•3
Percentage Mode Errors	page	F•4
Section G • Internal C-Paramet	ter :	Settings
Internal Parameter C-Functions		G•2
Expanding the Applications of the HX Series by Internal S	Setting	
Observation O Description	page	G•3
Changing C-Parameter Settings		G•4
The C-Parameter Settings		G•6
C0 • Environment		G•6
C1 • Display		G•7
C2 • Data Output	page	G-8

C3 • Serial Interface	page	G•10
C4 • Calibration	page	G•12
C5 • Auto Re-ZERO Function	page	G•13
C6 • Comparator Output	page	G•14
C7 • Analog Output	page	G•15
C8 • Others	page	G•16
Section H • AD-1652 Wireless Rem	ote i	Keyboard
AD-1652 Remote Keyboard	page	H•2
Entering Values with FUNC. Keys	page	H•3
AD-1652 Keyboard Operation	page	H•4
SAMPLE / 100% WT. Key	page	H•4
MODE / UNIT WT. Key	page	H•5
TARE Key	page	H•5
PERIOD KEY	page	H•5
PRINT / INTVL. Key	page	H•6
CAL Key	page	H•6
CODE NO. Key	page	H•7
ZERO / TARGET Key	page	H•7
START / H. LIMIT Key	page	H•7
STOP / L. LIMIT Key	page	H•8
FUNC. Key	page	H•8
ENTER Key	page	H•8
FUNC. key, Plus a 10-key	page	H•9
Func. + 1 key • Set the C-Parameter	page	H•9
Func. + 2 key • Set the Weighing unit	page	H•10
Func. + 3 key • Set the Code String	page	H•10
Func. + 4 key • Set the Date	page	H•11
Func. + 5 key • Time	page	H•12
AD-1652 Remote Code Number	page	H•13
C8 • Others (from page G•16)	page	H•13
Section J • AD-1651 Vibratory	Spo	on
AD-1651 Vibratory Spoon	page	J•2
Target Weight	page	J•2
Notes on Feeding Accuracy	page	J•2
Setting (or Viewing) Target Weight	page	J•3
Setting (or Viewing) Target Weight	page	J•3
To START Sooon Feeding	page	.1•4

To STOP Spoon Feeding	page	J•4
To Re-START Spoon Feeding	page	J•4
Connector Hook-up	page	J•4
Section K • RS-232C Serial In	terfa	ace
Specifications	page	K•2
Computer Connection	page	K•2
RS-232C Pin Connection	page	K•3
Circuit Diagram	page	K•3
Data Output	page	K•4
PRINT Key Mode (when PRINT key is pressed)	page	K•4
Auto Print Mode	page	K•4
Stream Mode	page	K•5
Output by Command	page	K•5
Timed Mode (Interval Data Output)	page	K•5
Sample Computer Programs	page	K•6
IBM PC-AT (STREAM Mode)	page	K•6
IBM PC-AT (Output by Command)	page	K•6
NEC PC-9801	page	K•7
Weighing Data Formats	page	K•8
A&D Standard Format	page	K•8
DP Format	page	K•8
KF Format	page	K•8
Weighing Data Format Examples	page	K•9
Stable Data Examples	page	K•9
Unstable Data Example	page	K•10
Overload Data Examples	page	K•10
Unit Codes Examples	page	K•11
Independent Data Formats	page	K•12
Code String	page	K•12
Code String Time	page	K•12
Date	page	K•12
	page	K•12
Parameter Setting	page	
Commands for the RS-232C Serial Interface Error Codes for the Serial Interface	page	K•13 K•20
Command Examples Illustrated	page	K•23
1 Display ON/OFF	page page	K•23
2 ReZero or Tare	page	K•24
3 Calibration		K•25


4 Manual Calibration Command		
5 Counting / Percentage	page	K•27
Section L • Comparator Current	t Lo	op
(part	of C	P-04)
Comparator	page	L•2
Pin Connection and Specifications		L•2
Setting HI/LO Limits	. •	L•3
Setting HI Limit and LO Limit		L•3
Using the AD-1652 Remote Controller	-	L•8
Using the RS-232C Serial Interface		L•8
Comparator C-Parameters	page	L•9
Section M • Miscellaneous	3	
Applying the Clock Function	page	M•2
OP-04 Comparator / CL. Output Board	page	M•4
General	page	M•4
Packing	page	M•4
Installing Procedure	page	M•4
Pin Connection	page	M•5
Circuit Configuration	page	M•5
Specifications	page	M•6
OP-05 Feeder / C.L. Output Board	page	M•7
General	page	M-7
Packing	page	M•7
Installing Procedure	page	M•7
Pin Connection	page	M•8
Circuit Configuration	page	M•9
Specifications	page	M - 9
The application of the General-Purpose I/O Terminal	page	M•10
Fine Adjustment of the Feeding Amount	page	M-11
OP-06 Analog Output Board	page	M•12
General	page	M•12
Packing	page	M-12
Installing Procedure	page	M•12
Output Modes and Selecting Digits	page	M•13
Changing output voltage	page	M•15
Fine Adjustment of Output Voltage	page	M•15
Output Voltage Except In the Weighing Mode	nage	M•16

Specifications	page	M•16
Installing the Optional Breeze Break OP-10/OP-11	page	M•17
Installing the Glass Breeze Break OP-10 for HX-400	page	M•17
Installing the Glass Breeze Break OP-11 for HX-3000	page	M•20
Rear Panel	page	M•23
External Key Input (EXT. SW)	page	M•23
Trouble?	page	M•24
Changing the Fuse	page	M•24
Errors	page	M•25
External Dimensions (HX-100 Type)	page	M•27
External Dimensions (HX-400, 3000, 6000 Type)	page	M•28

FCC Rules

Please note that this equipment generates, uses and can radiate radio frequency energy. This equipment has been tested and has been found to comply with the limits of a Class A computing device pursuant to Subpart J of Part 15 of FCC rules. These rules are designed to provide reasonable protection against interference when equipment is operated in a commercial environment. If this unit is operated in a residential area it might cause some interference and under these circumstances the user would be required to take, at his own expense, whatever measures are necessary to eliminate the interference.

(FCC = Federal Communications Commission in the U.S.A.)

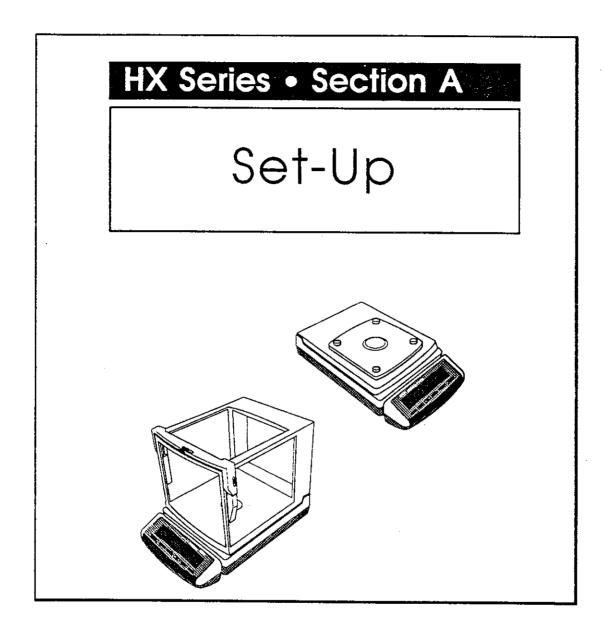


Unpacking Your HX




Unpack the scale carefully and keep the packing material if you are likely to transport the scale again in the future.

- ▶ In the carton you should find this manual plus:
 - ☐ The Balance.
 - ☐ The Weighing Pan and Pan Support.
 - ☐ An AC adaptor (check that the AC input rating is correct).
 - □ A spare fuse (500mA, Time Lag).
 - 8P DIN plug for connecting an external switch.
 - ☐ Plastic Breeze Break fon HX-400

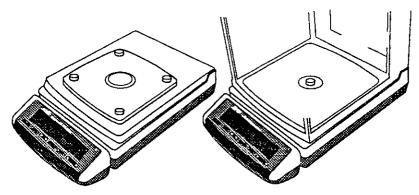

(HX-400 / 3000 / 6000)

 (HX-100)



Internal Weight Setscrews (Transportation Screws) There are two transportation screws (internal weight setscrews) under the bottom of the main body. Be sure to remove them before use and keep them together with the packing materials. When you transport the instrument, be sure to tighten the setscrews.



The HX series allows its display unit to be separated. If the display unit is to be removed, remove the internal weight set screws removing the display.







8P DIN Plug (For Connecting an External Switch)







 
Weighing Pan (For HX-400 / 3000 / 6000)



Weighing Pan (For HX-100)



Draft Ring (For HX-100)



Plastic Breeze Break (For HX-400)

Best Conditions For Weighing



To ensure that you get the most from your balance, please try to meet the following 'Best Conditions' as closely as possible:

- ☐ The Balance must be level (check the spirit level on the rear of the Balance).
- The best operating temperature is about 20°C/68°F at about 50% Relative Humidity.
- The weighing room should be kept clean and dry.
- ☐ The weighing table must be of a solid construction.
- Corners of rooms are best as they are less prone to vibrations.
- Don't install the balance near heaters or air conditioners.
- Don't install the balance in direct sunlight.
- Try to ensure a stable AC power supply when using an adaptor.
- ☐ Keep equipment containing magnets away from the balance.
- Warm-up the balance before use or leave it on standby (display OFF State) overnight.
- Ground the balance chassis for electrostatic discharge if the weighing conditions warrant (see next page).

Setting Up Your HX Balance



Place the balance on a suitable weighing surface (see BEST CONDITIONS FOR WEIGHING, previous page) and connect the AC adaptor 1 Please ground the chassis if you think static electricity may be a problem (there is a GND ground connection at the back of the balance).





P-FA IL

Power Failure may be displayed when you plug in the AC Adaptor: see next page.



Turn the leveling feet 2 until the spirit level 3 indicates the balance is level. Install the Pan Support and Weighing Pan.

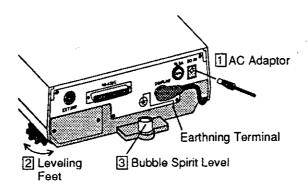


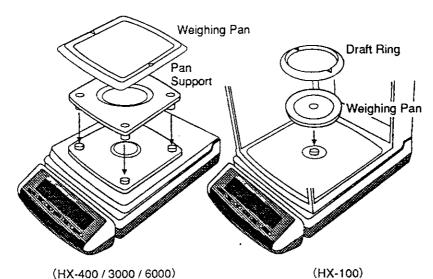





 - Press the ON:OFF key.
- All the display segments will come ON and you will hear the ZEROing mechanism.
- O Moments later, zero will be displayed. Also, the internal setting monitors (*) will be diplayed.





At this stage any weight reading will not be very accurate because the balance has not been "calibrated". You should "warm-up" your balance for at least one hour before calibration. You may turn OFF the display by pressing the ON:OFF key if you like.

Please also take the time to read SECTION B Introduction, it explains several important features of the HX, before proceeding to calibration SECTION C.





Please use the AC adaptor that was supplied with the balance, an alternative 12V DC power supply might not be stable enough for this balance.

 


The balance is always warmed-up and ready-to-use as long as the AC adaptor is connected. This is the normal state and does no harm to the balance. Please warm-up (plug-in) the balance for one hour before use.

WARM-UP YOUR BALANCE BEFORE USE!

Display OFF State

- O When the balance is plugged-in, but the display is OFF, it is in the "Display OFF State". There are three possible displays while in Display OFF State:
- One decimal point at the right of the display.




□ Power Failure

"P-FAIL" power failure is displayed if power was interrupted during weighing the last time the balance was used (see below).

P-FR IL

☐ Time Display

 If you want the current time to be displayed during the "Display OFF State", set the internal setting "oFF x c1" to "oFF 1c1". (see C1.Display in the section C-Parameter Settings.)



Display ON & Power Errors



The balance does a self check when you connect the AC adaptor, or press the ON:OFF key. If there is a problem, you will get an error display:

☐Power Failure:

P-FA IL

"P-FAIL" power failure is displayed if power was interrupted during weighing the last time the balance was used.

Press the ON:OFF key to clear.

☐ Stability Error:

Error 1

'Error 1' will be displayed if the balance takes more than thirty seconds while attempting to ZERO.

- Make sure that nothing is touching the weighing pan. If there is: press the ON:OFF key to clear.
- If there is nothing touching the weighing pan or interfering with the balance, then it is an 'environment' error.





Press the RE-ZERO key and the display will show near ZERO. See that all of the BEST CONDITIONS FOR WEIGHING have been met, especially avoiding drafts and vibrations.





If 'Error 1' is still displayed, press the MODE key repeatedly until five setting monitor marks (^) have been illuminated. This means that internal setting "fand X[0" has been altered to "fand Y[0". If the error still persists, call your dealer for service.

. [][][] a

Error 4

'Error 4' will be displayed if the weighing pan or pan support is not correctly installed, touching something or if there is a sample on the weighing pan when the ON:OFF key is pressed.

'Error 4' will be also displayed if you operate the balance with the internal weight set screws installed.

Check the weighing pan and pan support, remove any sample from the weighing pan and wait for a minute. If it doesn't correct itself, press the ON:OFF key and try again after a few seconds. If the error persists, call your dealer for service.

Memory Error:

Error5

Error8

'Error 5' or 'Error 8' will be displayed if the balance has a memory problem.

Disconnect and connect AC power and try again. If error persists, call your dealer for service.



Setting and Confirming the Built-in Clock



You can select 12- hour or 24-hour display mode for the built-in clock.

 
Confirming and Altering the time





Press the ON:OFF key to turn the display to the OFF state.








- With the CAL key held down, press the ON:OFF key.
- O The current time is displayed.

[Or, it is displayed in the 24-hour mode. Pressing the SAMPLE key allows you to change the 12-hour/24-hour mode.]


- ▶ If the time display is appropriate, press the ON:OFF key.
- O You are returned to the display OFF state.
- Confirm the current time displayed. When you want to display the date (year, month, day), press the MODE key.
- The date(year, month, day) will be displayed.
- Pressing the MODE key again returns you to the time display.

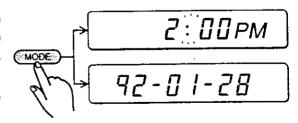





 
- When altering the time, press the RE-ZERO key first.
- First, the 'Hour' digits blinks.








Each time the MODE key is pressed, the 'Hour' and 'Minute' digits blink alternately.

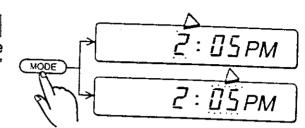





 Each time the RE-ZERO key is pressed, the blinking number in the 'Hour' digits rotates / through /2 and back to / again. (in the 12-hour mode)




In the 24-hour mode, the blinking number in the 'Hour' digits rotates g through 23 and back to g again, each time the RE-ZERO key is pressed.



To quickly step through time, hold the RE-ZERO key down until proper digit is set.

 
Each time the SAMPLE key is pressed, the 12-hour mode and 24-hour mode are selected alternately. The 12-hour mode was selected upon shipment from the factory.








 - After altering the number in the 'hour' digits, press the MODE key.
- O The 'minute' digits blink.





 ▶ Each time the RE-ZERO key is pressed, the blinking number in the 'minute' digits rotates [] / through 5 9, and then, to [] [], [] / onward.





After altering the 'hour' and 'minute' digits, press the PRINT kev.

 
15 PM

O You are returned to the time display in Step 2.

 
and Alterina the Date



Press the ON:OFF key to turn the display OFF state.










 
- ▶ With the CAL key held down, press the ON:OFF
- O The current time is displayed.








 - Press the MODE key.
- O The current date is displayed.



(Jan. 28, 1992)

 - If the date display is appropriate, press the ON:OFF key.
- O You are returned to the display OFF state.
- Confirm the current date displayed. When you want to return to the time display, press the MODE key.
- O The current time will be displayed.
- Pressing the MODE key again returns you to the time display.







- Press the RE-ZERO
- O First, the 'Year' digit





■ If you press the

RE-ZERO key with the 'year' digits blinking, the lowest one of the blinking 'year' digits will be incremented by 1.

The number in the 'year' digits rotates [] [] through qq and back to [] [] again.



To quickly step through digits, hold the RE-ZERO key down.





- To proceed to the 'month' digits, press the MODE key.
- O The 'Month' digits blink.





RE-ZERO key with the 'month' digits blinking, the lowest one of the 'month' digits will be incremented by 1 each time the key is pressed.








When you proceed to the 'day' digits, press the MODE key first to blink the 'day' digits. The number in the 'day' digits is incremented by 1 each time the MODE key is pressed.

92-02-28	
92-02-28	\equiv
92-02-29	





- After altering the 'year', 'month', and 'day' digits, press the PRINT key.
- You are returned to the time display in Step 2.

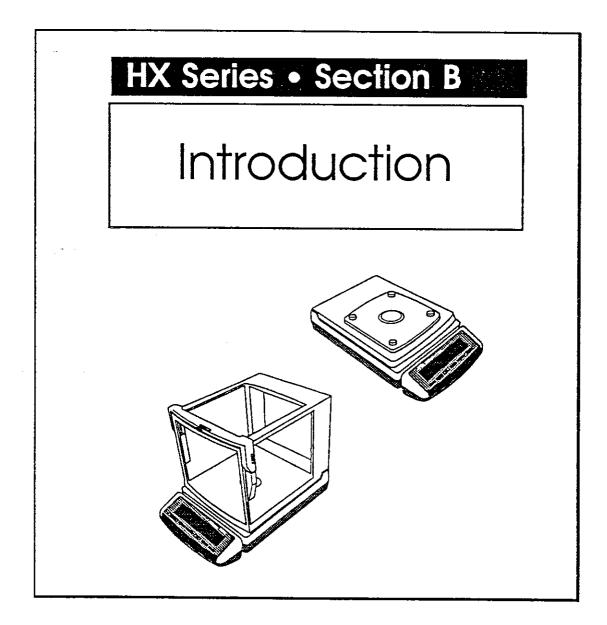



Thank You for Your AND Purchase!

This is an owner's INSTRUCTION MAN	NUAL for the A&D Electronic Balances
☐ HX-100 101g x 0.0001g Range	☐ HX-400 410g x 0.001g Range
☐ HX-3000 3100g x 0.01g Range	☐ HX-6000 6100g x 0.1g Range

Electronic Balances are in one sense extremely simple products: they are very easy to use. In another sense they are rather complex in that they are high technology products, with many features available. This manual will try to explain how your balance works and how to get the most out of it in terms of performance.

The HX Series, multi-function, electronic balance is the product of years of research, design, development and in-field testing. It incorporates the latest advances in electronic and mechanical engineering and offers increased features, increased functions, high resolution and portability; all in a low profile balance base. Every care has been taken during the manufacturing process of this balance to ensure that it will perform accurately and reliably for many years.

Specifications

☐ Weighing units are g gram; Lb pound; OZ ounce (avoir); Lb/OZ; OZt; troy ounce; dwt pennyweight; ct carat; mm momme; GN grain; t tola; and TL tael. Counting and percentage modes are also standard.

Capacity x Resolution	HX-100	HX-400
GRAM	101 x 0.0001	410 x 0.001
OUNCE (OZ)	3.5 x 0.00001	14 x 0.0001
POUND (LB)		0.9 x 0.00001
Troy OUNCE (OZt)	3.2 x 0.00001	13 x 0.0001
Penny Weight (dwt)	64 x 0.0001	263 x 0.001
Carat (ct)	505 x 0.001	2050 x 0.01
Momme (mm)	18 x 0.0001	109 x 0.001
GRAIN (GN)	1558 x 0.002	6327 x 0.02
TOLA (t)	8.6 x 0.00001	35 x 0.0001
Tael (TL)	3.2 x 0.00001	10 x 0.00 0 1
POUND/OZ		0.9Lb x 0.01 OZ
Weighing capacity	101g	410g
Minimum display	0.0001g	0.001g
Repeatability (Standard deviation)	0.00015g	0.001g
Linearity	± 0.0002g	± 0.002g
Sensitivity drift	± 3ppm/°C	
Stabilization time (Typical value)	Approx. 3.5 seconds	Approx. 1.5 seconds
Pan size	Φ3.4" (Φ85)	5.1" (□127)
Net weight	2.3lb (5.8kg)	9.5lb (4.3kg)
Display unit		t, ct, mm, GN, t, TL, cnt, % to the set weight)
% minimum registered weight	0.01g	0.1g
% minimum display	0.01%, 0.1%, 1% (automatic switching)	
Operating temperature and humidity ranges	32°F to 104°F RH<85%	
Power supply	100, 200, 220, 240VAC as required (factory preset) 50/60Hz	
Display update rate	4 times/second (8 times/second at high-speed display)	
External dimensions	HX-100 201 (W) x 352 (D) x 249 (H) HX-400 201 (W) x 350 (D) x 62 (H)	

Capacity x Resolution	HX-3000	HX-6000
GRAM	3100 x 0.01	6100 x 0.1
OUNCE (OZ)	109 x 0.001	215 x 0.01
POUND (LB)	6.8 x 0.0001	13.4 x 0.001
Troy OUNCE (OZt)	99 x 0.001	196 x 0.01
Penny Weight (dwt)	1993 x 0.01	3922 x 0.1
Carat (ct)	15500 x 0.1	30500 x 1
Momme (mm)	826 x 0.01	1626 x 0.1
GRAIN (GN)	47839 x 0.2	92592 x 2
TOLA (t)	264 x 0.001	519 x 0.01
Tael (TL)	82 x 0.001	162 x 0.01
POUND/OZ	6Lb 13OZ x 0.01OZ	13Lb 70Z x 0.01OZ
Weighing capacity	3100g	6100g
Minimum display	0.01g	0.1g
Repeatability (Standard deviation)	0.01g	0.1g
Linearity	± 0.02g	± 0.2g
Sensitivity drift	± 3ppm/°C	± 6ppm/°C
Stabilization time (Typical value)	Approx. 1.5 seconds	
Pan size	5.8" x 6.1 (145 x 153)	6.8" x 7.7" (169 x 193)
Net weight	11.7lb (5.3kg)	11.9lb (5.4kg)
Display unit	Q	t, ct, mm, GN, t, TL, cnt, % to the set weight)
% minimum registered weight	1g	10g
% minimum display	0.01%, 0.1%, 1% (automatic switching)	
Operating temperature and humidity ranges	32°F to 104°F RH<85%	
Power supply	100, 200, 220, 240VAC as required (factory preset) 50/60Hz	
Display update rate	4 times/second (8 times/second at high-speed display)	
External dimensions	201 (W) x 350 (D) x 62 (H)	



The following sections introduce you to some of the major features of your HX. Please take a moment to familiarize yourself with these items as they will be helpful for proper balance operation.

Features

a	Memorizes the working condition of your HX series and extracts the operation pattern of the balance, obtains an optimum calibration timing and performs calibration automatically at that time.
ū	One Touch Automatic Calibration with motor driven internal calibration weight. Calibration can also be done using an external calibration mass (within weight limits).
Q	Comparator HI & LO limits, can be set using the optional AD-1652 Wireless Remote Keyboard, or a computer via the RS-232C Serial Interface.
	Using the comparator function, a built-in buzzer can sound when weight exceeds set limits (internal comparator displays "+", "-", and "OK").
	Interval data output settings, with clock function.
9	The display unit and weighing unit can be separated. Depending on the purposes of use, the instrument can be set up in 3 way; united, stand-up, and separated.
J	An orange bar graph shows a current weight condition with respect to weighing capacity. It represents visually how much can be loaded

Accessories & Options

AD-1652 WIRELESS REMOTE KEYBOARD Accessory Optional infrared Remote Keyboard expands HX functions with

Optional infrared Remote Keyboard expands HX functions with a 3m, 60° operating range for remote or isolated spaces. It has the same keys as the HX series balance, plus many more, and a 10 key input.

☐ The balance is equipped with a built-in underhook for relative density

O VIBRATORY SPOON AD-1651 Accessory

Handy vibratory spoon for medical compounds or powders. Vibration frequency variable from 110Hz to 230Hz. Automatic weighing adjustment with feed control output from the HX series balance.

MULTI-FUNCTION PRINTER AD-8121 Accessory

A quiet, sharp, clear printout serial impact dot-matrix printer with a full range of statistical functions: Weight Data, Total Weight Data, Counting Data, Total Counting Data, Numbers of Operations, Standard Deviation, Range, Average and Statistical calculation on up to 999 data blocks.

Option OP-04

further.

experiments.

Comparator/current loop output board

Option OP-05

Vibratory spoon AD-1651 connection board

O Option OP-06

Analog Output Board

Option OP-10

Breeze Break for the HX-400

Option OP-11

Breeze Break for the HX-3000



 
Standby and Operating Modes



The balance is always warmed-up and ready-to-use as long as the AC adaptor is connected. This is the normal state and does no harm to the balance. Please warm-up (plug-in) the balance for one hour before use. BEFORE USE?


YOUR BALANCE

- O The ON:OFF key switches the display ON & OFF. The display can also be turned ON & OFF via the AD-1652 Remote Keyboard, or using a computer via the RS-232C Serial Interface.
- O Standby Mode is: when the balance display is OFF, but power is supplied via the AC Adaptor. The last decimal stays lit as an indicator.
- Use the ON:OFF key to turn the ON:OFF display ON or OFF. When the balance is in Standby mode, a period appears in the Display as an indicator that power is connected.



☐ Time Display

 If you want the current time to be displayed during the "Display OFF State", set the internal setting "oFF x c1" to "oFF 1c1". (see C1.Display in the section C-Parameter Settings.)





The HX balance has two main modes: Standby Mode and Operating Mode. In day-to-day operation, Standby Mode is normal when the balance is not in use. This keeps the weighing mechanism warmedup for accurate readings, and also keeps the balance's temporary memory active. If the balance is not going to be used for a long period of time, then it may be appropriate to disconnect the main power.



:-Parameters

Your HX balance has a number of software parameters that enable you to select the best weighing features for your needs. These settings control how the balance responds to various commands, operations and options. C-Parameters are listed on page G-2 and can be set using the method as shown in the section CHANGING C-PARAMETERS SETTINGS. The individual settings for each group are detailed in the section following THE C-PARAMETERS SETTINGS.




A Automatic Counting Accuracy Improvement

The ACAl™ (Automatic Counting Accuracy Improvement) function is an exclusive A&D software advancement that re-calculates the unit weight as more pieces are added, to improve count accuracy. This is a very useful function when counting light items, especially when there is a large number to be counted.



The Display and Keyboard

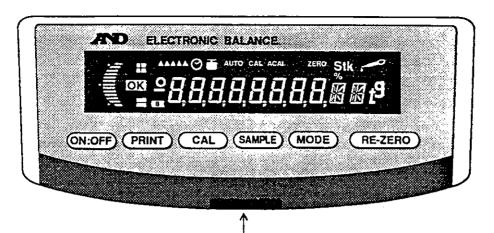

Extended Controller AD-1652 (Option), Wireless Remote Keyboard Sensor

, unimus,	Bar graph This bar graph is available as a yardstick to avoid exceeding the weighing capacity.	OK =	Comparator indication Indicates the too heavy, too light, and accepted conditions of the weighed substance with "+", "-", and "OK", respectively.
***	Setting monitor mark The number of illuminated setting monitor marks " " represents the ambient environment of the balance and its corresponding internal setting related to the response characteristic of the balance.	o	Stability mark Indicates that a variable is stable.
В	Battery mark Informs you if the supply input voltage is too low.	0	Clock mark Illuminated during interval output. Indicating wether the data is output or not.
—	Weight mark Blinks when you are prompted for a set value entry from the balance side in the comparator mode or during manual calibration.	AUTO	One touch calibration Illuminated during one touch calibration.
۰	Syringe mark Illuminated during feeding mode.	%	percent mark A weighed result is displayed in terms of percentage against the set 100% weight value.
cnt	The balance counts by calculating the weight of one piece -weight called the unit weight, then applying it to the total weight of what you are trying to count.	ACAI	Automatic Counting Accuracy Im provement function re-caluculates the unit weight as more pieces are added, to improve count accuracy.

 


- ☐ Care should be taken not to scratch or break the display and Remote Keyboard Sensor windows.
- Press on the middle of the keys to activate them, firmly but not forcefully. You will hear a faint 'fbeep' when the key has been activated.

The ON:OFF Key

ON: OFF

The ON:OFF key switches the display ON and OFF but does not cut the power to the balance - so the balance will remain on standby (warmed-up) while the AC adaptor remains connected (See POWER SUPPLY NOTES section). The HX series uses a cobalt blue fluorescent display. You can make sure that all the display segments are working properly by:



With the display OFF, press and hold the RE-ZERO key.




while holding the RE-ZERO key, press the ON:OFF key. All the display segments will come ON (Press the ON:OFF key again when finished).

The SAMPLE Key

SAMPLE

The SAMPLE key can be used to register a sample count (eg: 10 units) in counting "cnt" mode or register 100% in percentage mode.

Pressing the SAMPLE key in the "g" (gram) mode rounds the lowest digit to the nearest whole number. Pressing the SAMPLE key again returns you to the original number of digits.

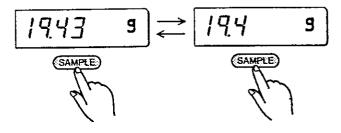

MODE

The MODE Key

- ☐ Press the MODE key quickly to rotate through the balance weighing modes.
- The weighing units are g gram; Lb pound; OZ ounce (avoir); Lb/OZ; OZt troy ounce; dwt pennyweight; ct carat; mm momme; GN grain; t tola; and TL tael (see the WEIGHING UNITS AND THEIR CONVERSIONS section (page B•14) for more information concerning the different weighing unit). There is also a percentage mode %, and counting mode cnt.
- ☐ The MODE key changes the units in the following sequence:

 


When the first setting monitor mark (♠) appears, press and hold the MODE key for about two seconds. Then, the next setting monitor mark (♠) will appear. When pressing and holding the MODE key, the setting monitor appears sequentially, one per second.


You can get a quick setting of response characteristic / environment.

Pressing the MODE key again enters the "feeding mode".

Press the MODE key repeatedly until five setting monitor marks (A) have been displayed. Then, pressing the MODE key once again enters the "feeding mode".



 In the above "feeding mode", pressing the MODE key twice returns you to the normal mode.



The CAL Key

CAL

The CAL key starts the calibration process. From the normal weighing mode, with nothing on the weighing pan and the balance level, press the CAL key and the balance will calibrate itself!

The PRINT Key

PRINT

The PRINT key can be used to transmit data to the AD-8121 printer, or to a computer, via the RS-232C.

The RE-ZERO Key

(RE-ZERO)


- The RE-ZERO key returns the balance to the center of ZERO when the weighing pan is empty, and can also TARE total weight (sample and container), RE-ZEROing the display up to the maximum capacity of the balance.
- ☐ When the display shows a small deviation from ZERO and the weighing pan is empty (and TARE is not being used), then press the RE-ZERO key to return the display to ZERO.





If you are using an AD-1652 Wireless Remote Keyboard, remember that the balance sensor has a 3-meter, 60° operating range.

⚠ You will hear a faint 'Fbeep?' if the key has been successfully received.

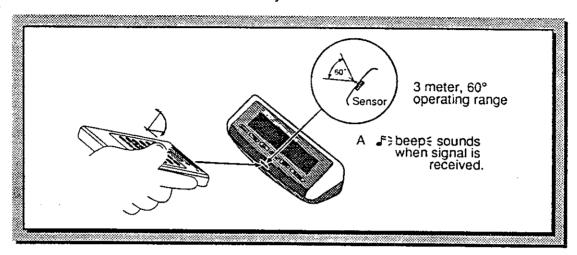

electing Weighing Units







The HX series balances are multi-functional instruments where switching between the weighing units contained in the balance software is done by pressing the |MODE| kev.

If the law in your area permits, you may use all of the units, or at this software level you can disable the weighing units you don't regularly use. Also, some dealers may initially turn OFF units which are not regular used, but you may want to turn them back ON. The complete weighing mode cycle is as follows (if some are missing please refer to your dealer):



Weighing Units OFF or ON



 
In this procedure, all available weighing units are initially turned OFF - you will have to select all the units you want to use! You can escape at any time by pressing the ON OFF kev.








▶ With the display OFF: Press and hold the MODE key







 ▶ While holding MODE key, press the ON:OFF key.



"Unit 9" will be displayed.





If you want only grams for your weighing mode, press the PRINT key - only "g" will be enabled and you will exit to the weighing mode.






SAMPLE If you wish to keep "g", press the SAMPLE key.

O The "O" stability indicator will come ON, indicating that the unit is enabled.

7			
ŏ	Цn	ıŁ	9

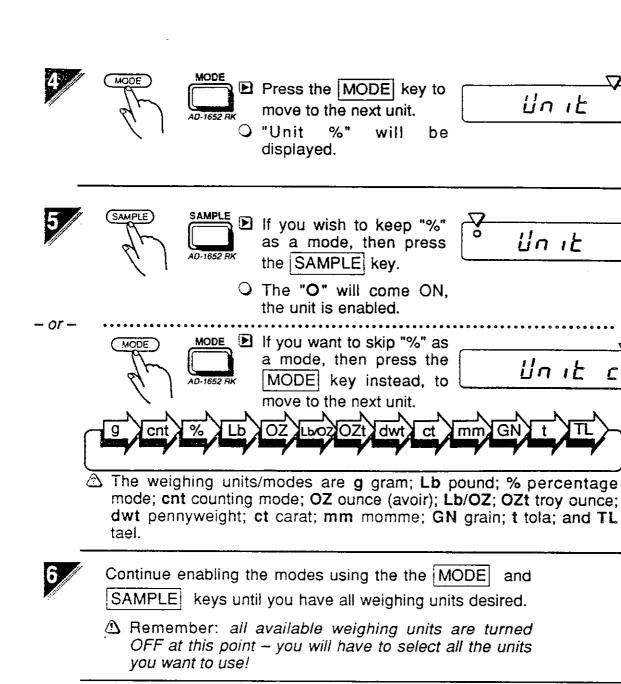

7





When you have the units you want, press the PRINT (PRINT on the AD-1652 Remote) key

to save any changes and exit to the weighing mode.

-- or --



Or, if you want to exit without saving any changes: press the ON:OFF key to exit without saving and go to display OFF state.

■ Weighing Units and Their Conversions

Abbrev.	Name In Fuil	Conversion	
Lb	Pound	453.592 37 g	
OZ	Ounce (Avoir)	28.349 523 125g	
OZt	Troy Ounce	31.103 476 8g	
dwt	Pennyweight	1.555 173 84g	
ct	Metric Carat	0.2g (5=1 gram)	
mm	Momme (Japan)	3.75g (10=1 Tael)	
GN	Gtain (UK)	0.064 798 91g	
t	Tola (India)	11.663 803 8g	
TL	Tael (Taiwan)	37.5g	
TL	Tael (Sing.)	37.793g	
TL	Tael (HK)	37.7994g	




Separating the Display Units



The display unit of the HX series can be separated from the main body depending on the working environments.

- Unit for normal use.
- Stand up when a working space is narrow.

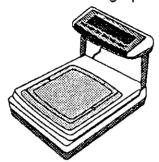

Separate when weighing something a little large.

 


Detaching the Display Unit

When the plastic transportation screws (internal weight setscrews) have been already removed, replace them prior to turning the balance over or on it's side.




- Pemove the screws (M4 screws) from, the bottom of the HX series.
- O You can see that the cable connecting the display unit and main body is placed in the bottom groove of the balance.



Transportation Screws (Leave them intact)




Remove the display assembly by pulling it straight out to the front, as there are retainer locks that grip the support tabs on the display. Some resistance to movement should be expected.

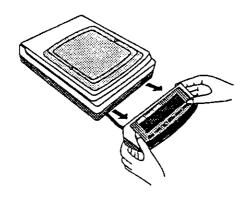



Remove the cable from the groove, which connects the display unit to the main body.

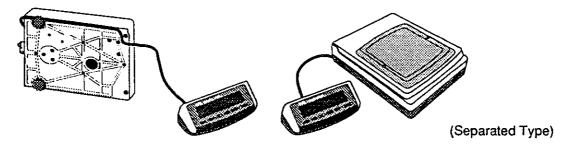

Before using, remove the internal weight set screws (transportation screws). This must be done with the balance right side up, not on it's side or inverted.




When standing up the display unit, use the legs folded under it.





Pemove the plastic caps located in the rear of the HX main body and insert the legs of the display unit into the holes.

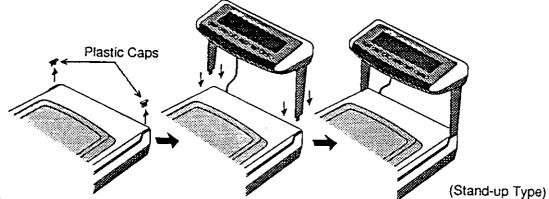


Before using, remove the internal weight setscrews (transportation screws) this must be done with the balance right side up, not on it's side or inverted.

Using the Glass Breeze Break Conveniently





The glass breeze break can be opened/closed in various ways in order to improve operability of the HX series. Examples 2 and 3 below show convenient ways of use.

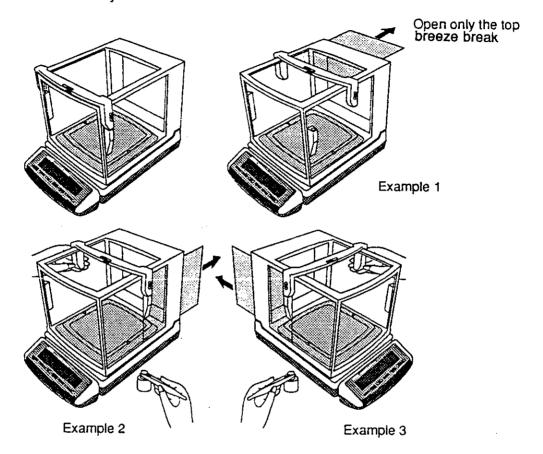

Move only the handle with your left hand and open the right-side glass. At the same time, you can place a sample on the weighing pan with your right hand.

Move only the handle with your right hand and open the left-side glass. At the same time, you can place a sample on the weighing pan with your left hand.

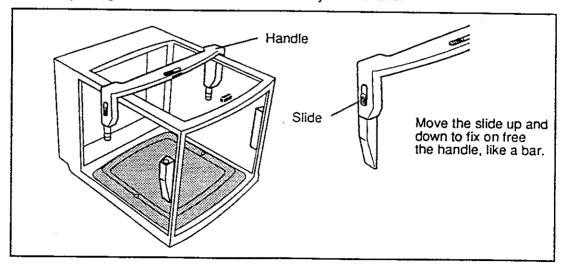

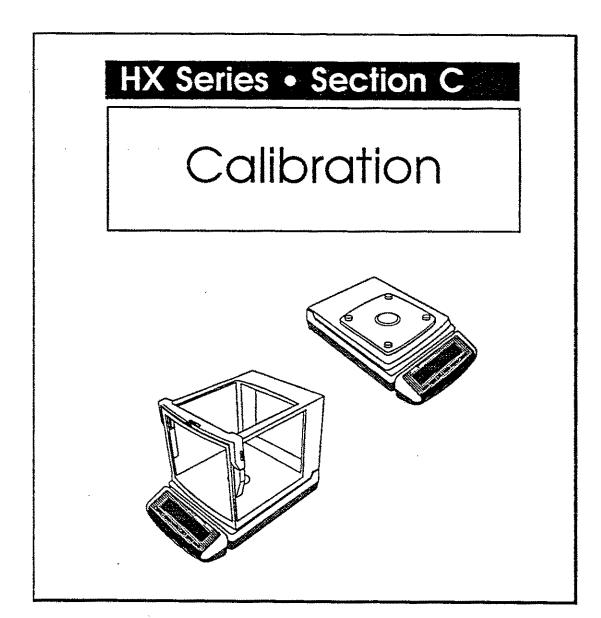



Intelligent Calibration



This mode memorizes the working condition of the balance and extracts its operation pattern, it helps you obtain an optimum calibration timing and enables automatic calibration at that time. The balance is automatically calibrated periodically without interrupting its weighing work, and you will be freed from troublesome calibration work.



- ☐ In internal setting, select the CAL setting "CAL 0 c4" "ENABLE ALL CAL." (Upon shipment, "ENABLE ALL CAL." has been selected.)
- In order to operate intelligent calibration, it is recommended to leave the balance turned on even when it is not used. In this case, the display may be left turned off.
- ☐ When you want to disable intelligent calibration, select the CAL setting "CAL I c4" "DISABLE INTELLIGENT CAL." (Even if intelligent calibration is disabled, internal calibration is performed by using the CAL key.)

One Touch Calibration Have the display ON, in normal weighing mode and stable. Check that there is nothing 9 000 on the weighing pan and the balance is level. ▶ Press the CAL ERtAD-1652 PH [AL. You will hear calibration mechanism EAL working as the display goes to [RL. A decimal point will move to show EALthat calibration is in progress. [AL $\it ERL$ End

000

9

■ When the balance is finished calibrating it will

return to normal weighing mode.

 
Manual Calibration



You can easily calibrate your HX balance by using your own calibration mass. If you want to enter the precise weight of the calibration mass, or what to use a different size mass, see the following page for instructions (ENTERING A DIFFERENT CAL MASS VALUE).




Have the display ON, in normal weighing mode and stable. Verify that there is nothing on the weighing pan and the balance is level.






- Press the CAL key, and then immediately press the PRINT key.
- O The last set CAL weight will be displayed ("100g for HX-100, 200g for HX-400, 2000g for HX-3000, 5kg for HX-6000" are the factory setting). If you wish to change this setting see page C-4.

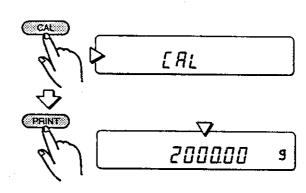




 - Press the RE-ZERO key.
- O "CAL 0", then the "■" mark, and "CAL F" will be displayed.






- When "CAL F" and "■" are displayed, place the calibration mass on the pan.
- The "■" mark, and then "CAL End" will be displayed.

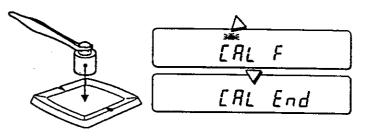




Remove the calibration mass and the display will return to normal weighing.

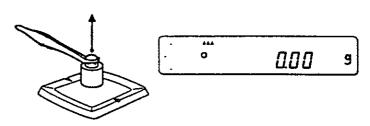

Entering a Different CAL Mass Value




 If you want to enter the precise weight of the calibration mass, or want to use a different size mass, then between Step 2 and 3 above, use the keys as shown below to enter the new mass value.



HX-100 : 100g ±15digit

HX-400: 200g, 300g, 400g ±15digit **HX-3000**: 2000g, 3000g ±15digit **HX-6000**: 3kg, 4kg, 5kg, 6kg ±15digit

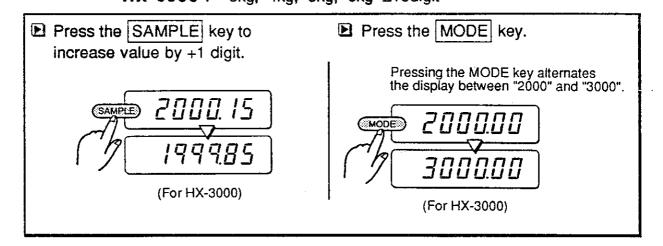

Calibration Notes and Errors



If you are using two calibration masses (say a 100g and a 200g to make 300g) a "-CAL E" will be given after you load the first mass – but "CAL F" will be displayed when you place the second on the weighing pan.

☐ CAL Errors:

-[AL E

'-CAL E' will be displayed if the calibration mass is too light.

[AL E


'CAL E' will be displayed if the calibration mass is too heavy.

Check the mass weight, look for something touching the weighing pan. Press the RE-ZERO key, then the CAL key (to use the balances' internal CAL mass) before trying again with an external CAL mass.

[AL no

'CAL no' will be displayed if the balance is not stable while weighing the calibration mass.

Check for excessive vibrations or drafts. Press the RE-ZERO key or see BEST CONDITIONS FOR WEIGHING.

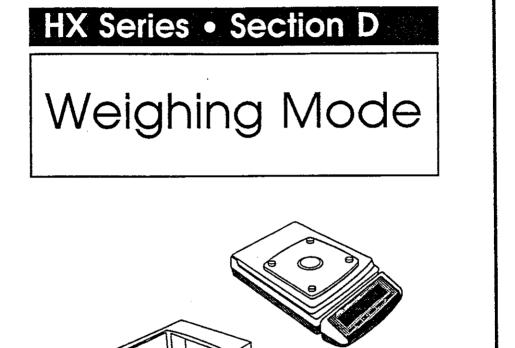



Simple Weighing




For accurate weighing, please warm-up the balance for an hour before using and try to meet the BEST CONDITIONS FOR WEIGHING.






- Press the ON:OFF key.
- O The display will come ON with all segments lit;
- O The display will blank for a moment while the balance zero's;
- O Moments later, '0' is displayed, the 'o' stability indicator and the 'a' internal setting monitor (Cond x co) will come ON.

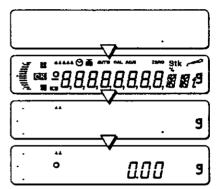






- Press the MODE key quickly as required to select a unit and the weighing mode.
- O Press the MODE key quickly to rotate through the balance weighing modes.
- When the first setting monitor mark (▲) appears, press and hold the MODE key for about two seconds. Then, the next setting monitor mark (▲) will appear. When pressing and holding the MODE key, the setting monitor appears sequentially, one per second.
- Illuminate five setting monitor marks (♠) and press the MODE key once again. You will be placed in the feeding mode, and at the same time, the syringe mark (♠♠♠♠) will be illuminated.

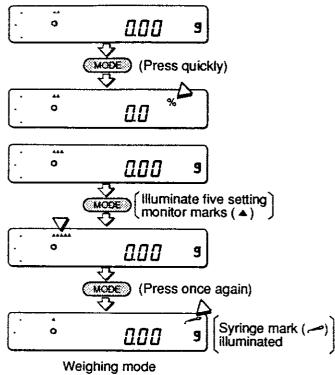

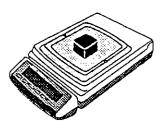

Place item(s) to be weighed on the pan, wait for the round stability indicator to come ON and read the weight.









when the unit is gram (g), pressing the SAMPLE key can display a variable, rounding the lowest digit.

. 0		2 109	9	
·	444	<u> </u>		
	0	211	9	

O The lowest digit is rounded to the next number.

 O Every time the SAMPLE key is pressed, the pre-rounded and post-rounded variables can be displayed alternately.



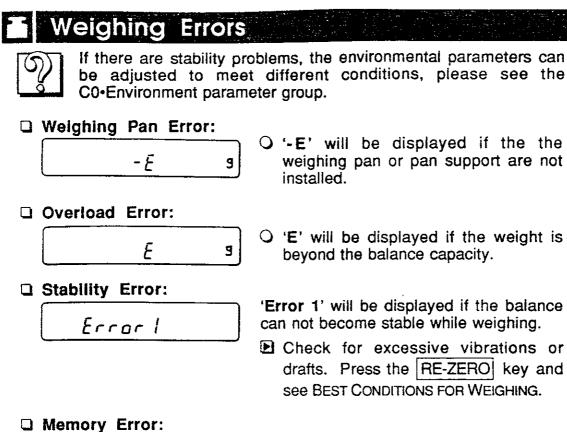

'Error 6' will be displayed if the balance has a memory problem.

Disconnect and connect AC power and try again. If error persists, call for service.

☐ Memory Error:

Error7

Errorb

'Error 7' will be displayed if the balance has a memory problem.


Disconnect and connect AC power and try again. If error persists, call for service.




sing RE-ZERO to Tare (or TARE key on RK)

into a Container Weighing



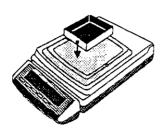

Place a container on the weighing pan.

 

O The display will show the container weight.

 







TARE Press the RE-ZERO to cancel the weight.






O The display goes to zero.



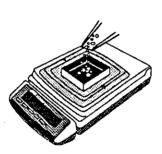

 Fill the container until the target weight is reached. •When adding more than one ingredient to the container, press the RE-ZERO key after each.



O The display will show the sample weight.

Weighing Out of a Container



 


Place a full container on the weighing pan.



O The display will show the weight of the container and its contents.





▶ Press the


RE-ZERO

on AD-1652(Remote) to cancel the


0.00 9

weight. • The display goes to zero.



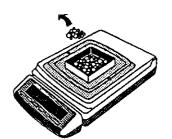

 
Remove until target weight is reached, as shown by the negative display.




O When subtracting more than one ingredient from the container, press the RE-ZERO key after each.

Weighing Out, Goal Remains in Container



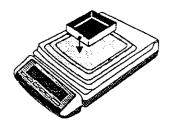

Place a container on the weighing pan.

 

Press the




1652 Remote) to cancel the weight.

O The display goes to zero.




Fill the container (the container may be removed and filled outside the weighing chamber).



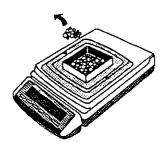

 Remove until the target weight is reached.




Deviational Weighing (Difference from an Ideal)





 Place a reference object (an ideal) on the weighing pan.





O In this case, an object that will be weighed next should ideally weigh 50g.





  
Press the RE-ZERO





• The display goes to zero.




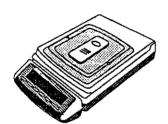

Comparative objects will now show their deviation from the reference weight (zero) by a plus or minus weight.



- The bar is -0.0003g under the ideal weight of 50g.
- If you want to use a container, you would also put it on the weighing pan in Step 1.

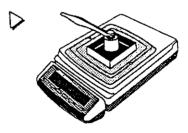

0.00

9




Underhook Weighing Density Determination




The HX Series comes equipped with a standard built-in underhook. This makes density determination a relatively simple matter. You may hang a light-weight weighing harness from this hole or thread a strand of fishing line through it. For best results re-calibrate the balance with the harness fitted. Place the balance on a weighing table with a hole cut in it or place it on a firm metal stand designed for underhook weighing. In either event take care to exclude drafts with a breeze break around the apparatus.



You can find the relative density (specific gravity) of a metal or some other material from its loss in weight when weighed in water. Because one gram of water is almost exactly one cubic centimeter in volume, the loss in weight (floating weight through displacement) associated with weighing an object in water is in proportion to the object's volume. By dividing the object's weight in air by the loss in weight in water (volume), you can find the relative density of the object (expressed as g/cm³).

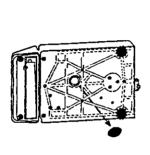

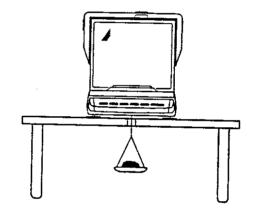


9

Section D

Underhook Weighing Example




 After you have prepared the weighing mechanism: Press the RE-ZERO key to cancel the mechanisms' weight.






 - Place an object on the weighing mechanism and record the weight.
- O In this example, the mass weighs 10g in the air.






 After recording the weight: Press the RE-ZERO key to cancel the weight of the mass.






- Lower the object into water at 4°C (maximum density).
- O In this example, the mass weighs -0.4662g in water, which is almost the same as 0.4662 cm³.

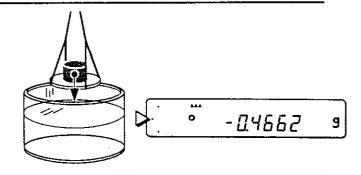



Compute: 10.0000g÷0.4662cm³ ≈21.45g/cm³. The mass is most likely platinum.

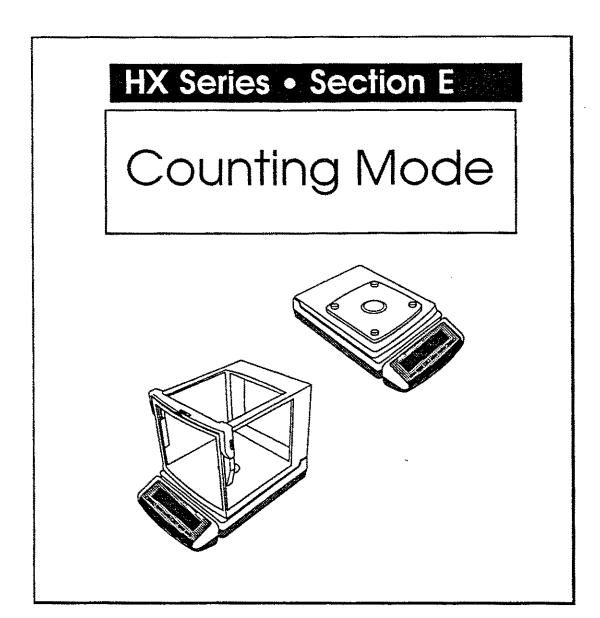




'cnt' Counting Mode



The HX balance counts by calculating the average weight of one piece-weight called the *unit weight*, then applying it to the total weight of what you are trying to count. A&D has added exclusive software called ACAITM Automatic Counting Accuracy Improvement that constantly updates the unit weight.

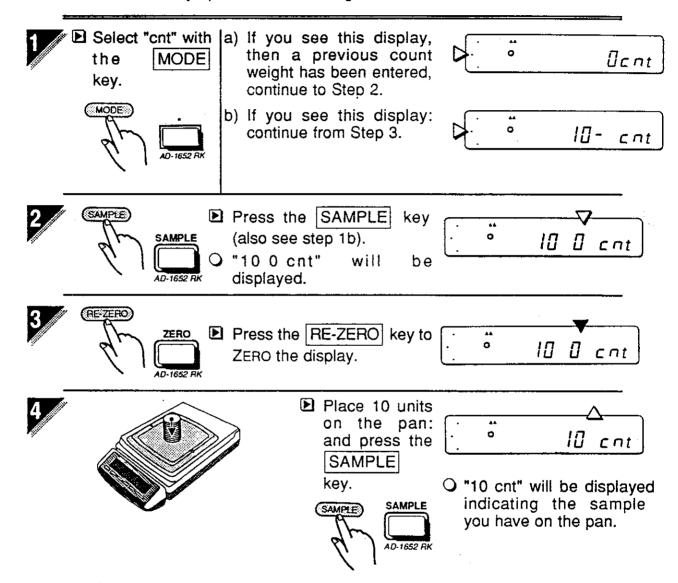





• 'Lo cnt' will be displayed if the unit weight is too small: less than 0.01g. The display will return to the "10 - cnt" display.

La Cot



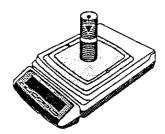

 - □ Now, to activate the ACAI, you will need to approximately double the sample. The number you add can be an estimate, but must be between 3 and 16 additional units (see following ACAI Table just below).
- For this example we will add 10 more units (double the sample).
- "20 cnt" will be displayed and ACAI should appear meaning count was within the ACAI range.





At this point please refer to the *ACAI Table*, or the following section: **ACAI** OPERATION, concerning the number of units that need to be added to satisfy **ACAI**. A rule of thumb is to approximately double the previous count until you reach your target. Make sure that the **ACAI** indicator appear as you build. When you have reached your target: count!

ACAI Table The table below shows that with an approximate number of sample unit "Pcs" on the weighing pan - to keep ACAI working, you add more units within the ACAI Addition Range shown, you don't have to be exact.

10	ACAI Addition Range 13 → 26	6063 → 108 7073 → 118
20	23 → 47	80 83 → 128
30	33 → 65	9093 → 128
40	43 → 81	· 100 103 → 148
50	53 → 95	over 100104 →

 
Counting Mode Notes



If you want to use a tared container: Load the container before pressing the RE-ZERO key in Step 3 (you may also use the ZERO or TARE key on

the AD-1652 Remote Key-board).










Example: 123.4g as unit weight

 

nunit weight can only be set in grams, and ACAI does not operate.



The Unit weight can also be set digitally using the RS-232C Serial Interface. Unit weight can only be set in grams and the ACAI will not operate.



☐ The unit weight memory is non-volatile, even though the AC adaptor is disconnected, so unit weight is remembered (except: if you turn weighing units OFF or ON).


To Increase The Counting Accuracy



To increase the counting accuracy, refer to the following procedures instead of the Step 3 to Step 4 on page E-2.




Press the PRINT key to rotate the piece count from 10 to 100 to set the actual piece count.

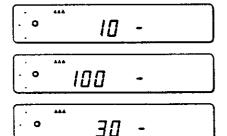

Example: 30 units were selected.



 - Place the 30 units on the pan.
- O "30-cnt" will be displayed.
- Press the SAMPLE key to register the Unit Weight.
- O "3[]cnt" will be displayed.





(Units on the pan will be displayed.)



 - ⚠ Do not take any pieces off until the end of the ACAI procedure. If you do, ACAI will stop operating and you will have to start again to use the ACAI. If you are unfamiliar with ACAI, please read the next section before you start.
- A You don't have to count out the pieces when you add, just stay within the ACAI range.



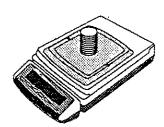





We are at the same place as Step. 5 on page E•2.


To start ACAI operation, unit weight must be registered and the sample still on the weighing pan.




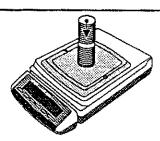

   Add pieces within the nearest ACAI range, following the table below.







As you add, the ACAI indicator range.


When you stop adding, the stable will be ON as long as you are in indicator comes ON, the ACAI indicator will disappear.

Pcs On the Weighing Pan	ACAI Addition Range		
	13 → 26		
20	23 → 47		
30	33 → 65		
40	43 → 81		
50	53 → 95		

60	63 → 108
70	73 → 118
80	83 → 128
90	93 → 128 103 → 148
100	103 → 148
over 100	104 →



 As you add, the **ACAI** indicator will be ON as long as you are in range.



When you stop adding, the stable indicator comes ON, the ACAI indicator will indicator will



- Continue adding pieces within the ACAI range until you have reached a sample size as large as the largest number of pieces that you will be counting. For example, if you are going to be counting up to 300 bolts, follow the ACAI procedure until you have over 300 pieces on the weighing pan.
- When you have added the maximum number of pieces required, remove the sample pieces and start your counting job.



ACAI Automatic Counting Accuracy Improvement



The ACAI™ (Automatic Counting Accuracy Improvement) function re-calculates the unit weight as more pieces are added, to improve count accuracy.

·	44	ACAL	
-	0	חב	
l		בט	COL

When the balance calculates unit weight from sample pieces, the more sample pieces that are used, the higher the accuracy. For example: let's say that you use 10 pieces as your sample and the unit weight calculated by the balance from your sample is 1g. Using the **ACAI** feature, after loading on 200 pieces, the balance determines that the average unit weight is really 0.98g instead of 1g. This is improved accuracy and could make a big difference when you are counting thousands of pieces.

You need to stay within the ACAI counting range as you add more pieces. But this is easy to do and only needs to be done once, up to 500 pieces. After that, the ACAI remembers the most accurate unit weight.

If you set the unit weight digitally, by using the optional AD-1652 Remote Keyboard or by computer via the serial interface, the **ACAI** function will not operate.

ACAI Notes

- You must do the ACAI procedure just after you set the unit weight. Samples must be still on the weighing pan.
- Do not take the samples off until the end of the ACAI procedure.
- You don't have to count out the pieces when you add, just stay within the ACAI range.
- ☐ Continue the ACAI procedure to reach the largest amount that you will be counting (or 500 pieces).
- If you want the most precise counting results every time you count different batches of the same item, use **ACAI** every time you start counting the next batch (in other words, if you are counting to 100, start with approximately 10 pieces and then when you add, approximately double the amount until you get to 100).





The ACAI function DOES NOT work when the unit weight is set digitally by the optional AD-1652 Remote Keyboard, or using a computer via the RS-232C Serial Interface.

Counting Errors

☐ Count Sample too light:

Lo cot

'Lo cnt' will be displayed if the unit weight is too small. The display will show 'Lo' and returns to the "10 - cnt" display.

Unit weight is less than 1digit.

☐ Stability Error:


Error 2

'Error 2' will be displayed if the balance can not become stable while registering the unit weight.

► Check for excessive vibrations or drafts. Press the RE-ZERO key and see BEST CONDITIONS FOR WEIGHING.

HX Series • Section F

Percent Mode

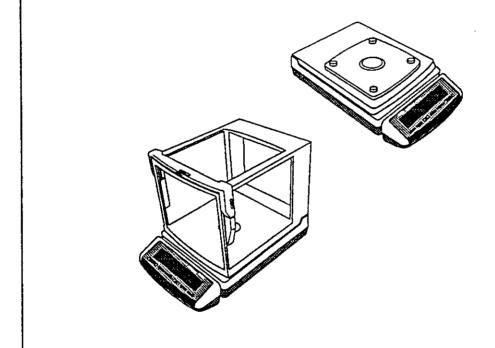





%' Percentage Mode



The HX balance contains a percentage mode which will tell you what percentage an item being weighed differs from an ideal weight. This ideal weight is called a '100%' weight. For example: if you have a metal bar that should weigh 50g, you simply register 50g as 100% weight - then when you weigh subsequent bars, the balance will display what percentage of the 100% weight they are (100% = 50g).

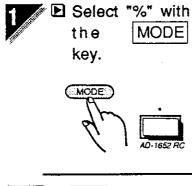

 ▶ Select "%" with a If you see this display, then a previous percentage weight has been entered, continue to Step 2.



b) If you see this display: continue from Step 3.

 




 


SAMPLE Press the SAMPLE (also see step 1b).

"100 0 %" will displayed.









Press the RE-ZERO key to ZERO the display.






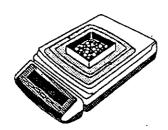

▶ Load the ideal 100% sample.

 


 The '0' will go to a '-' to indicate that a sample has been loaded.




Press the SAMPLE key.

  
"100 %" will be displayed when the ideal weight has been registered.








 ltems will now show their deviation from the ideal weight.




In this example the bar is 99.95% of the ideal, or 0.05% under weight.

Percentage Mode Notes

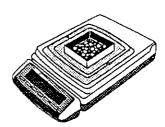

 If you want to use a tared container: Load the container before pressing the RE-ZERO key in Step 3 (you may also use the ZERO or TARE key on the AD-1652 Remote Keyboard).



: " 123.45 °

100% weight can only be entered in grams.



 
The 100% weight can also be set digitally using the RS-232C Serial Interface. 100% weight can only be set in grams.



☐ The 100% weight memory is non-volatile, even though the AC adaptor is disconnected, so unit weight is remembered (except: if you turn weighing units OFF or ON).

Percentage Mode Errors






'Lo Pct' will be displayed if the 100% weight is too small. The display will show 'Lo' and returns to the "100 - %" display.

▶ 100% weight is less than 100digits.

 ☐ Stability Error:




'Error 2' will be displayed if the balance can not become stable while registering the 100% weight.

Check for excessive vibrations or drafts. Press the RE-ZERO key and see BEST CONDITIONS FOR WEIGHING.

HX Series • Section G

Internal C-Parameter Settings

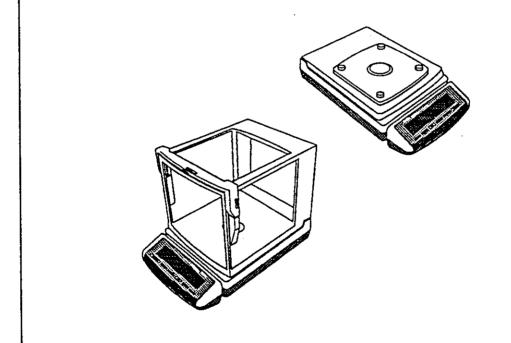




Internal Parameter C-Functions



Your HX balance has a number of internal software parameters that enable you to select the best weighing features for your needs. These settings control how you want the balance to respond to its environment, various commands, operations and options. An overall C-Parameters table is shown below.

All of the C-Parameters have initial settings from the factory, or possibly from your dealer. You may change these settings easily as you need them, or conditions vary.

 CHANGING C-PARAMETERS explains how to change the settings. The individual settings for each group are detailed in the following section THE C-PARAMETERS.



When you are in the CHANGING C-PARAMETERS mode, the parameter name, its present setting, and the group number are displayed.

	<u> </u>					
Environment	5 L b - b Stabilty Band Width	Land Response/Environ.	Erc Zero Tracking			
Display	5PEEd Refresh Rate	d 5P Reedability	Point Decimal Display	P-an Auto Start Func	OFF Display OFF State	
[2] Data Output	Print Data Out Mode	Auto Print Polarity	AP-6 Auto Print Band	d-out Send Date Data	E - OUE Send Time Data	EadE Send Code No.
	PRUSE Data Pause	AALE Date Order	AL - F	Rr - d Auto Data Transmit		
E 3 Serial Interface	6PS Beud Rate	PAr Parity Bit	りた Data Bit Length	Stop Bit	[r-LF	LYPE Data Format
	E - UP Receive Time	ASCII decmi. code	E-Cad	CTS Control		
☐ ¥ Calibration	[AL CAL Inhibition	[- [Self Check	INFO CAL Date & Time			
	Auto Function	Auto Re-zero Band	Ar - L Detecting Time			
□ 6 Comparator Out.	[P Comparison Mode	[P-d Comp. Out	[P - [] Comp. Near Zero	bEEP_ Buzzer LO	Buzzer GO	BUZZER HI
[7 Analog Output	An Mode Selection					
<i>□</i> 8 Misc.	ed Remote Keybd, ID	PF Parameters Protect/ Initialization				FR-04



Expanding the Applications of the HX Series by Internal Setting


As we want to incorporate the balance into the system, it is troublesome to press the ON:OFF key every time it is used.	0
Answer: Make use of "auto start." Select the internal setting "P - an / c1" (Refer to the page G•7 which has "C1: Display")	
☐ We want to take in as many data as possible through the RS-232C.	
Answer: Set the display refreshment to "high speed" at any time. Selecting the internal Setting "SPEEd 2 c1" outputs the data 8 times per second. (Refer to the page G•7 which has "C1: Display")	
☐ We want the printout to be started automatically when substance is placed o the pan.	n
Answer: Make use of "auto print A/B." Selecting the internal setting "Print 2 c2" and "Print 3 c2" outputs the data once after stabilization. (Refer to the page G-8 which has "C2: Data Output")	
☐ When we unload the substance weighed from the balance, we want zero to be displayed automatically.	:0
Answer: Make use of "auto rezero." Select the internal setting "#r - [] / cs" (Refer to the page G•13 which has "C5: Auto RE-ZERO Function")	



Changing C-Parameter Settings



 
- ☐ The C-Parameters can't be changed when the memory is protected by "PF" C8 group. If this parameter is set to 'protect', PF /[8, change to PF][8]
- ☐ You can escape without saving any changes, at any time, by pressing the ON:OFF key.








  With the display OFF: Press and hold the RE-ZERO key.








While holding RE-ZERO press the ON:OFF key.




 O All display segments will come ON.






- Press the MODE key to move to C-Parameter Settings mode.
- The software version number will be displayed parameter Name Setting briefly, then the first Parameter Name, Setting and Group Number will be displayed.

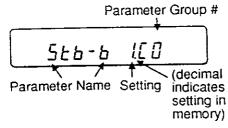

MODE



Use these keys to move through, or change the C-Parameter settings:

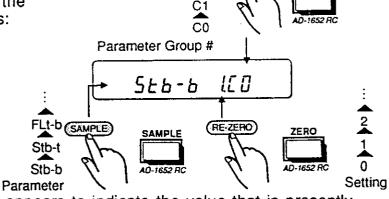

- The decimal point appears to indicate the value that is presently stored in memory.
- Parameter Names, Settings and Group Numbers will loop. So if you miss a setting, keep going until it comes around again.



Remember that you can escape at any time without saving any changes, by pressing the ON:OFF key.










When you have finished: Press the PRINT key to save the changes and exit to the weighing mode.



The C-Parameter Settings

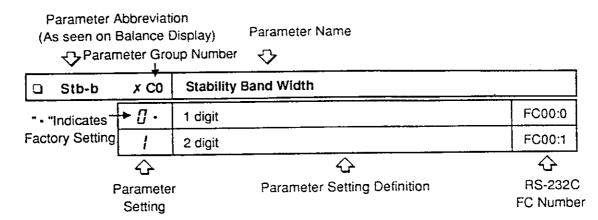

CO • Environment

	□ Stb-b xco		Stability Band Width NOTE: The Stability Indicator turns ON when display deviation within the range set by "Stb-b".		
		<i>[::</i> 1	Stable when 1 digit	FC00:0	
5Eb-b		1	Stable when 2 digits	FC00:1	
		2	Stable when 3 digits	FC00:2	

☐ Cond Xco		Response / Environment		
		Fast Response / Good Environment	FC01:0	
Land	1	Mid-Fast Response	FC01:1	
2.		Normal	FC01:2	
	3	A bit Slow Response	FC01:3	
4		Slow Response / Bad Environment	FC01:4	

□ trc	XC0	Zero Tracking Detection Time NOTE: The balance traces a zero-drift caused by the temperature, humidity, air pressure, etc., and stabiliz ZERO point. Display continues ZERO if the drift is les digit per time decided by 'trc' parameter. If weighing samples, select a smaller number.	es the s than 1
	<i>[</i>]	ZERO tracking OFF	FC02:0
Erc	1	Long (Weak Tracking)	FC02:1
	2.	Normal	FC02:2
	3	Short (Strong Tracking)	FC02:3

C1 • Display

O SPEE	d XC1	Display Refreshing Rate	
	<i>[]</i> •	Normal if Stable, Hi speed if Unstable	FC10:0
SPEEd	1	Normal (4 times/second)	FC10:1
	2	Hi Speed (8 times/second)	FC10:2
☐ diSP	XC1	Repeatability	
	п.	1 diait	FC11:0

Į	U alsp	XC1	Repeatability	
		<i>[[] · [</i>	1 digit	FC11:0
	15P	1	2 digits	FC11:1
		2	5 digits	FC11:2

☐ Point	XC1	Decimal Point Display	
Parat	<i>[]</i> •	Point (.)	FC12:0
. 5 1172		Comma (,)	FC12:1

☐ P-on	XC1	Auto Start Function	
P-00	<i>[]</i> •	No Auto start	FC13:0
3.,	/	Auto Start (You don't have to press the ON/OFF key to start weighing, the display will come ON when power is supplied)	FC13:1

□oFF	XC1	Display at 'Display OFF State' see p	. A•4
nFF	<i>[]</i> •	Power Indicator (right decimal ".")	FC14:0
<u> </u>	1	Time Displayed	FC14:1

C2 • Data Output

These parameters are used with the RS-232C Serial Interface and Current Loop. Please see Section K.

Current Loop.			
☐ Print	XC2	Data Out Mode	
Pr int	<i>a</i> ·	PRINT Key Mode A: PRINT key command accepted only if the display is stable. The display will blink when data is transmitted.	FC20:0
	1	PRINT Key Mode B: PRINT key command accepted and output if display stable. The display will blink when data is transmitted.	FC20:1
	2	Auto Print Mode A: Data output if display is over the 'Auto Print Band' "AP-b c2" setting and stable. Polarity by "AP-P c2"	FC20:2
	3	Auto Print Mode B: Data output when the difference between the display and the last transmitted data is over the 'Auto Print Band' "AP-b c2" setting and stable. Polarity by "AP-P c2"	FC20:3
	4	Stream Mode: Data output continuously.	FC20:4
□ AP-P	XC2	Polarity at Auto Print Mode	
	X C2	Polarity at Auto Print Mode Send only positive data.	FC21:0
□ AP-P #P - P			FC21:1
		Send only positive data. • At Auto Print Mode A: both positive and negative data sent.	FC21:1
		Send only positive data. • At Auto Print Mode A: both positive and negative data sent.	FC21:1
AP-P	<i>[]</i> ·	Send only positive data. • At Auto Print Mode A: both positive and negative data sent. •At Auto Print Mode B: Negative data only	FC21:1
<i>AP-b</i>	<i>[</i>] • / / / / / / / / / / / / / / / / / /	Send only positive data. • At Auto Print Mode A: both positive and negative data sent. •At Auto Print Mode B: Negative data only Auto Print Band	FC21:1
AP-P	<i>[</i>] • / / / / / / / / / / / / / / / / / /	Send only positive data. • At Auto Print Mode A: both positive and negative data sent. •At Auto Print Mode B: Negative data only Auto Print Band 10 digits	FC21:1
<i>AP-b</i>	#C2	Send only positive data. • At Auto Print Mode A: both positive and negative data sent. •At Auto Print Mode B: Negative data only Auto Print Band 10 digits 100 digits	FC22:0 FC22:1
<i>AP-b</i>	#C2	Send only positive data. • At Auto Print Mode A: both positive and negative data sent. •At Auto Print Mode B: Negative data only Auto Print Band 10 digits 100 digits	FC22:0 FC22:1
ЯР-Р ПР-Ь	#c2 ☐ ·	Send only positive data. • At Auto Print Mode A: both positive and negative data sent. •At Auto Print Mode B: Negative data only Auto Print Band 10 digits 1,000 digits	FC22:0 FC22:1

1 (3) 4 4.44	XC2	Cond Time Date	
☐ t-out	X C2	Send Time Data	
t-out	<i>[]</i> ·	No Time Data.	FC24:0
	- 1	Sent Time Data before the weighing result.	FC24:1
☐ COde	¥C2	Send Code Number	
[OdE	<i>:</i>	No Code Number.	FC25:0
[2002	1	Send Code Number before the weighing result and the code number is increased by 1.	FC25:1
O PAUSE	XC2	Pause Between Data	
PAUSE	<i>[]</i> •	No Pause.	FC26:0
771002	1	Pause 1 second (NOTE: When AD-8121 compact printer is connected with HX, set 'PAUSE' to 1 so that the printer has time to print a compete line of data).	FC26:1
□ dAtE	¥C2	Date Order	
	X C2	Date Order yy-mm-dd	FC27:0
□ dAtE			FC27:0 FC27:1
	<i>[]</i> •	yy-mm-dd	
dRFE	□ · 	yy-mm-dd mm-dd-yy	FC27:1
	<i>[]</i> ·	yy-mm-dd mm-dd-yy	FC27:1
dREE at	□ · 	yy-mm-dd mm-dd-yy dd-mm-yy	FC27:1
dRFE	[]· 2 x c2	yy-mm-dd mm-dd-yy dd-mm-yy Auto Paper Feed Function	FC27:1 FC27:2
dREE at	[]· 2 x c2	yy-mm-dd mm-dd-yy dd-mm-yy Auto Paper Feed Function No Paper Feed. Paper Feed (NOTE: When AD-8121 compact printer is connected with HX, <cr> and</cr>	FC27:1 FC27:2 FC28:0
dREE at	[]· 2 x c2	yy-mm-dd mm-dd-yy dd-mm-yy Auto Paper Feed Function No Paper Feed. Paper Feed (NOTE: When AD-8121 compact printer is connected with HX, <cr> and</cr>	FC27:1 FC27:2 FC28:0 FC28:1
dREE at RE-F	[] ·	yy-mm-dd mm-dd-yy dd-mm-yy Auto Paper Feed Function No Paper Feed. Paper Feed (NOTE: When AD-8121 compact printer is connected with HX, <cr> and <lf> are sent after weighing result is printed. Auto Re-ZERO after Weighting Data Transmission NOTE: This Auto Re-ZERO is executed only at Key A</lf></cr>	FC27:1 FC27:2 FC28:0 FC28:1

C3 • Serial Interface

These parameters are used with the RS-232C Serial Interface and Current Loop. Please see Section K

Current Loop.	Please	see Section K	
□ bPS	ХСЗ	Baud Rate	
	<i>[</i>]	600 bps	FC30:0
<i>6P5</i>	- 1	1200 bps	FC30:1
	2.	2400 bps (for AD-8121)	FC30:2
,	3	4800 bps	FC30:3
	4	9600 bps	FC30:4
□ PAr	X C3	Parity bit	
PAr	<i>[]</i> •	Even	FC31:0
	- 1	Odd (NOTE: When data bit length is selected as 8. "bit 1c3", it is regarded as No Parity)	FC31:1
		Data Dia Lagrada	
□ bit	ХСЗ	Data Bit Length	1
616	<i>[]</i> •	7 bits	FC32:0
		8 bits	FC32:1
□ Stop	х сз	Stop Bit	
StoP	<i>[</i>] •	1 bit	FC33:0
750.	1	2 bits	FC33:1
□ Cr-LF	Х С3	Terminator NOTE: This parameter is applied to both transmitted data.	or received
[r-LF	<i>[]</i> •	<cr> <lf></lf></cr>	FC34:0
<u> </u>	- 1	<cr></cr>	FC34:1
Data Format NOTE: Weighing result format can be changed by this parameter. For further information, see DATA FORMAT section.			
EYPE	<i>[]</i> •	A&D Standard	FC35:0
73,5	1	Dump Print format	FC35:1
			¬

☐ t-Up	Х С3	Time for Command Receiving	
E-UP	<i>[]</i> •	Timer ON	FC36:0
_ <u> </u>	1	Timer OFF	FC36:1
prik 1111 - 111 - 111 - 111 - 111 - 111 - 111 - 111 - 111 - 111 - 111 - 111 - 111 - 111 - 111 - 111 - 111 - 11			
Q dP ,	- X C3	ASCII Code of the Decimal Point	
AP .	<i>[]</i> •	2EH(.)	FC37:0
	1	2CH(,)	FC37:1
f			
🗅 E-Cod	Х С3	Error Code at Command Mode	
	∦ C3	Error Code at Command Mode No Error Code	FC38:0
E-Lad			FC38:0 FC38:1
E-Lod		No Error Code	
		No Error Code Transmit Error Code (NOTE: The balance	FC38:1
E-Lad	<i>[]</i> ·	No Error Code Transmit Error Code (NOTE: The balance transmits Error Code when command is received.)	FC38:1
E-Lod	[] · / X C 3	No Error Code Transmit Error Code (NOTE: The balance transmits Error Code when command is received.) CTS Control(Selects CTScontrol or RTS cr	FC38:1

C4 • Calibration

☐ CAL	XC4	Calibration Inhibition	
ſ Ri		All Calibration permitted (see p. C•2)	FC40:0
2112	1	Intelligent Calibration inhibited	FC40:1
	2	All Calibration inhibited	FC40:2
CAL-C	X C4	Self Check after Calibration (not with Self Calibration)	Automatic

G OAL-OAC4		Self Calibration)	
f Bi - f	<i>[]</i> •	No Self Check	FC41:0
2.12	1	Self Check (NOTE: Self Check is executed only when Calibration is done by the inner automatic balance calibration mass)	FC41:1

□inFo	¥C4	Send Calibration Date & Time	
-5-	<i>[]</i> •	No calibration date and time	FC42:0
[111 <u>1</u> 1	1	Send the calibration date and time	FC42:1

E C5 • Auto Re-ZERO Function

☐ Ar-0	X C5	Auto Re-ZERO function near ZERO	
Ac - A	<i>[]</i> •	No Auto Re-ZERO	FC50:0
	1	Auto Re-ZERO (NOTE: If display is ZERO ±5 digits for the time set by "Ar-t xc3" parameter, re-ZERO will be executed automatically)	FC50:1

☐ Ar-b	¥C5	Auto Re-ZERO Band Width.	
	<i>[]</i> •	ZERO when within 5 digits	FC51:0
Ar-b	1	ZERO when within 50 digits	FC51:1
	2	ZERO when within 500 digits	FC51:2

☐ Ar-t	X C5	Detecting Time for near ZERO	
	<i>:</i>	1 second	FC51:0
Ar-E	1	3 seconds	FC51:1

C6 • Comparator Output

	□ C P	¥C6	Comparison Mode	
[P		Compare all Data	FC60:0	
	-	1	Compare Stable or Overload Data	FC60:1

☐ CP-d	X°C6	Comparison Result Display	
[P-d		No Display	FC61:0
<u>, , , , , , , , , , , , , , , , , , , </u>	1	Display Comparison Result	FC61:1

□ CP	- 0 X ce	Comparison Near ZERO	
[P-D		No Compare near ZERO	FC62:0
		Compare	FC62:1

□ bEEP	_ XC6	Buzzer for LO Limit	
BEEP		No beep at LO limit	FC63:0
	1	Beep at LO limit	FC63:1

Q bEEP-	X C6	Buzzer for GO Range	
BEEP-		No beep for GO range	FC64:0
		Beep for GO range	FC64:1

□ bEEP- xc6		Buzzer for HI Limit	
BEEP-	<i>[]</i> •	No beep at HI limit	FC65:0
ULL		Beep at HI limit	FC65:1

C7 • Analog Output

	An	X C7	Mode Selection	
	An	<i>a</i> ·	Output voltage corresponding to any of two digits	FC70:0
		1	Output voltage corresponding to any of three digits.	FC70:1
		2	Full Scale are output (Net)	FC70:2
		3	Full Scale are output (Gross)	FC70:3

□SEL	X C7	Digit position of Analog Output	
	<i>[]</i> •	Least Digit	FC71:0
5 <i>EL</i>	1	First Digit	FC71:1
	2	Second Digit	FC71:2
	3	Third Digit	FC71:3
	4	Fourth Digit	FC71:4
	5	Fifth Digit	FC71:5
	Б	Sixth Digit	FC71:6


C8 • Others

	□id	X C8	ID Code for Remote Keyboard AD-	1652
		<i>a</i>	No action to Remote Keyboard	FC80:0
	ıd	1.	ID Code Number "1"	FC80:1
		2	ID Code Number "2"	FC80:2
		3	ID Code Number "3"	FC80:3
		4	ID Code Number "4"	FC80:4
÷		5	ID Code Number "5"	FC80:5
		Б	ID Code Number "6"	FC80:6
		7	ID Code Number "7"	FC80:7

□ PF	Protect the set Parameters NOTE: Even when 'PF' is set at "1", you can er Parameter Change mode and change the disp memories will keep the same value.	nter the lay, but the			
O C	<i>[]</i> •	Parameters can be changed	FC82:0		
ГГ	1	Parameters cannot be changed	FC82:1		
	2	Initialization	FC82:2		


HX Series • Section H

AD-1652 Wireless Remote Keyboard

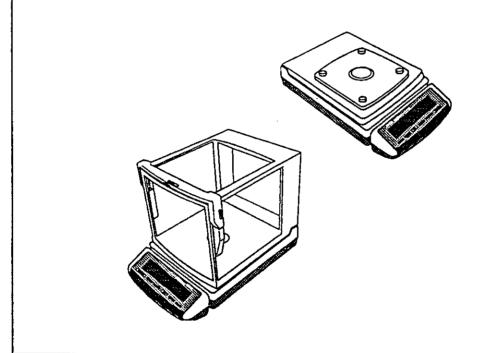




AD-1652 Remote Keyboard

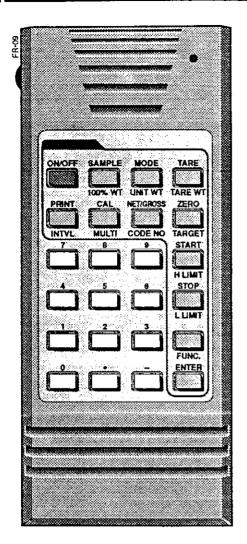

AD-1652 WIRELESS REMOTE KEYBOARD Accessory

By using the Wireless Remote Keyboard AD-1652 Accessory, the HX Series Balance can be controlled with a 3m, 60° operating range. You never have to touch the balance itself, avoiding unnecessary vibrations.

Since every balance feature can be controlled by the AD-1652 Remote Keyboard, and digital data can also be entered through the 10-key keys, you greatly simplify the more complicated balance functions.

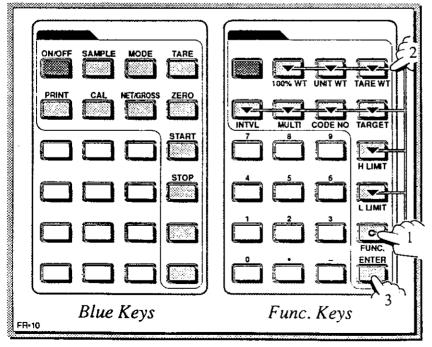

- ☐ The *Blue Keys* have two modes:
- When pressed by themselves, the balance does what is printed in black above the key.
- 2. When the FUNC, key is pressed first, you may then enter a value for what is printed in blue below the key. In this section, these keys will be described as "F-keys". See the next page.
- The white 10-key pad keys are used to enter number values. In this section, these keys will be shown as:

 12.345 keys, or
 123.45



Entering Values with FUNC. Keys





- Press the FUNC k key.
- O "-F-" will be displayed.
- ⚠ Press the FUNC key again anytime to exit, without saving any changes.





- Press the F-key desired, in this example: High Limit.
- O Any previously set value will be displayed, in this example: 80g.

80.00HI





 
- Use the 10-key pad to display value to enter.
- O In this example: 90 keys, or 90g.

90.00HI






Press the ENTER key to enter the value.




 The display will return to where you left it.



 "Error 3" will be displayed if the value entered is out of the range permitted for the function. To return to weighing mode, press any key.




When using the AD-1652 Wireless Remote Keyboard, remember that the balance sensor has a 3-meter, 60° operating range. You will hear a faint '*beep* if the key signal has been successfully received.

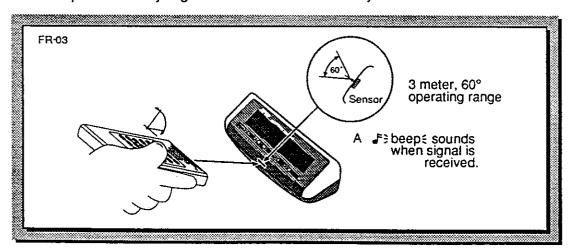




- ❖ The "□" sections are descriptions of the blue keys performing the operations printed in black above the keys.
- ❖ The "○" sections are descriptions of the F- key operations printed in blue below the keys. The ">" represents 'next', and <N> represents any number entered onto the display using the 10-key pad. For example:

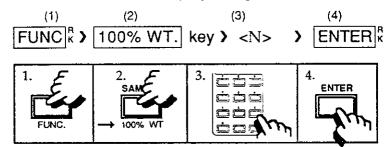


If there is another key combination operation, it will be listed after the two above.

SAMPLE / 100% WT. Key

  
- The SAMPLE key can be used to register a sample count (eg: 10 units) in counting "cnt" mode or register 100% in percentage "%" mode (when the 100 % sample is on the weighing pan).
 - ☐ When the unit other than % and cnt is used, the lowest digit is rounded to the nearest whole number.





the balance will enter 20.02g as the 100% weight (if "g" unit weight is being used).

 
MODE / UNIT WT. Key



The FUNC N VINIT WT. key > <N > ENTER N key

combination digitally sets the unit weight in milligrams (mg).

 There will be an error if the entered value is negative or the number is less than 1 digit.




the balance will enter 12.3g as the unit weight. The counting mode and percentage mode assume the unit of gram.

TARE Key

TARE WIT TARE Record to the maximum capacity of the scale and should not be confused with the ZEROR key which returns the scale to the center of ZERO when

the weighing pan is empty. The TARE weight (container weight) is a portion of the total weight, and is a portion of the total range of the scale.

 PERIOD key



The setting monitor marks appear sequentially each time this key is pressed.

PRINT / INTVL. Key



☐ The PRINT key can be used to transmit data to the AD-8121 printer, or to a computer, via the RS-232C.

 


O The FUNC * > INTVL. key > <N >

> ENTER combination digitally sets



the data transmission time interval. As Interval OFF is "00:00:00". the time is being entered, the digit being set will flash, and move right when a 10-key is pressed.






00-10 00



the balance will enter 10 minutes as the data transmission time interval.

 Interval Start:



To start interval data output, press the FUNC key then the INTVL. key

and then again, as the PRINT key.



☐ The CAL key starts one-touch automatic calibration. From the normal weighing mode, with nothing on the weighing pan and the balance level, press the CAL key and calibration will be performed automatically.

CODE NO. Key



CODE NO. key > <N > > ENTER k key O The FUNC :>

combination digitally sets the code number that will be transmitted (via RS-232C) at the next data-out operation. 10key numbers are entered to the left up to 6 digits. The maximum number allowed is 999,999. Please see Parameter setting "Code c2" page G-8.

Example: |FUNC|

CODE NO.

key

1234No

1 2 3 4 FUNC

the balance will enter code number '001234'.

TARGET Key



TARGET key > <N > > ENTER O The FUNC

combination digitally sets the target weight to stop the optional AD-1651 Spoon Feeder. There will be an error if the entered value is over the balance capacity.

Example: FUNC & TARGET key > 2 > ENTER &

216

the balance will enter 2g as the target weight (if "g" unit weight is being used).

START / H. LIMIT Kev



☐ The START key starts the optional AD-1651 Vibrating Spoon.



O The FUNC |R| > H. LIMIT key > $\langle N \rangle$ ENTER |R|

combination digitally sets the comparator higher limit. A negative number is permitted and the acceptable range is from -9999999 to +9999999.

Example: | FUNC |

H. LIMIT

key

1505HI

5 0 . 5 > ENTER

the balance will enter 150.5g as the comparator's high limit (if "g" unit weight is being used).

FUNC. Key

When the FUNC key is pressed before another blue key, the balance will set what is printed in blue below the key - after waiting for you to enter a number via the 10-key, and then press the ENTER key.

 
ENTER Key

The ENTER key tells the balance to accept the number that has been entered via the 10-key, or to start an action.

FUNC. key, Plus a 10-key


Entering a number subsequent to the FUNC key allows you to easily set the "internal C-Parameter settings", "weighing units", "code strings", "date" and "time".

Func. + 1 key • Set the "C-Parameter"




MODE	Press the MODE key to select the "Parameter Group Number".
SAMPLE	Press the SAMPLE key to select the "Parameter".
ZERO	Press the ZERO key to select the "Setting Values".
PRINT	Press the PRINT key to save "C-Parameter" and return to weighing mode.
ENTER	Press the ENTER key to save "C-Parameter" and return to weighing mode.
ON/OFF	☐ Press the ON:OFF key to exit and go to "display OFF state".

 Func. + 2 key • Set the "Weighing Unit"



MODE	☐ Press the MODE key to select the desired "Unit".
SAMPLE	☐ Press the SAMPLE key to keep the selected unit.
PRINT	☐ Press the PRINT key to save the selected unit.
ON/OFF	Press the ON:OFF key to exit and go to "display OFF state".

 Func. + 3 key • Set the "Code String"




 Connect the serial interface to the balance and you can enter the code string form the 10-key pad.

☐ The code string itself must consist of six digits, including spaces or hyphens.

Example: 0 1 3 - 5

	□ The keys 0 → 9 will display the numbers 0→9. The period key . will be the "space" and the minus key - will be the "hyphen".
ENTER	☐ Press the ENTER key to save the code string and return to weighing mode.
ON/OFF	☐ Press the ON:OFF key to exit and go to "display OFF state."

 Func. + 4 key • Set the Date




O The date is set in YY-mm-dd (or other depending on the setting 'Date Order' "dAtE 5c2" using the 10-key pad. Enter flashing digit as it moves to the right.

MODE	Pressing the MODE key moves a blinking digit to the right.
	☐ The keys 0 → 9 will display the numbers 0→9.
ENTER	Save the date and return to weighing mode.
PRINT	Save the date and return to weighing mode.
ON/OFF	☐ Press the ON:OFF key to exit and go to display OFF state.

Func. + 5 key • Time



 Using the setting "Display at 'Display OFF State" "oFF 1c1" the time can be shown while the display is OFF. It can also transmitted before the weighing result via the RS-232C




MODE	☐ Pressing the MODE key moves a blinking digit to the right.
SAMPLE	☐ Pressing the SAMPLE key selects the 12-hour mode and 24-hour mode alternately.
	 The keys 0 → 9 will display the numbers 0→9. Enter flashing digit as it moves to the right. III - III T/1 Hour Minute Although the displayed time is fixed, the clock is still working.
ENTER	Save the time and return to weighing mode.
PRINT	Save the time and transmit it (exit: FUNC or - key).
ON/OFF	Press the ON:OFF key to exit and go to display OFF state.



AD-1652 Remote Code Number




The AD-1652 Remote Keyboard can be reset to a different code number if more than one balance is being used, or for what ever reason. If the number is changed on the AD-1652 Remote Keyboard, the C-Function "id 1cs" must also be changed.

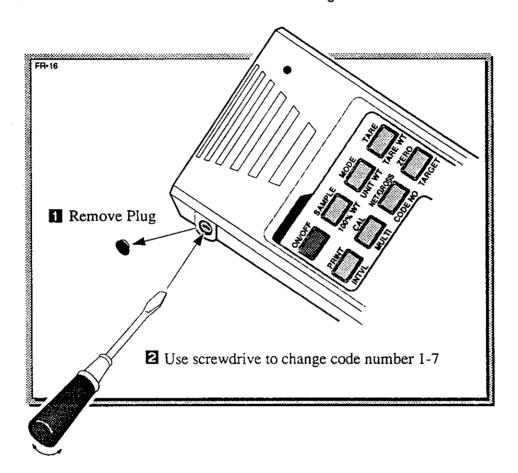

■ C8 • Others (from page G•16)


□id	X C8	ID Code for Remote Keyboard AD-	1652		
	G G	No action to Remote Keyboard	FC80:0		
14	1.	ID Code Number "1"	FC80:1		
	2	ID Code Number "2"	FC80:2		
	3	ID Code Number "3"	FC80:3		
	4	ID Code Number "4"	FC80:4		
	5	ID Code Number "5"	FC80:5		
	Б	ID Code Number "6"	FC80:6		
	7	ID Code Number "7"	FC80:7		

The factory setting is "1", ID Code Number 1

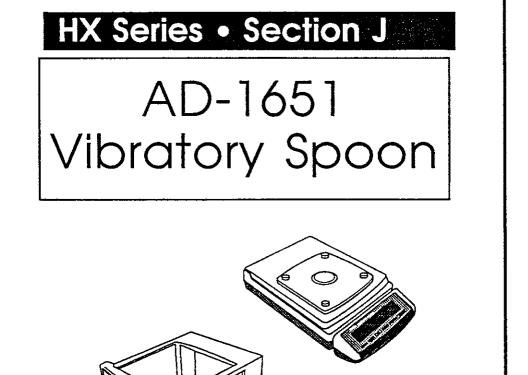



AD-1651 Vibratory Spoon

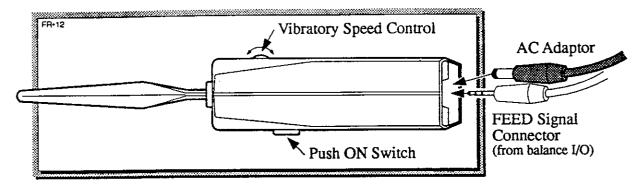

- ☐ Using the OP-05, the optional AD-1651 Vibratory Spoon makes it easy to accurately feed powders to be weighed.
- With the cable supplied with the Vibratory Spoon, connect one end to the "I/O" connection in the back of the Spoon, and the other end to the "FEEDER" connection in the rear panel of the balance.
- Since no DC power is supplied from the balance, make sure that there are batteries in the Spoon, or connect the AC Adaptor.
- The push switch operates the spoon. If a Target Weight has been set (via AD-1652 Remote Keyboard or RS-232C), the spoon will stay ON until the limit is reached: unless a STOP signal is sent (see next page).

Target Weight

- ☐ To set, see next page. The target weight will be the weighing unit last seen on the balance display as you go into the setting mode. Later, if you change the weighing units, the target weight will also be converted. For example: the target weight of 10g is displayed as 50 ct in carat mode.
- ☐ If the unit weight (cnt) or 100% weight (%) is not registered in cnt/Pct mode, the target weight shows zero. However, after the registration, target weight is converted to each unit.
- You cannot set the target weight over the capacity.

Notes on Feeding Accuracy

- O Feeding accuracy may be decreased by the following:
 - a) Flow rate changes due to the AD-1651 Spoon angle changing.
 - b) Free Fall weight (weight of airborne sample) changes due to AD-1651 Spoon being too high above the weighing pan.
 - c) Sample is not uniform.
 - d) Flow rate is too large for the target weight.
 - e) Flow rate is too small (display changes slowly on average).
 - f) Display is not in high-speed mode (see 'Display Refreshing Rate' "Speed 1c1").



Setting (or Viewing) Target Weight





Press the FUNC key, p

40000TG

 Any previously set value will be displayed, in this

 
example: 4q.




If you are just viewing the Target Weight, or want to exit without saving any changes, press the FUNC k key again.







 ▶ Use the 10-key pad to display value to be entered.



O In this example: 3 | . | 5 keys. or 3.5a.





Press the ENTER key to enter.






- O The display will return to where you left it.
- See START/STOP SPOON FEEDING sections, next page.

(or Viewing) Target Weight

Ex 1. СŢ G T

Request the balance to send the target weight presently set.

 ☐ For example if the balance has 2g set as the target weight, then it will send:



Ex 2. G 4 0 СĽ g

Set a new target weight (ex: 4g).

СĽ 4 G 0 Ζ 0

Set a new target weight (ex: 4oz).

To START Spoon Feeding



Press the AD-1651 Vibratory Spoon button.







Press the START key on the AD-1652 Remote Key-board.







Send a 'FEED' command via the RS-232C.

To STOP Spoon Feeding



Spoon feeding stops when the display is near the target weight; or when the display becomes stable, even though under the target weight.



 




Press the STOP key on the AD-1652 Remote Keyboard.








Send a 'STOP' command via the RS-232C.

To Re-START Spoon Feeding


- ▶ If the display is under the target weight, you may restart by any of the methods in the To START section above.
- ▶ If the display is over the target weight, you must press the button on the AD-1651 Spoon to restart.

Connector Hook-up

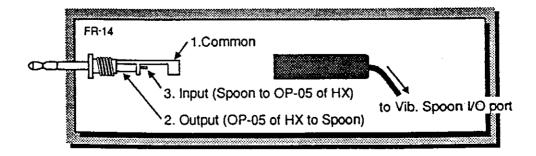

HX Series • Section K

RS-232C Serial Interface

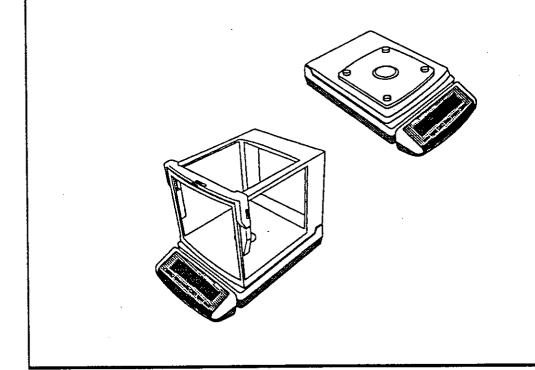

Specifications

Type EIA-RS-232C

Method Asynchronous Transmission, Bi-directional.

Format Baud rate: 600, 1200, 2400, 4800 and 9,600 baud. Rates user selectable.

Data bit 7 or 8.

Parity Even/Odd (data 7 bit)

None (data 8 bit).

Stop bit 1 or 2

Code ASCII.


RS-232C	20mA Cur. Loop
1 = -5V → -15V	20mA
0 = +5V → +15V	0mA

	- 1	SB 0	1	2	3	4	5	MSB 6					
		Ł							A	₹_	——— — Sto	p Bit	
Star	ı t Bit			Da	ata Bi	ts			LF	arity	Bit	, P	

Computer Connection


- ☐ The HX is designated as DCE (Data Communication Equipment).
- Please confirm that proper conditions have been met before connecting equipment. Refer to connection equipment's manual.
- The connecting cable should be of a high quality. For example: NEC PC-8895, Epson cable set #705, #724.

RS-232C Pin Connection

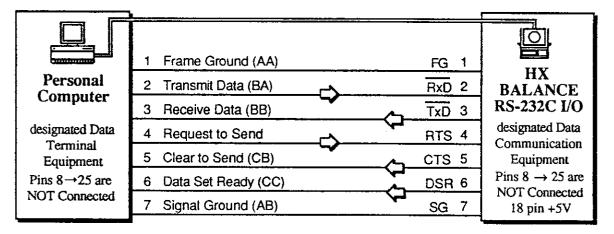

- □ No connector or connector covers are provided with this option.
- ☐ Use a high quality modem type cable between the computer and balance.
- ☐ AD-8121 is supplied with a cable for connection to the balance.

Circuit Diagram

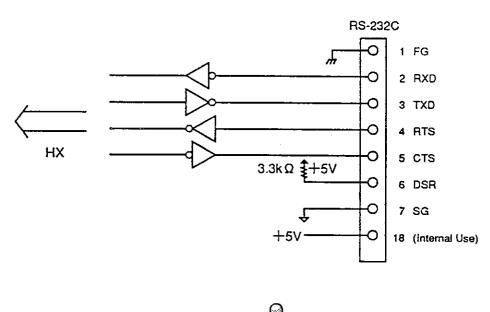

Other pin numbers for the RS-232C or Current Loop interfaces are not connected.





There are five modes to handle the transmission of weighing data, they are:

PRINT Key A or B Mode. Sends Data when panel (or AD-1652

remote) PRINT key is pressed.

☐ Auto Print A or B Mode. Data is automatically sent when the

display become stable, and other user

set conditions are met.

☐ Stream Mode. Data is sent continuously.

☐ Output by Command. Data output is initiated by a request

from an external computer or device.

☐ Timed Mode. Data is sent at user set time intervals.

PRINT Key Mode (when PRINT key is pressed)

☐ Print 0 c 2

PRINT Key A Mode: PRINT key command accepted only if the display is stable. The display will blink when data is transmitted.

☐ Print 1 c 2

PRINT Key B Mode: PRINT key command accepted and output if display stable. The display will blink when data is transmitted.

Auto Print Mode

☐ Print 2 c 2

Auto Print A Mode: Data is output if display is over the 'Auto Print Band' "AP-b c2" setting and stable, data is output once. Polarity is set by "AP-P c2" •Next transmission is done after the display falls below the selected band

☐ Print 3 c 2

Auto Print B Mode: Data is output when the difference between the display and the last transmitted data is over the 'Auto Print Band' "AP-b c2" setting and stable, data is output once. Polarity is set by "AP-P c2".

Next transmission is done after the display falls below the selected band

Stream Mode ☐ Print 4 c 2 Stream Mode: Data output is continuous. ☐ In this mode weighing data is transmitted continuously. The display does not blink when data is output, and the PRINT key is ignored. Output by Command ☐ Weighing data output is controlled by commands from an external computer, or similarly equipped device. Various commands controlling the balance are listed on pages K•14 →20. [Data output by a command is enabled in any of the key mode, auto print mode, and stream mode.] Timed Mode (Interval Data Output) Data is transmitted at the time interval set by the AD-1652 Remote Keyboard or by an RS-232C command: ☐ The interval output can be started only in the PRINT Key or Auto Print Oc2 thru 3c2"). When not using the interval output, the modes ("Print |PRINT| Key or Auto Print modes work normally. The balance also transmits data one time when the interval timer is

☐ The interval timer stops if you move from the weighing mode to another

☐ To stop the interval timer, press the PRINT key on the front panel, or the AD-1652 Remote Keyboard or P R T command via the RS-232C.

Data output by a command is enabled in any of the key mode, auto print

started and stopped.

mode, and stream mode.

☐ The display will blink when the data is transmitted.

mode - including display OFF or the calibration mode. ☐ While the interval timer is ON, the (❤) mark is displayed.

Sample Computer Programs

IBM PC-AT (STREAM Mode)

☐ Balance parameters set to:

```
Print
        4.C2
                 (STREAM Mode)
        0.C2
                 (no time data)
t-out
        0.C2
CODE
                 (no code number)
PAUSE 0.c2
                 (no pause)
bPS
        3.c3
                 (4800 bps)
PAr
        0.c3
                 (parity even)
bit
        0.c3
                 (data bit 7)
Cr-LF
        0.c3
                 (terminator <CR><LF>)
tYPE
        0.c3
                 (A&D Standard Format)
dΡ
        0.c3
                 (decimal point 2EH)
     OPEN "COM1:48ØØ,,,,CS" AS #1
1Ø
2Ø
     LINE INPUT #1,DT$
3Ø
     INPUT #1, HD$, DT$
4Ø
             IF HD$<>"OL" THEN GOTO 6Ø
5Ø
     DT$="
                 "+LEFT$ (DT$,1)+"E":GOTO 8Ø
6Ø
             IF HD$<>"US" THEN GOTO 8Ø
7Ø
     DT$=LEFT$ (DT$, 9)
8Ø
     PRINT HD$,DT$
9Ø
     GOTO 3Ø
1ØØ END
```

IBM PC-AT (Output by Command)

☐ Balance parameters set to:

```
Print
        0.C2
                 (Key A Mode)
bPS
        3.c3
                 (4800 bps)
PAr
        0.c3
                 (parity even)
bit
        0.c3
                 (data bit 7)
Cr-LF
        1.C3
                 (terminator <CR>)
tYPE
        0.c3
                 (A&D Standard Format)
t-UP
        0.c3
                 (timer ON)
dΡ
        0.c3
                 (decimal point 2EH)
E-Cod
        1.C3
                 (transmit error code)
1Ø
     OPEN "COM1:4800" AS #1
2Ø
     PRINT #1, "R"+CHR$(&HD)
3Ø
     LINE INPUT #1, AK$ {Reply to "R" command}
                   IF AK$<>CHR$(6) THEN GOTO 13Ø
4Ø
5Ø
     LINE INPUT #1, AK$ {End of REZERO}
6Ø
                   IF AK$="EC,EØ"
                                      THEN GOTO 14Ø
7Ø
                   IF AK$="EC,E11" THEN GOTO 15Ø
8Ø
     FOR I=1 TO 1000: NEXT I
     PRINT #1, "Q"+CHR$(13)
9Ø
```

```
100 INPUT #1, HD$, DT$

110 PRINT HD$, DT$

120 GOTO 80

130 PRINT "BALANCE NOT READY!":CLOSE:END

140 PRINT "COMMUNICATION ERROR!":CLOSE:END

150 PRINT "ERROR 1...BALANCE NOT STABLE!":CLOSE:END
```

■ NEC PC-9801

☐ Balance parameters set to:

```
(Key A Mode)
Print
          0.C2
bPS.
          3.cs
                   (4800 bps)
PAr
                   (parity even)
          0.c3
bit
          0.C3
                   (data bit 7)
                   (terminator <CR><LF>)
Cr-LF
          0.C3
                   (A&D Standard Format)
tYPE
          0.c3
                   (timer ON)
t-UP
          0.C3
                   (decimal point 2EH)
dP
          0.c3
E-Cod
                   (transmit error code)
          1.C3
```

- 1Ø OPEN "COM: E73 NN" AS #1 {NN=PC-9801 BASIC dialect}
- 2Ø PRINT #1, "R" {RE-ZERO the balance}
- 3Ø LINE INPUT #1, AK\$ (Return <AK>)
- 4Ø IF AK\$<>CHR\$(6) THEN *ERROR (If ERROR, "EC,E¥X" is received)
- 5Ø LINE INPUT #1, AK\$ (End of REZERO)
- 6Ø IF AK\$<>CHR\$(6) THEN *ERROR
- 7Ø FOR I=1 TO $1\emptyset\emptyset\emptyset$: NEXT I {Delay after <AK> received}
- 8Ø PRINT #1, "Q" (Question the balance)
- 9Ø INPUT #1, HD\$, DT\$ {Receive the data strings}
- 100 PRINT HD\$, DT\$ (Display the data strings)
- 11Ø CLOSE
- 12Ø END (Stop)
- 13Ø *ERROR
- 14Ø PRINT "ERROR HAS OCCURRED"
- 15Ø CLOSE
- 16Ø END



Weighing Data Formats



Some weighing data output is formatted according to how 'tYPE c3' (Data Format, see page G•10) is set. This parameter allows for three types of data formats:

1) A&D Standard Format Adapted for peripheral instruments made

by A&D, such as the AD-8121 printer

(tYPE 0c3).

2) **DP Format** Adapted for A&D's AD-8121 printer (MODE

3) (tYPE 1c3).

3) KF Format Adapted for Karl-Fischer moisture tester

which cannot communicate by A&D

Standard Format (tYPE 2c3).

A&D Standard Format

Adapted for peripheral instruments made by A&D, such as the AD-8121 compact printer.

- ☐ Header of two characters indicate the status.
- ☐ Data with a polarity symbol, including the leading zeros.
- ☐ Unit code of three characters.
- One data set consists of fifteen characters (excluding terminator).

DP Format

Adapted for A&D's AD-8121(MODE 3) printer.

- Header of two characters indicate the status if not overloaded.
- ☐ Data with a polarity symbol, but omitted if data is zero.
- Leading zeros replaced by spaces.
- One data set consists of sixteen characters (excluding terminator).

KF Format

Adapted for Karl-Fischer moisture tester, which cannot communicate by A&D Standard Format.

 
- No header in data.
- Polarity symbol as the first character if not over-loaded, but omitted if data is zero.
- ☐ Leading zeros replaced by spaces.
- Unit code 'g' is transmitted only if stable and weighing in gram unit.
- One data set consists of thirteen characters (excluding terminator).

 
Weighing Data Format Examples



Space code is noted as (20H) in the following examples.

Stable Data Examples





	1	2	3	4	5	6	7	8	9	10	11	12	13	14	15	16	17
A&D Std.	S	Т	,	+	0	0	0		0	0	0	0	(20H)	(20H)	g	ट्रा	
DP	W	Τ	(20H)	(20H)	(20H)	(20H)	(20H)	0		0	0	0	0	(20H)	(20H)	g	द्रा
KF	(20H)	(20H)	(50H)	(50H)	0		0	0	0	0	(20H)	g	(20H)	वी			

Example: display="100.5678g":




	1	2_	3	4	5	6	7	8	9	10	11	12	13	14	15	16	17
A&D Std.	S	Τ	,	+	1	0	0	•	5	6	7	8	(20H)	(20H)	g	ជា	
ĎР	W	Т	(20H)	(20H)	+	1	0	0	•	5	6	7	8	(20H)	(20H)	g	ट्य
KF	+	(20H)	1	0	0		0	0	0	0	(20H)	g	(20H)	ជា			


Example: display="0 cnt":




	1	2	3	4	5	6	7	8	9	10	11	12	13	14	15	16	17
A&D Std.	α	T	,	0	0	0	0	0	0	0	0	0	(20H)	Р	С	ជា	
BP	a	Τ	(20H)	(20H <u>)</u>	(20H)	0	(20H)	Р	С	ट्रा							
KF	(20H)	(20H)	(20H)	(20H)	(20H)	(20H)	(20H)	(20H)	(20H)	0	(20H)	(20H)	(20H)	ជា			

  Example:display="345678 cnt":






Unstable Data Example

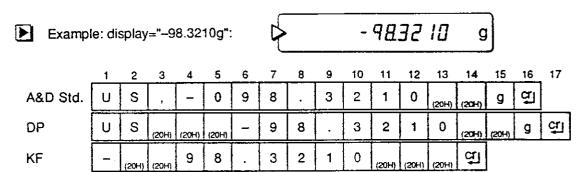

Overload Data Examples

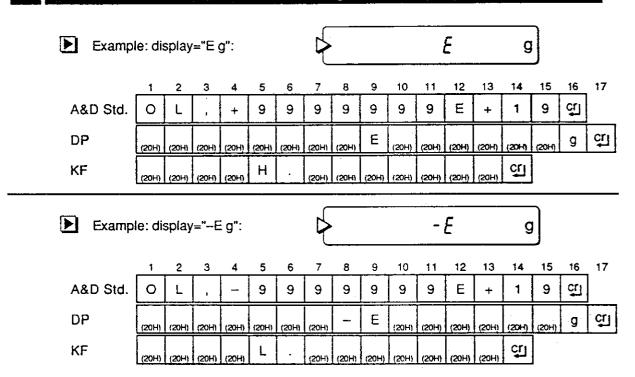

Unit Codes Examples

A&D Standard & DP

Gram	(g)
Percent	(pct)
Count	(cnt)
Decimal Ounce	(oz)
Troy Ounce	(OZt)
Pennyweight	(dwt)
Carat	(ct)
Momme	(mm)
Grain Unit	(GN)
Tola	(t)
Tael	(TL)

اپ تا.	and	aiu o
(20H)	(20H)	g
(20H)	(20H)	%
(50H)	Р	C
(20H)	0	z
0	z	t
d	w	t
(20H)	С	t
E	0	m
(20H)	G	N
(20H)	(20H)	t
(20H)	T	L

	KF		
(20H)	g	(20H)	
(20H)	(20H)	(20H)	
(20H)	(20∺)	(20H)	
(20H)	(20H)	(20H)	



Independent Data Formats



Some data formats are independent of how parameter 'tYPE c3' is set. •Space code is noted as (20H) in the following examples.


Code Number

The code number itself must consist of six digits.


1	2	3	4	5	6	7	8	9	10	11
N	0	-	(SOH)	0	1	2	3	4	5	ដា

Code String

 ☐ The code string itself must consist of six digits, including spaces or hyphens.



Time

 


Date

☐ The order of the date, yy-mm-dd, depends on how parameter 'dAtE c2' is set.

•	_	_		5	-	-	-							
D	Α	Ţ	Ε	(20H)	9	2	_	0	2	_	2	8	딝	

Parameter Setting

- \Box (n) = the parameter group number 0 though 8.
 - (m) = the parameter number.
 - (i) = the parameter name (5 characters)
 - (v) = parameter setting value

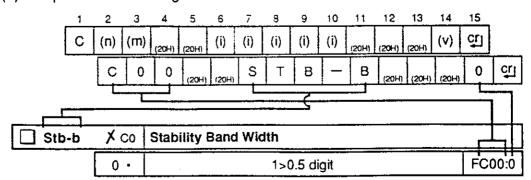

Commands for the RS-232C Serial Interface



Please note that there needs to be a delay time between a balance acknowledgement <AK>, and the transmission of the next command to the balance. The FOR~NEXT loop times depend on your computer's operating clock and performance. Make the FOR~NEXT longer if the program does not work correctly.

For an example, using a BASIC program:

1			
123	LINE INPUT #1, AK\$		Receive <ak></ak>
124	FOR I=1 TO 100:NEXT	I	Delay
125	PRINT #1, "Q"		TX: 'Q' command
1			

- ☐ If the ERROR CODE AT COMMAND MODE parameter is set at '0' (E-Cod 0c3), then the balance transmits no error codes nor acknowledgement code <AK> (ASCII 06H).
- ☐ If the ERROR CODE AT COMMAND MODE parameter is set at '1' (E-Cod 1c3), then when the following commands are accepted by the balance: 'P', 'ON', 'R', 'T' or 'TARE', 'Z', 'CAL', 'EXC', 'SMP', the HX transmits the acknowledgement code <AK> (ASCII 06H).

It will send not only after the command is received, but also after the command is executed. If the command can't be executed, then the HX sends various codes to inform the host computer.

- ☼ Space code is noted as (20H) in the following examples.
- 1) ? # Request the Code Number

Send	?	#	ជា								
Reply	N	٥		(20H)	1	2	3	4	5	6	tî

2) ? \$ Request the Code String

Send	?	\$	ᄗ									
Reply	С	0	D	Ε	(20H)	1	2	3	1	5	6	ជា

- 3) ? % Request the 100% Weight
 - ☐ The balance reply is the weighing unit used last. If the balance is in Percent or Count mode, the reply is in grams (g).

Send	?	%	លា												
Reply	%	W		+	1	2	3	4	5	6	7	(20H)	(20H)	g	ដា


4) ? @ Request the Unit Weight

☐ The balance reply is in the weighing unit used last.

Send	?	@	ជា													
Reply	U	W	,	+	0	0	0	0	0	•	1	2	(20H)	m	g	ដា


5) ? A L L Request All User Defined Parameters


☐ 10 sets of data will be sent by the balance in reply.

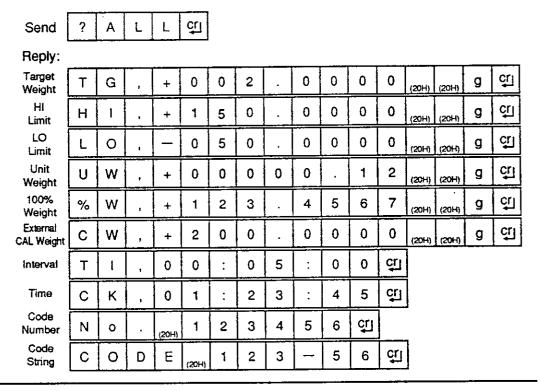

6) ? C (n) (m) Request a Parameter Setting

☐ You must specify the parameter group number (n) and parameter number (m). See PARAMETER SETTING.

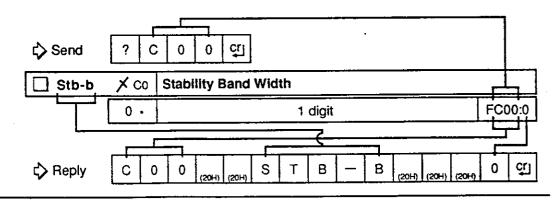

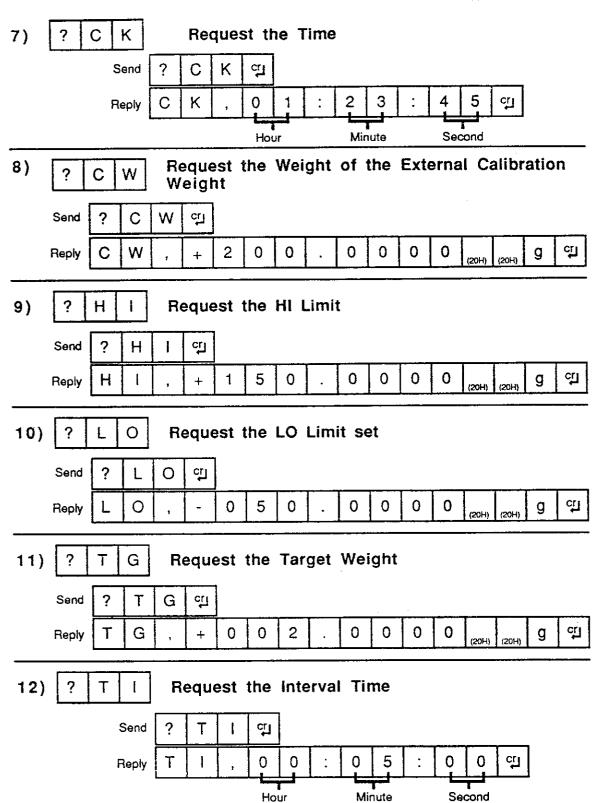

13) ? U Request the Balance's Present Weighing Unit
The balance reply is in the weighing unit used last. Send ? U Reply P C Reply (20H) P C P
14) # Set the Code Number
The balance will error if '-' or '.' are included. Code doesn't # 1 2 3 4 5 6 c
need to have exactly six digitsor- Send # 1 2 3 c
15) \$ Set the Code String The code string must be six Send & R R R R R R R R R R R R R R R R R R
digits including '-' or a space.
All weighing units are acceptable. If the weighing unit code is omitted, the balance assumes you want the last weighing unit used. If you are in Percentage mode and the weighing unit code is omitted, then gram (g) is assumed. •The balance will error if: 1) The value is over the capacity; 2) The value is negative; 3) The value is less than 100 digits. Example: Send % 1 0 . 1 2 CT if in carat mode, then 10.12ct if in ounce mode, then 10.12cz
17) @ Set the Unit Weight
All weighing units are acceptable. •The balance will error if: 1) The value is over the capacity; 2) The value is negative; 3) The value is less than 10 digits;
Send @ 0 . 1 2 3 (20H) (20H) g CT
or Send @ 0 . 1 2 3 cri balance assumes 'g' if the
unit "g" is used
18) C Release the SIR See the SIR command that follows.
19) C A L Perform Calibration Same as pressing the CAL key.

20)	C K To Adjust the Clock Send: <hour>:<minute>:<second>.</second></minute></hour>
	Send C K 0 1 : 2 3 : 4 5 대
	Hour Minute Second
21)	C W To set the External Calibration Weight
۵	All weighing units are permitted. If the weighing unit is omitted, the balance will assume the present weighing unit. If in percent, or counting, then weighing unit will be grams (g). Example:
	Send C W 2 0 0 . 0 0 1 2 대
	External Calibration weight would be registered as +200.0012g (balance was in grams). The balance will error if: 1) The value was over capacity; 2) The value was negative; 3) The value was less than half of capacity.
22)	E X C Go to External Calibration Go See MANUAL CALIBRATION section, page C•4.
23)	F C To change a Parameter Setting Send <fc><nm>:<v>, the parameter section and parameter number, and setting.</v></nm></fc>
	(n) = the parameter group number 0→8. (m) = the parameter number. (v) = parameter setting value F C (n) (m) : (v) cg
	Send F C 2 5 : 0 प्रा is set at '0', No Code Number:
	☐ COde X c2 Send Code Number
	0 No Code Number FC25:0
24)	F E E D Start feeding by the AD-1651 Vibratory Spoon
25)	H I To set the HI Limit
٦	All wighing units are permitted, including a negative value. If the weighing unit is omitted, the balance will assume the present one. If in percent, or counting.
	Send H I + 1 5 0 . 5 (20H) (20H) g CL

.*45

26)	L I S T Request a listing of the Parameter Settings		
	A list of the 42 parameters will be sent by the balance. Example:		
	Send L I S T CT		
	Reply C 0 0 con (20H) (20H) S T B - B (20H) (20H) 0 CT		
	Format (20H) (20H) (20H) (20H) (20H)		
	Stb-b × Co Stability Band width		
	0 • 1 digit FC00:0		
27)	L O To set the LO Limit		
	All weighing units are permitted. A negative value is permitted. If the weighing unit is omitted, the balance will assume the present weighing unit. If in percent, or counting.		
	Send L O - 1 0 0 . 5 CI		
28)	O F F Display OFF mode No change if already in Display OFF mode.		
29)	29) O N Go to Display ON mode O No change if already in Display ON mode.		
30)	P Display ON/OFF • The same as pressing the ON:OFF key.		
31)	PRT Print The same as pressing the PRINT key.		
32)	Question the balance for Weighing Data Balance will send the weighing data immediately.		
33)	R RE-ZERO The same as pressing the RE-ZERO key.		
34)	R E A D Read the balance Weighing Data D Balance will send weighing data immediately (same as 'Q').		
35)	S Send Stable Data Display will blink when data transmitted.		
36)	Send Weighing Data Immediately Balance will send the weighing data immediately (same as 'Q').		

37)	S I R Send Immediately the Weighing Data & Repeat Balance will send the weighing data immediately with continuous transmission (like a stream mode) until the 'C' command is received.
38)	S M P SAMPLE The same as pressing the SAMPLE key.
39)	S T O P Stop the AD-1651 Vibratory Spoon
40)	T TARE the balance The same as pressing the RE-ZERO key.
41)	T A R E TARE the balance (same as above)
42)	T G Set the Target Weight
٥	All weighing units are acceptable. If the weighing unit code is omitted, the balance assumes you want the last weighing unit used. •The balance will error if the value is over the capacity.
	Send T G 2 . 0 0 0 0 0 (20H) (20H) g C[]
43)	T I Set the Interval Time
	The value must be in the range of '00:00:00' to 24:59:59. Example of a 5 minute setting:
	Send T I 0 0 : 0 5 : 0 0 cr
44)	U Change the Internal Setting Monitor(*) The same as pressing the MODE key.



Error Codes for the Serial Interface



In the Command mode, the computer may receive an error code from the balance if the software parameter 'E-Cod c3' is set at '1' Also:

4	the balance if the software parameter 'E-Cod c3' is set at '1' Also:
a	In the case the Command requests the weighing data, ex: the 'Q' command: then: 1) If there is no error, then the balance sends the data; or 2) If there is an error, then the balance sends the error code.
	In the case the Command is not a request, ex: 'HI' command: then: 1) If there is no error, then the balance sends <ak> (06H) code; or 2) If there is an error, then the balance sends the error code.</ak>
	To raise the reliance of the RS-232C communication, the balance replies to all commands.
	The format of the error codes is:
	E C , E <n> ਪ੍ਰੀ <n> standing for the error number</n></n>
Ξ0	Communication Error Parity error, framing error, etc.
Ξ1	Undefined Command Error
Ξ1	Undefined Command Error Example: ? h i cp The command must be in uppercase – 'HI'
Ξ1 Ξ2	☐ Example: 2 h i g The command must be
Ξ1 Ξ2	D Example: ? h i प्र The command must be in uppercase – 'HI'
Ξ1 Ξ2	☐ Example: ? h i ☐ The command must be in uppercase — 'HI'
Ξ1 Ξ2 Ξ3	☐ Example: ? h i ☐ The command must be in uppercase — 'HI' Balance not ready Error ☐ If the display is OFF, then only 'P' and 'ON' commands accepted. ☐ Data request commands (such as 'Q', 'S' commands) cannot be
Ξ1 Ξ2 Ξ3	☐ Example: ? h i ☐ The command must be in uppercase — 'HI' Balance not ready Error ☐ If the display is OFF, then only 'P' and 'ON' commands accepted. ☐ Data request commands (such as 'Q', 'S' commands) cannot be accepted if the balance is not in the weighing mode.
Ξ1 Ξ2 Ξ3	Balance not ready Error If the display is OFF, then only 'P' and 'ON' commands accepted. Data request commands (such as 'Q', 'S' commands) cannot be accepted if the balance is not in the weighing mode. Time Over Error The command must be in uppercase – 'HI'
Ξ1 Ξ2 Ξ3	Balance not ready Error If the display is OFF, then only 'P' and 'ON' commands accepted. Data request commands (such as 'Q', 'S' commands) cannot be accepted if the balance is not in the weighing mode. Time Over Error The balance couldn't receive the next character in 1 second after the last character was received.

Section K page K • 20 instruction-HX-v.2.a

E5 1	Terminator Error
	☐ The command contains an illegal terminator.
E6 1	Format Error Examples: T 1 0 0 : 1 0 º: - missing Seconds L O - 1 0 G G - unit must be '_g' for gram (not capitalized)
E7 (Out of Range Error Example: - must be within balance capacity
E11	Stability Error Balance display shows Error ! The balance takes more than 30 seconds to ZERO.
E12	Stability Error
E13	Invalid Value Error Dalance display shows Error 3 D Value entered by the AD-1652 RK is out of the range permitted for the function (example: TW 400g is out of the TARE range). To return to weighing mode, press any key.
E14	Weighing Pan Error ☐ Balance display shows Error ☐ ☐ The weighing pan touching something, or there is something on the pan when the ON:OFF key is pressed.
E15-	→17 Internal Error □ Balance display shows Error 5→6 □ Disconnect the AC adaptor, wait a few seconds and try again. If the error persists, call your dealer for service.
E20	Calibration Error Dalance display shows [RL E Dalance disp

E21	Calibration Error	☐ Balance display shows	- [RL E
	☐ Calibration weight is	s too light.	
E22	Calibration Error Balance unstable d	☐ Balance display shows luring calibration.	[AL no
E33		rror 🗅 Balance display sho	ws Lo
	Individual sample w	veignt too iignt.	

Command Examples Illustrated



The following examples illustrate the interaction between the host computer and the HX Balance during RS-232C Serial Interface communication.




Please note that there needs to be a delay time between a balance acknowledgement <AK>, and the transmission of the next command to the balance. The FOR~NEXT loop times depend on your computer's operating clock and performance. Make the FOR~NEXT longer if the program does not work correctly.

□ For an example using a BASIC program:

```
1..


123 LINE INPUT #1, AK$ Receive <AK>
124 FOR I=1 TO n:NEXT I Delay
125 PRINT #1, "Q" TX: 'Q' command
```

Where n = a value ~ 100, 1000, 5000 that will set the computer to wait for about one second.

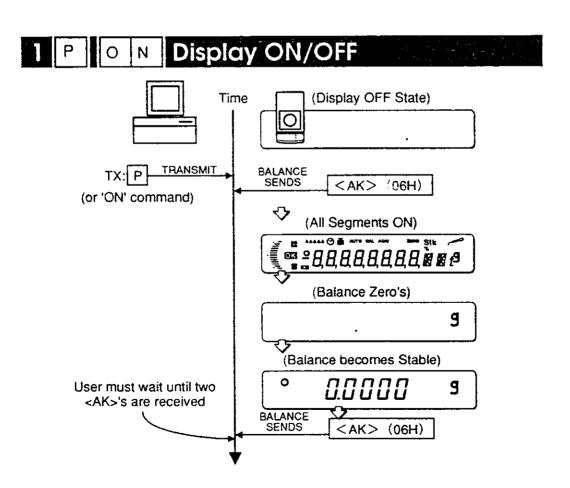


 ${}^{1}\cdot,\cdot$


2 R T T A R E ReZero or Tare

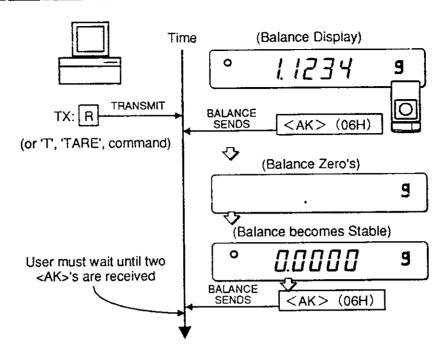


3 C A L Calibration

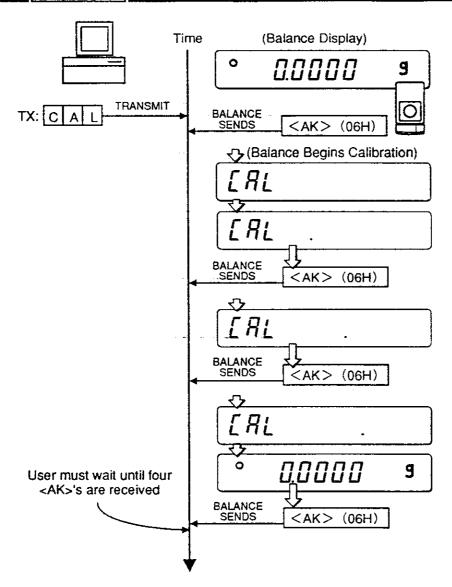


4 E X C Manual Calibration Command

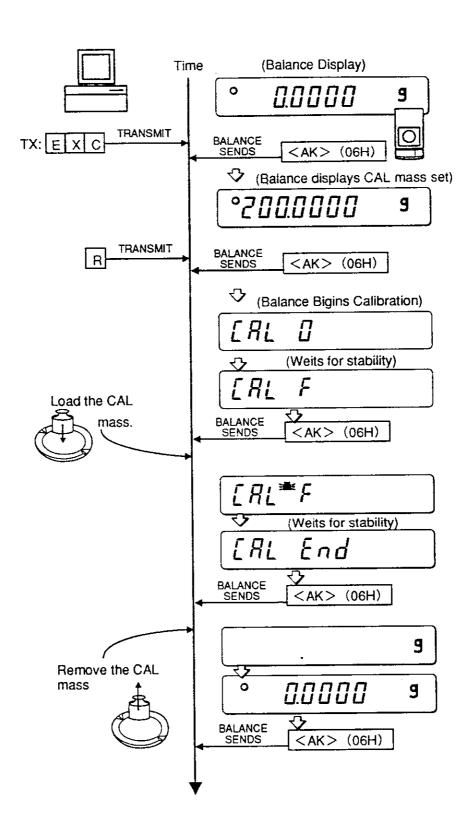

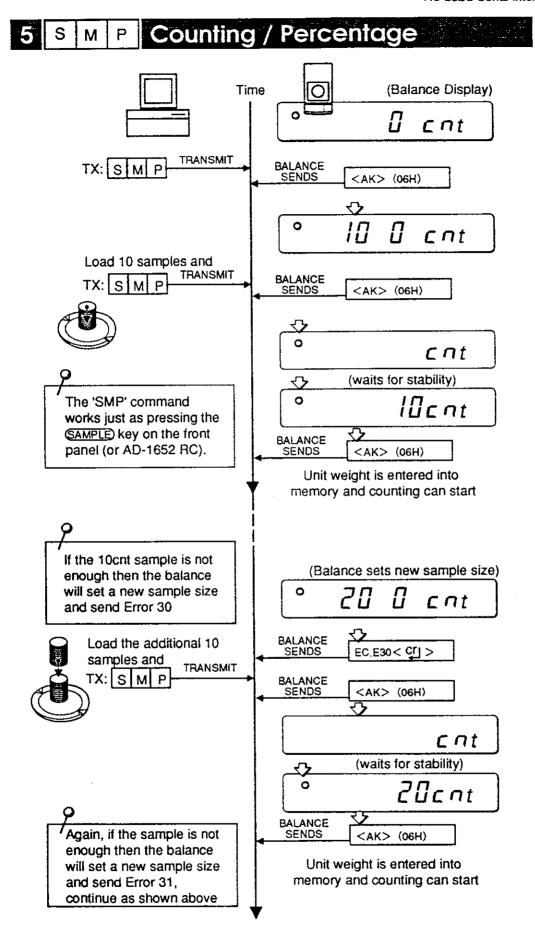

HX Series • Section L

Comparator Current Loop (part of OP-04)

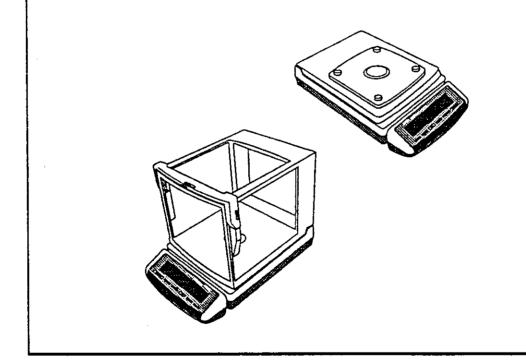





There are 3 methods for setting of HI/LO limits (See "Setting HI/LO limits" on page L-3, or Next page).

The comparator mode indicates whether the sample is too heavy or too light. This function is convenient for a product weight check, and so on. Select the internal setting "[P-d] | c6."

When the HI/LO limits are set		
Too heavy	Indication	"+" illuminated
Accepted	Indication	"OK" illuminated
Too light	Indication	"-" illuminated


[The marks "+", "OK", and "-" are used to indicate the judgment results. When entering a set value or selecting a set value for internal setting, "H [", [[a", "and "La" represent "+", "OK", and "-", respectively.]

[A buzzer can be sounded to inform you of the "too heavy", "accepted", and "too light" judgments. (Refer to Internal Setting)]

When either the HI or Lo limit is set		
Too heavy	Indication	"+" illuminated
Too light	Indication	"-" illuminated

Connecting the option OP-04 (comparator output board) allows you to output the judgement results to the external devices such as AD-8951.

Pin Connection and Specifications

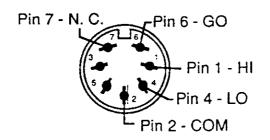

Pin 1 - HI
Pin 2 - COM
(Pin 3 - LOOP)
Pin 4 - LO
(Pin 5 - LOOP)
Pin 6 - GO
Pin 7 - N. C.

Specifications: Max. Voltage 50V DC Max. Current 200 mA

Setting HI / LO Limits

There are the following three ways to set the HI limit and Lo limit.

Actually, prepare the samples for the HI limit and Lo limit, and make the balance memorize their respective set values. (Only one kind of sample is required when making either judgment whether too heavy or too light.)



You may set or view the HI/LO limits using the AD-1652 Remote controller, or via the serial interface. Also:

- ☐ If the weighing unit is changed, the HI/LO limits are converted to the unit displayed. For example: if the HI limit is 10g, if the unit is changed to carats, then then HI limit will be displayed as 50ct.
- If the unit weight or 100% weight is not registered in cnt/%mode, then the HI/LO limits will show zero. But after registration, the HI/LO limits are converted into each consecutive unit.
- The maximum HI/LO limits are limited to seven digits, -9999999 to +9999999.

Setting HI Limit and LO Limit

- Setting of the HI limit and Lo limit is performed with the unit presented on the display. (An RS-232C command allows you to set those values with the unit which is not presented on the display.)
- ☐ When the unit is changed after setting the HI limit and Lo limit, the limits are converted into the new unit. When the unit is swithced from "g" to "%", they are converted into "%", if the 100% weight has been set.
- The maximum number of digits for the HI and Lo limit is 7 digits (-9999999 to +9999999).




Select the internal setting "[P-d / C6."







- E Keep pressing the SAMPLE key for about seconds in weighing display state.
- O "-----HI" is displayed. "HI" indicates that the set value is the HI limit.
- ⚠ "-----HI" is displayed for about 2 seconds. After that, you will be returned to the weighing state automatically.

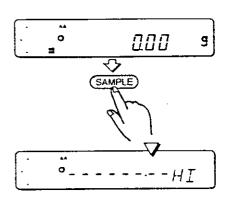

 O If the HI limit has been set and left intact, that



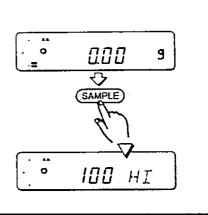

When Previous Set Value Is 100g.

 
----HI" is displayed, and if you press the MODE key immediately, "-----La" is displayed. Pressing the MODE key again displays "----- Ti" Pressing the MODE key again returns the display to "- - - - - - - H [" In the comparator mode




 
Prepare actual samples coresponding to the HI limit and Lo limit and, and set them sequentially. In the following, you set the HI limit and Lo limit. When you want either judgment whether too heavy or too light, however, set either HI limit or Lo limit.


- In the weighing display state, press the SAMPLE key about 2 seconds.
- O "-----HI" is displayed about 2 seconds.
- Press the RE-ZERO key immediately.

- O The display changes and the weight mark (♣) blinks.
- 3
- Place the sample on the weighing pan for the HI limit.
- O The variable for the HI limit "HI" is displayed.
- 4
- To save the value, press the SAMPLE key.
- O The blinking weight mark "♣" disappears, and the HI limit is saved.
- O If the HI limit value is left intact about 4 seconds after it was saved, the display is changed to "100.00 g" automatically.



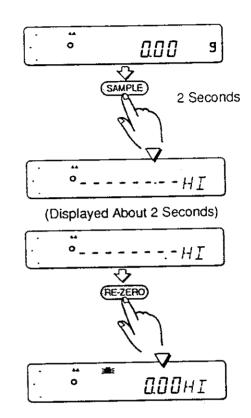





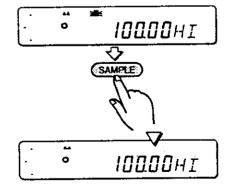



 - Set the Lo limit.
- After finishing Step 4, press the MODE key immediately (within 4 seconds).
- O "-----Lo" is displayed. (If the lower limit value was set previously, that set value will be displayed.)
- O After "-----Lo" is displayed, press the RE-ZERO key immediately.



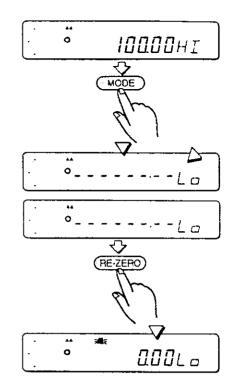




Place the sample on the weighing pan for the LO limit.



- To save the value, press the SAMPLE key.
- O The blinking weight mark () disappears and the Lo limit is saved.
- O If it is left intact, you will be returned to the weighing display state automatically.

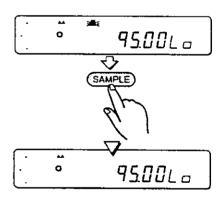

▶ When you press the SAMPLE key 0 0.00 9 in the weighing display state to $\overline{\Diamond}$ enter the comparator mode and (SAMPLE) alter the displayed HI/LO limits, About 2 Seconds press the RE-ZERO key quickly. The weight mark (■) starts blinking. 10000HI When you set new HI/Lo limits, repeat from Step 2 or Step 5, respectively. $\overline{\nabla}$ (RE-ZERO) 0 QOOHI

Using the AD-1652 Remote Controller

▶ To set HI Limit



The FUNC > H. LIMIT key > <N > ENTER key combination digitally sets the comparator higher limit. A negative number is permitted and the acceptable range is from -9999999 to +9999999.

Example: FUNC R > H. LIMIT key > 1 5 0 . 5 > ENTER R

the balance will enter 150.5g as the comparator's high limit (if "g" unit weight is being used).

 
: ° ISOSHI

▶ To set LO Limit




The FUNC > L. LIMIT key > <N > ENTER key combination digitally sets the comparator lower limit. A negative number is permitted and the acceptable range is from -9999999 to +9999999.

the balance will enter 149.5g as the comparator's lower limit (if "g" unit weight is being used).




Using the RS-232C Serial Interface

 ▶ To set HI or LO limit. A unit code of three characters must be added after the value if the HI/LO limits is in a different unit from the one presently on the display.



▶ To view HI or LO limit.

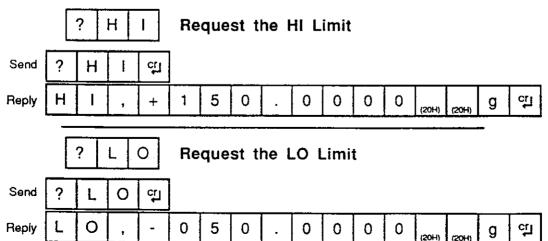


Comparator C-Parameters



There are a number of Parameters that can and need to be set. These include Comparison Mode, Comparator Output, Buzzer, etc. (see page G•14).

HX Series • Section M

Miscellaneous

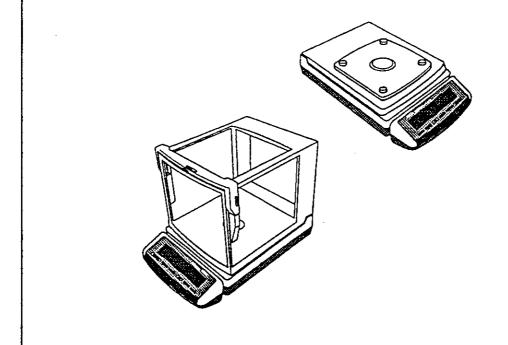

Applying the Clock Function




The Following can be enabled by making use of the built-in clock of the HX series.

☐ Outputting the time/date together with the RS-232C output data. Select the internal setting as follows:

d-out	102
t-out	102

- Outputting a weight change to the printer at constant intervals. Make use of interval output. (During output, the time mark (⋈) is illuminated on the display of the balance.)
- ▶ Press the PRINT key in the weighing display state.
- O "[] [] [] [] T [" is displayed. (Or, the interval time currently set is displayed.)

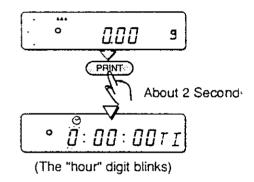

- O Pressing the MODE key moves the blinking digit to the right.
- O Pressing the RE-ZERO key increments the number in the blinking digits by 1. (The number keeps being incremented while the key is held down.)
- O Pressing the PRINT key memorizes the interval time, returns you to the weighing state, and starts outputting at every set time.
- O Pressing the ON:OFF key exits this mode and returns you to the display OFF state.
- **▶** Utilizing the remote controller AD-1652

Example:

When setting the interval output time to 10 minutes; Operate the keys in the following sequence:

FUNC key > INTVL key > 0 0 1 0 0 0 > ENTER key

This sets the interval time to 10 minutes.

■ Utilizing the RS-232C command

With the TIII command, set the interval time.

Set in the format, "hours:minutes:seconds."

"TI III:IIII" sets the interval time to 10 minutes.



OP-04 Comparator/CL. Output Board

General

OP-04 is an optional comparator output and 20 mA, passive current loop output board.

The comparator output section provides [HI], [GO], and [LO] contact outputs matched to [+], [OK], and [-] of the balance.

The current loop output section outputs the same data as the RS-232C output of the balance.

Refer to Section • K " RS-232C Serial Interface " and Section • L " Comparator/ Current Loop ".

Packing

• OP-04 Board • 7P Din Plug

Installing Procedure

Step 1

Remove the AC adaptor from the balance.

Step 2

Remove the two screws indicated by the drawing at the right, at the rear of the balance.

NOTE: Do not remove any screws other than these two screws.

Step 3

Insert the option board into the grooves of the guide


inside the balance.


When the connector is installed firmly, the option board mount will be flushed with

the balance case.

Step 4

Secure the board with the two screws previously removed.

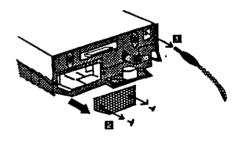


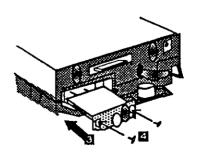

Pin Connection

Pin No.	Signal Name
1	HI
2	COMMON
3	Send Loop
4	LO
5	Send loop
6	GO
7	Not connected
Connector shell	Frame Ground

Circuit Configuration

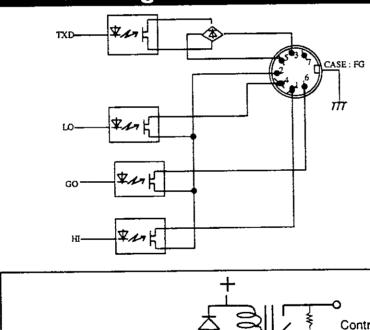

Specifications

Comparator section

Rated voltage	50 V DC	
Rated current	100 mA	
ON resistance	20 Ω Max.	
AD-8951 Comparator Light can be directly connected.		
Controlling AC voltage, use a relay.		

Current loop section

Туре	20 mA current loop (PASSIVE)	
Transmission method	Asynchronous, output only	
Signal format	Baud Rate: 600/1200/2400/4600/9600 bps Data Bits: 7/8 bits Parity: Even/Odd (Data length 7 bits) None (Data length 8 bits) Stop Bit: 2 bits Code: ASCII	
Since the current loop is the PASSIVE type, the receiving device must supply the loop current.		



OP-05 Feeder/C.L. Output Board

■ General

OP-05 is an optional feeder control and 20mA, passive current loop output board.

The feeder control section is used to connect the AD-1651, Vibratory Spoon to the HX balance.

Setting a Target Weight in the HX balance enables you to feed powder to be weighed automatically.

As OP-05 is also equipped with the general-purpose I/O terminal, the balance can be controlled by the other devices with this option.

▶ Current Loop output section outputs the same data as the RS-232C.

Refer to Section •K " RS-232C Serial Interface " and Section • J " AD-1651 Vibratory Spoon ".


Packing

□ OP-05 Board □ 7P Din Plug □ 3P Mini Plug

Installing Procedure



Remove the AC adaptor from the balance.

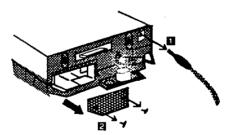



Remove the two screws at the rear of the balance, indicated by the drawing at the right.




instruction-HX-v.2.a

Do not remove any other screws.



Insert the option board into the grooves of the guide inside the balance.

When the connector is installed firmly, the option board mount will be flush with the balance case.

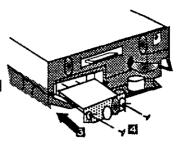




Secure the board with the two screws previously removed.

Pin Connection

3P Mini Connector	Connected to the AD-1651 Vibratory Spoon
-------------------	---

7P DIN Connector		Connected to a general-purpose Feeder input/output or a Current Loop output
Pin No. 1	Feeder output	
2	Common	
3	Current loop (Not polarized)	
4	Send a Feeder START/STOP input	
5	Current loop (Not polarized)	
6	Not connected	
7	Not connected	
Connector shell	Frame Ground	

Circuit Configuration

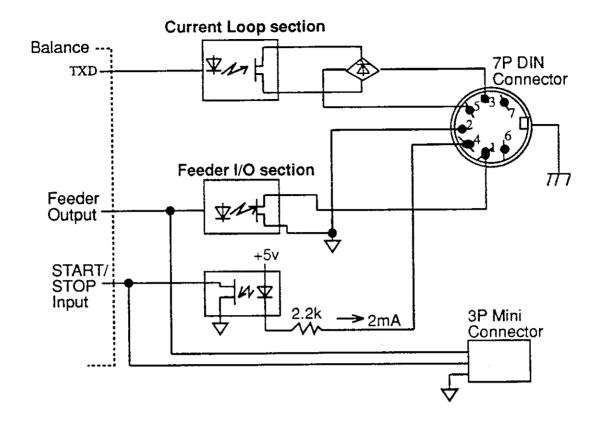

Specifications


Feeder I/O section

☐ 3P Mini Connector	Connected to the Vibratory Spoon (AD-1651)
☐ 7P DIN Connector	▶ Rated Voltage: 30 v DC
	▶ Rated Current: 30 mA
	▶ Input Pulse: 100 msec Minimum

Current loop section

☐ Type	▶ 20mA current loop (passive)	
☐ Transmission method	► Asynchronous, output only	
☐ Signal format	 ▶ Baud Rate: 600/1200/2400/4800/9600 bps ▶ Data Bits: 7/8 bits ▶ Parity: Even/Odd (Data length 7 bits), None (Data length 8 bits) ▶ Stop Bit: 1 or 2 ▶ Code: ASCII 	
	O Since the current loop is the PASSIVE type, the receiving device must supply the loop current.	

The Application of the General-Purpose I/O Terminal

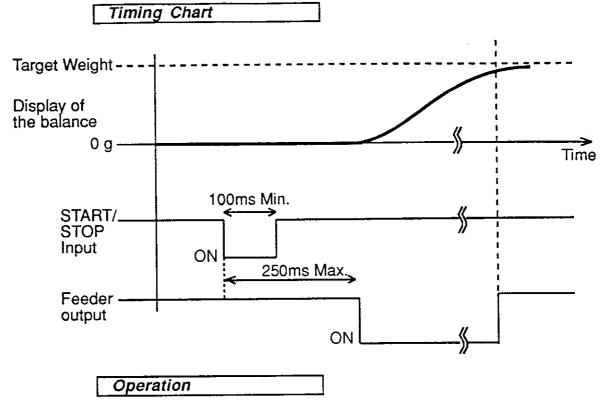

- When a pulse is applied to the START/STOP Input, Feeder Output will turn ON.
- When the weight values of the balance reach the Target Weight, Feeder Output will turn OFF.
- While the Feeder Input stays ON, which means that the weight values of the balance have not reached the Target Weight, Feeder output will be OFF if a pulse is applied to the START/STOP Input again.

Fine Adjustment of the Feeding Amount



Feeder accuracy (the difference between the Target Weight and actual fed amount) is affected by the powder flow rate or weighing condition.

- Internal setting, 5£L x £7, adjusts the free fall compensation, and allows the feeding amount to be adjusted.
- If the Spoon Feeding stops under the Target Weight, increase the value of the C-Parameter setting, $5EL \times C7$ (x indicates setting values)

SEL SEL SEL SEL SEL SEL	0123455	Feeding amount will become less. Feeding amount will
5tL	D 1	become more.



OP-06 Analog Output Board

General

OP-06 is an optional analog output board which allows the displayed values in the HX balance to be converted to voltage and then to be output.

- There are two types of output modes. The first is that you can select the digits you like to output, and the second is that you can output within the range of the weighing capacity. Zero Span = 0V, Full Span = 1V
- lacksquareThe output voltage can be selected by jumper pins.

Packing


- ☐ OP-06 Board
- □ Adjusting screwdriver □ 7P DIN Plug



Installing **Procedure**



Remove the AC adaptor from the balance.

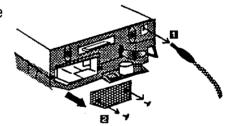




Remove the two screws at the rear of the balance, indicated by the drawing at the right.



Do not remove any other screws.

Insert the option board into the grooves of the guide inside the balance.

When the connector is installed firmly, the option board mount will be flush with the balance case.

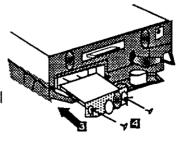



Secure the board with the two screws previously removed.

Output Modes and Selecting Digits



Output mode can be selected by choosing the four types of the internal setting parameters. Factory setting is R_{n} - Ω .

Яn	<i>a</i>	Output voltage corresponding to any of two digits. When the displayed arbitrary two digits are 0 0, 0.00 v will be output and when the displayed arbitrary two digits are 9 9, 0.99 v will be output. Output voltage is decided by selecting the value of the internal
		setting parameter, SEL.
Rn	1	Output voltage corresponding to any of three digits. When the displayed arbitrary three digits are 0 0 0, 0.000 v will be output and when the displayed arbitrary three digits are 9 9 9, 0.999 v will be output.
		Output voltage is decided by selecting the value of the internal setting parameter, 5 £ £ .
8n 2		The displayed values from 0 to full scale are output corresponding to 0.00 v and 1.00 v. When the net weight value is 0 g, 0.00 v will be output, and when the net weight value is full scale, 1.00 v will be output.
		If the RE-ZERO key is pressed to zero the displayed value, 0.00 v will be output.
		In this mode, the internal setting parameter, 5££ does not control the output.
Rn	3	The gross weight values on the weighing pan from 0 to full scale are output corresponding to 0.00v and 1.00 v. When the gross weight value containing a tare is 0 g, 0.00 v will be output, and when the gross weight value is the capacity, 1.00 v will be output.
		Even if the RE-ZERO key is pressed to zero the displayed value, the output voltage will not change.
	,10	In this mode, the internal setting parameter, 5 £ L does not control the output.

[*Hn [*]][*Hn |*] Modes

- Digit position is set by selecting the value of the internal setting, 5EL in the [Rn] or [Rn /] mode.
- When the SAMPLE key is pressed in the internal setting Rn, 5EL II will be displayed.
- The values to be set and digit positions are described in the table on the next page. Factory setting is [5fL].


	Two digits [Rn 🗓]	Three digits [An 1]
SEL 0 SEL 1 SEL 2 SEL 3 SEL 4	61 [] [] 	<i>5100.0</i> ⊢ ⊢ ⊢

The upper digit which is left blank is regarded as zero and also when the least digit is left blank by pressing the SAMPLE key, the digit is regarded as zero.

What is Full Scale in the [An 2] & [An 3]?



 The value of full scale in the $R_n \supseteq A$ and $R_n \supseteq A$ modes is shown in the table below.



Model	Full Scale	Model	Full Scale
HX-100	100 g	HX-3000	3000 g
HX-400	400 g	HX-6000	6000 g

If the HX-400 is indicating the weight as 410g, the output voltage is as follows:


$$1.00V \times \frac{400g}{410g} = 1.025V$$

Changing output voltage



To change the jumper pins on board between jumper pin A and jumper pin B enable you to change the range of the output voltage. Factory setting is set to jumper pin A.

Setting of jumper pin	Output voltage range	
Α	0.00v to 1.00v	
В	0.20v to 1.00v	

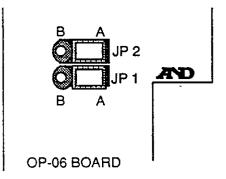


■ When the output is to be 4 to 20 mA, select jumper pin B.

Fine Adjustment of Output Voltage



Though the output voltage was adjusted at our factory, you can perform a fine adjustment of the output voltage by rotating the adjustments on the output connector section.

 - ☐ When the display of the HX balance is in the OFF state, the output is 0.00V.
- Zero can be adjusted by rotating the left adjustment (Z).



Voltage will be higher by rotating the adjustment clockwise.

- With the RE-ZERO key held down, press the ON:OFF key.
- O The display will come ON with all segments lit.

 At this time, the output voltage is 1.00V. This can be adjusted by rotating the right adjustment (S).
- Repeat item 11 and 22 described above to get the proper output voltage.

Output Voltage Except In the Weighing Mode

Output voltage is fixed in the following five states.
☐ Display In the OFF state or During Calibrating ☐ 0.00 V will be displayed. (When setting of the jumper pin is B, 0.20 V is output.)
☐ During Re-zeroing ☐ 0.00 V will be output. (When setting of the jumper pin is B, 0.20 V is output.) If the internal setting is set to R_n ☐ [7, the last voltage value will be output.
☐ During " -E " being displayed Dur

During " E " being displayed

Voltage shown in the table on the next page will be output in proportion to the internal settings.

	An O, An I	An 2, An 3
HX-100	1.00 V	1.010 V
HX-400	1.00 V	1.025 V
HX-3000	1.00 V	1.033 V
HX-6000	1.00 V	1.017 V

During " All segmements " being displayed

■ 1.00 V will be output. (Fine span adjustment can be performed in this state.)

Specifications

☐ Output impedance	≥ 100 Ω Maximum		
☐ Linearity	▶ ± 0.3%		
☐ Output connector	▶ 7 pins, DIN connector		
☐ Pin connection	▶ Output : Pin 7		
	■ GND : Pin 2		
	Other pins are not connected.		



Installing the Optional Breeze Break OP-10/OP-11




To prevent influences of a breeze during weighing, it is recommended to install an optional glass breeze break.



Installing the Glass Breeze Break OP-10 for HX-400




Remove the weighing pan, pan support, and dust guard of the HX-400.

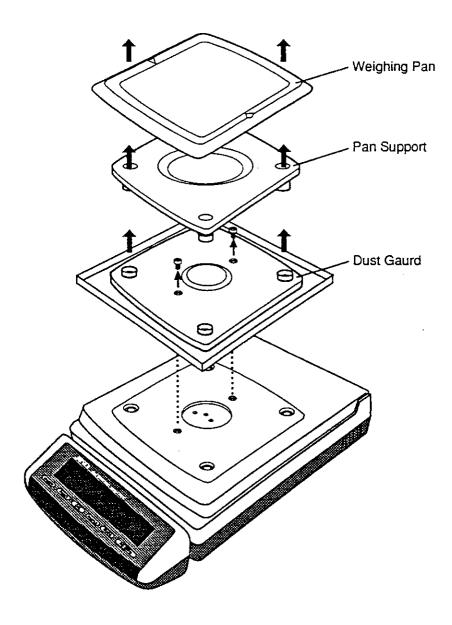




Place the glass breeze break OP-10 on the main body.

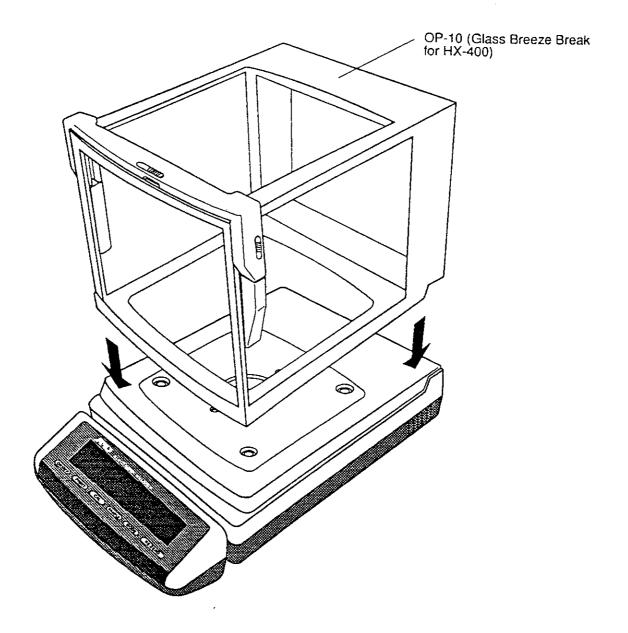




Remount the breeze break floor plate, dust cover, pan support, and weighing pan in that order as shown in the figure below.

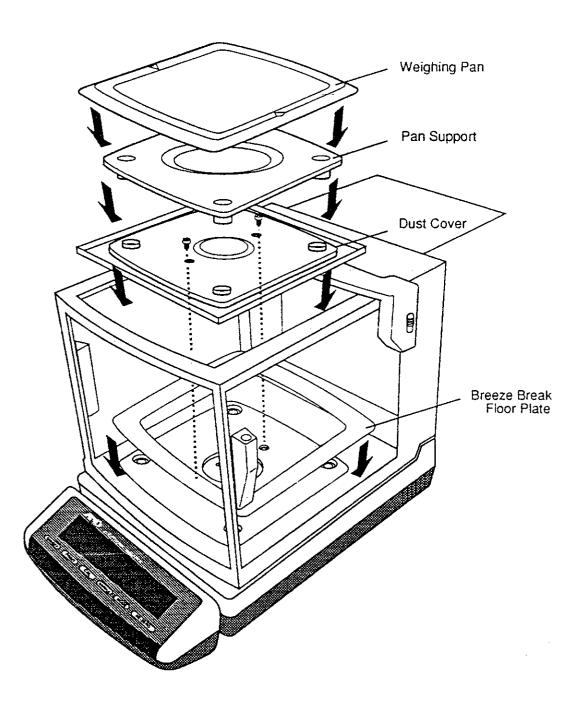


Installing the Glass Breeze Break OP-11 for HX-3000



Remove the weighing pan, pan support, and dust guard of the HX-3000.

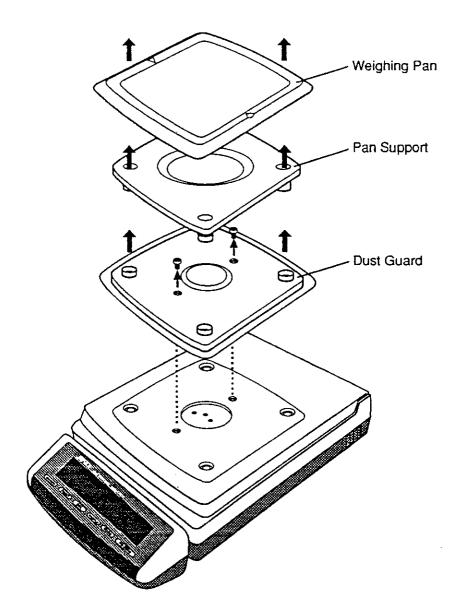


Place the glass breeze break OP-11 on the main body.

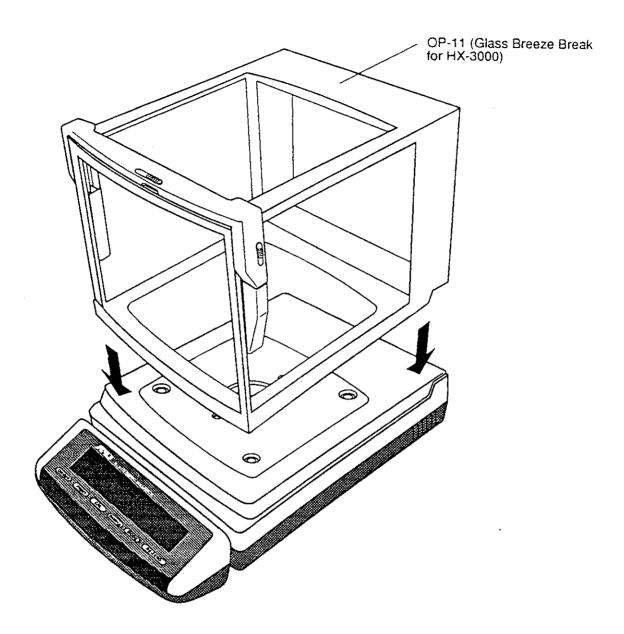




Remount the breeze break floor plate, pan support, and weighing pan in that order as shown in the figure below. (The dust guard is unnecessary. The user is kindly requested to store it.)

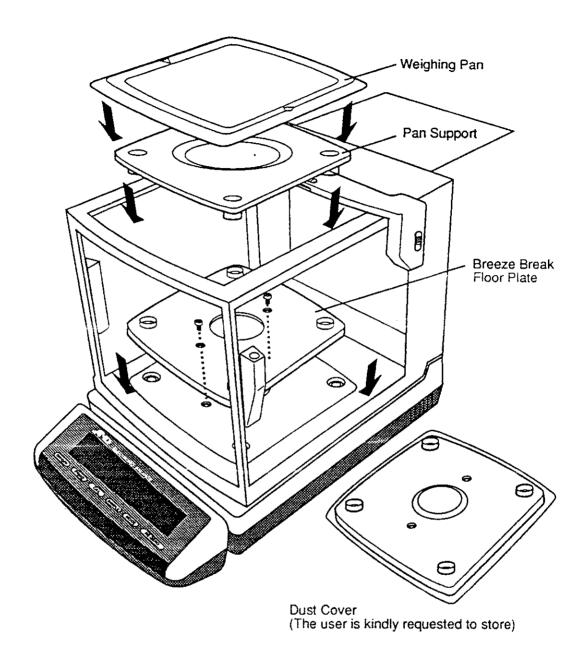


Rear Panel

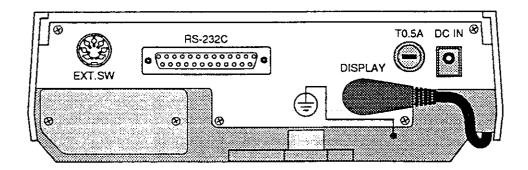

External Key Input (EXT. SW)



It is also possible to operate with entries through the EXT. SW (External Switch) instead of pressing the six key switches of the balance.

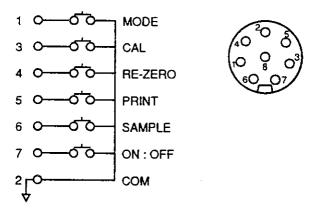


☐ The switching operation is available when the 100 msec pulse is input.



- What if the weighing result is not stable? Check that the weighing table is stable. Check that there are no drafts. Check that the breeze break (if any) is installed correctly. Check that the power supply voltage is stable.
- What if the weight displayed is obviously incorrect? Check that the balance is level. Check that it has been accurately calibrated. Check that the display started from zero before the mass was placed on the pan. Check that the mass is not overhanging and touching something else, like the sides of the breeze break or the top cover of the balance.
- What if "Lo" is displayed in "cnt" or "%" mode after I press the SAMPLE key? The weight of the sample was too low. In counting mode you will be prompted to increase the sample size from 10 units to 20, 50 or 100 units but remember that the minimum unit weight cannot be less than the resolution of the balance.
- What if the standby decimal point is not on when the adaptor is plugged in, and the display doesn't switch on when I press the ON:OFF key? Check external fuses as shown below.

Changing the Fuse

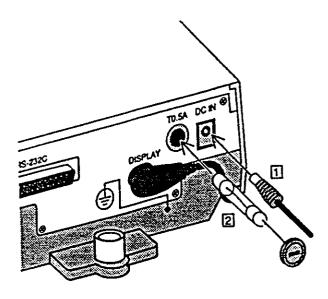

- I. Remove the AC adaptor from it's plug at the back of the balance II.
- Find the fuse holder press and turn it counter-clockwise, remove.
- 3. Replace the fuse with a new one. 500 mA, slow blow 2.
- **4.** If the fuse blows again, please contact your nearest A&D dealer for service.

Errors

☐ Power Failure Error:

P-FA 11

"P-FAIL" power failure is displayed if power was interrupted during weighing the last time the balance was used.

Press the ON:OFF key.

□ Weighing Pan Error:

- <u>E</u> 9

• '-E' will be displayed if the weighing pan or pan support are not installed.

□ Overload Error:

E 9

• 'E' will be displayed if the weight is beyond the balance capacity.

☐ Stability Error:

Errorl

'Error 1' will be displayed if the balance can not become stable while zeroing, or weighing.

Check for excessive vibrations or drafts. Press the RE-ZERO key and see BEST CONDITIONS FOR WEIGHING.

☐ Stability Error:

Error 2

'Error 2' will be displayed if the balance can not become stable while registering the unit weight.

► Check for excessive vibrations or drafts. Press the RE-ZERO key and see BEST CONDITIONS FOR WEIGHING.

☐ Value Error:

Error 3

'Error 3' will be displayed if the value entered is out of the range permitted for the function.

► To return to weighing mode, press any key.

☐ Weighing Pan Error:

Error 4

'Error 4' will be displayed if the weighing pan or pan support is not correctly installed, touching something or if there is a sample on the weighing pan when the ON:OFF key is pressed.

'Error 4' will be also displayed if you operate the balance with the internal weight set screws installed.

	Memory	Error
_		

Error 6

'Error 6' will be displayed if the balance has a memory problem.

Disconnect and connect AC power and try again. If error persists, call for service.

■ Memory Error:

Errar 7

'Error 7' will be displayed if the balance has a memory problem.

Disconnect and connect AC power and try again. If error persists, call for service.

□ Count Sample too light:

'Lo cnt' will be displayed if the unit weight is too small. The display will show 'Lo' and returns to the "10 - cnt" display.

▶ Unit weight is less than 10 digits.

☐ 100% Sample too light:

'Lo Pct' will be displayed if the 100% weight is too small. The display will show 'Lo' and returns to the "100 - %" display.

▶ 100% weight is less than 100 digits.

☐ CAL Errors:

-[AL E

'-CAL E' will be displayed if the calibration mass is too light (varies by more than 10g of set weight).

[AL E

'CAL E' will be displayed if the calibration mass is too heavy (varies by more than 10g of set weight).


Check the mass weight, look for something touching the weighing pan. Press the RE-ZERO key, then the CAL key (to use the balances' internal CAL mass) before trying again with an external CAL mass.


[RL no

'CAL no' will be displayed if the balance can not become stable while weighing the calibration mass.

Check for excessive vibrations or drafts. Press the RE-ZERO key and see BEST CONDITIONS FOR WEIGHING.


External Dimensions (HX-100 Type)

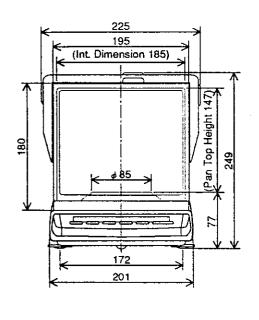

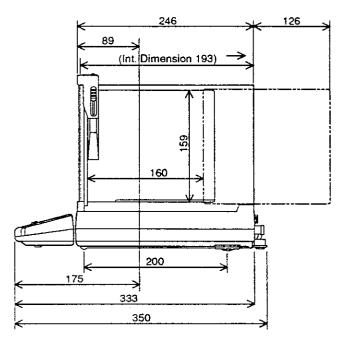


FRONT VIEW

SIDE VIEW

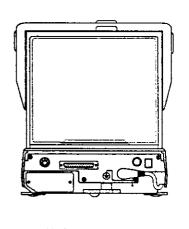




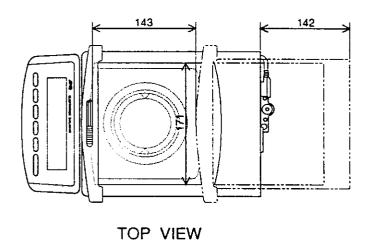


(Unit:mm)




External Dimensions (X-400, 3000, 6000 Type)

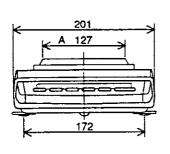


FRONT VIEW

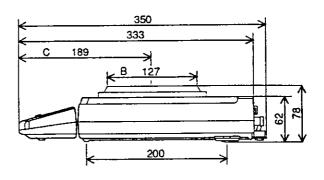


SIDE VIEW

 

REAR VIEW

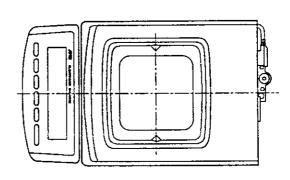

TOP VIEW

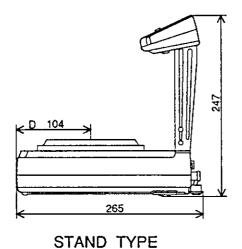

Dimen- sion Type	Α	В	С	D
HX-400	127	127	189	104
HX-3000	145	153	189	104
HX-6000	169	193	209	124

(Unit:mm)



A&D Company, Limited
3-23-14 Higashi-Ikebukuro, Toshima-ku, Tokyo 170 Japan
Telephone: [81] (03) 5391-6132 Fax: [81] (03) 5391-6148 Telex: 2422816 AANDD J

A&D ENGINEERING, INC. 1555 McCandless Drive, Milpitas, CA. 95035 U.S.A. Telephone: [1] (408) 263-5333 Fax: [1] (408) 263-0119

A&D INSTRUMENTS LTD.
Abingdon Science Park, Abingdon, Oxford OX14 3YS England Telephone: [44] (0235) 550420 Fax: [44] (0235) 550485

A&D MERCURY PTY. LTD.
32 Dew Street, Thebarton, South Australia 5031 Australia Telephone: [61] (08) 352-3033 Fax: [61] (08) 352-7409

A&D KOREA Limited
3rd Floor Hanam Bldg 44-27 Yoldo-dong Youngdeungpo-ku Seoul, Korea
Telephone: [82] (02) 784-4264 Fax; [82] (02) 784-6557