

SW-D


Weighing Indicator *For Super Washdown Scales*

SET UP INSTRUCTIONS



Warning Definition

The warning described in this manual has the following meaning:

 DANGER	An imminently hazardous situation which, if not avoided, will result in death or serious injury.
---	--

© 2011 A&D Company, Limited. All rights reserved.

No part of this publication may be reproduced, transmitted, transcribed, or translated into any language in any form by any means without the written permission of A&D Company, Limited.

The contents of this manual and the specifications of the instrument covered by this manual are subject to change for improvement without notice.

CONTENTS

CONTENTS	3
1. COMPLIANCE	4
2. INTRODUCTION	5
3. FEATURES	5
4. UNPACKING	6
5. INSTALLATION and PRECAUTIONS	7
5.1. Precautions for Installing the Indicator	7
5.2. Connecting to the load cell	7
5.3. Verifying Load Cell Output and Input Sensitivity	8
5.4. Setting Up the Indicator	9
5.5. Parameter Settings and Sensitivity Adjustment	9
6. DESCRIPTION OF EACH PART	10
7. SENSITIVITY ADJUSTMENT	12
7.1. Items of the Sensitivity Adjustment mode	12
7.2. Setting of the weighing capacity / minimum division / decimal point position	14
7.3. Gravity acceleration correction	15
7.4. Sensitivity Adjustment using a weight	16
8. SETTING FUNCTIONS OR UNITS FOR USE	18
8.1. Setting of the CF function	18
8.2. Setting unit for use	19
8.3. CF Function list	20
9. OPTIONS	21
9.1. SW-11 Display stand / Wall-mount	21
10. MAINTENANCE	22
10.1. Notes on maintenance	22
10.2. Error codes	22
11. SPECIFICATIONS	23
11.1. Specifications	23
11.2. External dimensions	24
12. GRAVITY ACCELERATION MAP	25

1. COMPLIANCE

Compliance with FCC rules

- ❑ Please note that this equipment generates, uses and can radiate radio frequency energy. This equipment has been tested and has been found to comply with the limits of Class A digital devices pursuant to Part 15 of FCC rules. These rules are designed to provide reasonable protection against interference when equipment is operated in a commercial environment. If this unit is operated in a residential area, it may cause some interference and under these circumstances the user would be required to take, at his own expense, whatever measures are necessary to eliminate the interference. (FCC = Federal Communications Commission in the U.S.A.)

Classification of protection provided by enclosures

- ❑ The equipment is designed to comply with the IP Code of IEC 60529.
The “IP69K” is explained as follows:

“IP” International Protection.

“6” Against ingress of solid foreign objects.
Dust-tight. No ingress of dust.

“9K” Against ingress of water with harmful effects.
High pressure water jets directed against the enclosure from any direction shall have no harmful effects. (DIN40050 Part 9)

2. INTRODUCTION

This manual describes how this product works and how to get the most out of it in terms of performance.

The SW-D weighing indicator may be used to build a water-proof digital scale to specification IP69K. It has similar specifications and functions as an indicator of the SW series.

Please refer to the instruction manual for the SW supplied with the SW-D.

3. FEATURES


The SW-D weighing indicator is an electronic display instrument used to build a water-proof scale to specification IP69K by the combination of the SW-D and a weighing unit (Load cell), with the following features:

- ☐ Dust-tight and water-tight construction, complying with IP69K.
- ☐ Employing touch-sensitive keys enabled the display to be covered with a plastic sheet, resulting in better dust-tight and water-tight performance.
When a key is touched, the corresponding LED, above that key, turns on to indicate that the key has been touched.
- ☐ A bright LED display, with a broad viewing angle.
- ☐ Operating up to four 350 Ω load cells is available.
- ☐ Available range selection, for the display resolution, is 1/20 to 1/60,000.
- ☐ Free setting of the weighing capacity, within the display resolution of 1/60,000, is available.
- ☐ Available weighing units are kg (kilogram), g (gram), lb (pound), oz (ounce), and pcs (pieces for the counting mode).
- ☐ The counting mode easily counts the number of objects of the same weight.
- ☐ The comparator mode compares the displayed value (weight value) with the previously set comparator values and indicates the results by the large and bright LED display. The optional comparator relay output (SW-03) can output the results as a relay signal.
- ☐ The auto-tare function, used with the comparator mode, automatically tares and displays "OK" for a certain amount of sample and repeats this process for the next weighing.
- ☐ Using the optional RS-232C serial interface (SW-03) or optional RS-422/485 serial interface (SW-04) provides serial data output of the weight value and relay output of the comparison result.
- ☐ The optional sealed lead acid (SLA) battery (HC-02i) can be installed, allowing the scale to be used where an AC power source is not available.
- ☐ SW-11 provides the function of a display stand or wall-mount bracket for the SW-D.

4. UNPACKING

Unpack the indicator carefully and keep the packing material if you are likely to transport the indicator again in the future.

When unpacking, check whether all of the following items are included:

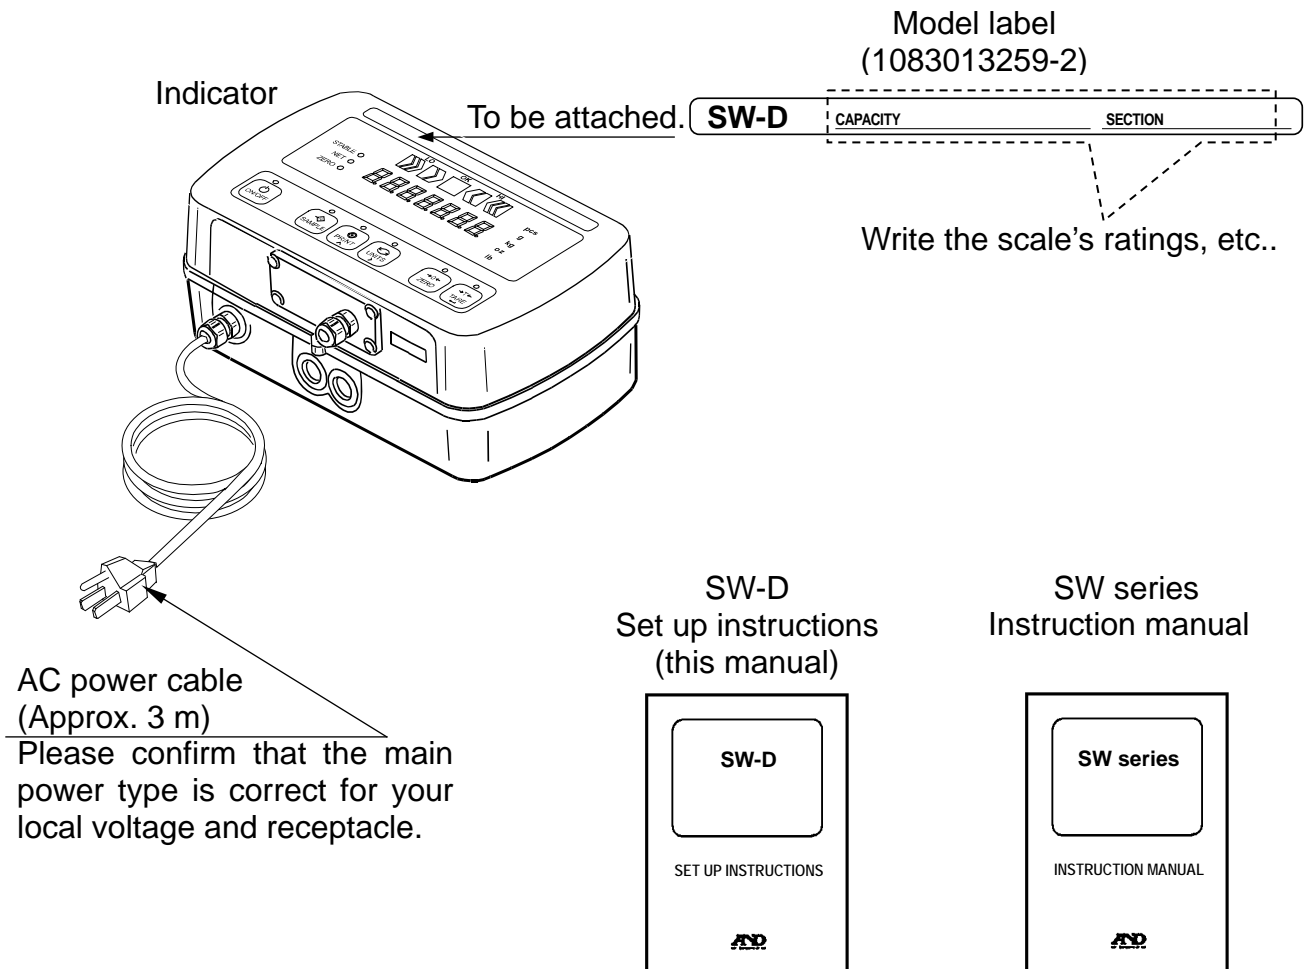

5. INSTALLATION and PRECAUTIONS

5.1. Precautions for Installing the Indicator


⚠ DANGER

- ☐ Ground the indicator so that the user will not be subjected an electric shock.
- ☐ Do not handle the main power cord with wet hands.
- ☐ The AC plug is not water-resistant. Install it in an area where it does not get wet.
- ☐ Even when the optional sealed lead acid (SLA) battery (HC-02i) is used, be sure to prevent the AC plug from getting wet.
- ☐ Do not install the indicator where there is flammable or corrosive gas present.
- ☐ Do not pull, fold or arrange cables forcibly.
- ☐ Use shielded cables for all connections.
- ☐ Ground the platform to be connected to the indicator to avoid a risk of electric shock.

Read the section “PRECAUTIONS” in the instruction manual of the SW to understand the conditions and precautions for installation, operation and cleaning the indicator.


5.2. Connecting to the load cell

1. Disconnect the main power cord of the scale from the power source.
2. On the bottom of the display, remove the screw protection caps on the load cell panel. Loosen the four screws and open the load cell panel.
3. Loosen the cable clamp locking nut on the load cell panel and insert the load cell cable through the cable clamp.
Accommodates load cell cable diameters of ϕ 3.5 to 7.0 mm.

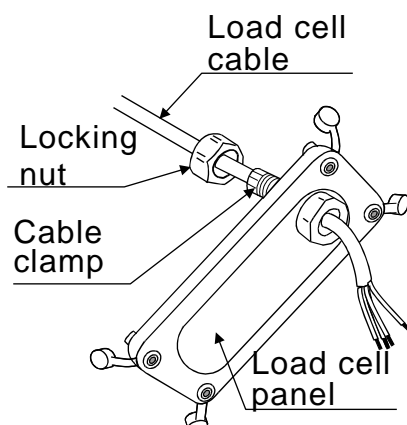

4. Solder the wires to the pin contacts of the connector.

- ❑ A 5 m or less load cell cable is recommended as the SW-D uses a 4 wire system (no remote sensing).

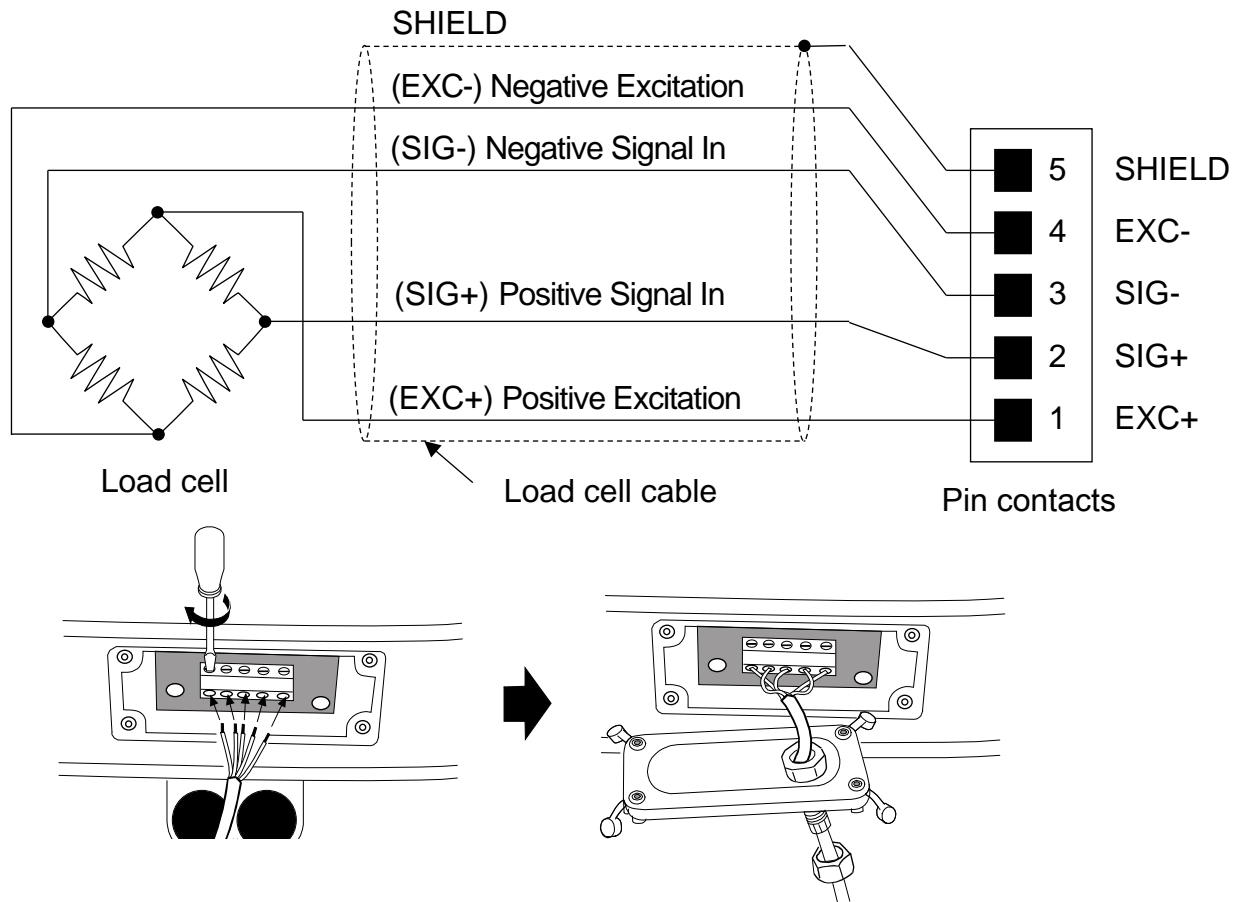

5. Tighten the cable clamp locking nut to secure the load cell cable.

6. Close the load cell panel by securing the four screws and cover the screws using the screw protection caps.

5.3. Verifying Load Cell Output and Input Sensitivity

The input sensitivity is 0.2 $\mu\text{V}/\text{division}$ or more. When designing a weighing scale, the following calculation formula should be satisfied.

- ❑ The input sensitivity requires a change in output voltage, from the weighing device, to change the display value as a one digit step. In order to achieve a scale with stable performance, select the input sensitivity as large as possible.

Calculating formula:

$$0.2 \leq \frac{E \times B \times d}{A \times n}$$

A : Rated capacity of load cell

B : Rated output (mV/V)

d : Minimum division

E : Excitation voltage (mV) = 5000 mV for SW-D

n : Number of load cells

Example of calculation:

In the case of designing a scale with a capacity of 60 kg and minimum division of 0.005 kg, using one load cell with a rated capacity of 100 kg and rated output of 1 mV/V:

Rated capacity of Load cell:

A = 100 kg

Rated output:

B = 1 mV/V

Minimum division:

d = 0.005 kg

Excitation voltage:

E = 5000 mV


Number of load cells:

n = 1

$$\frac{5000 \times 1 \times 0.005}{100 \times 1} = 0.25 > 0.2$$

Therefore, there is no problem with this design.

5.4. Setting Up the Indicator

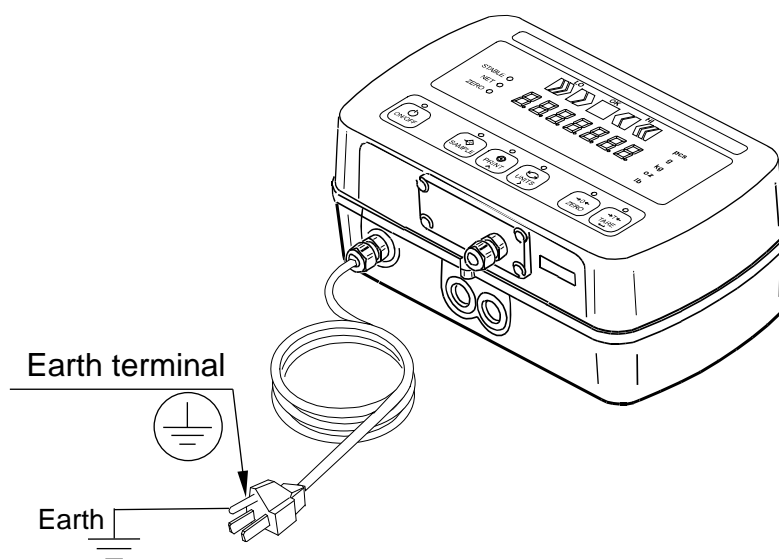


- ❑ After confirming that nothing is touching the key switches on the indicator, connect the main power cable to a power source that has an earth ground terminal.

5.5. Parameter Settings and Sensitivity Adjustment

When a platform scale is initially set up, it is necessary to set some parameters and calibrate it using a sensitivity adjustment weight.




 
 
 
See “[8. SETTING FUNCTIONS OR UNITS FOR USE](#)” to calibrate the scale.

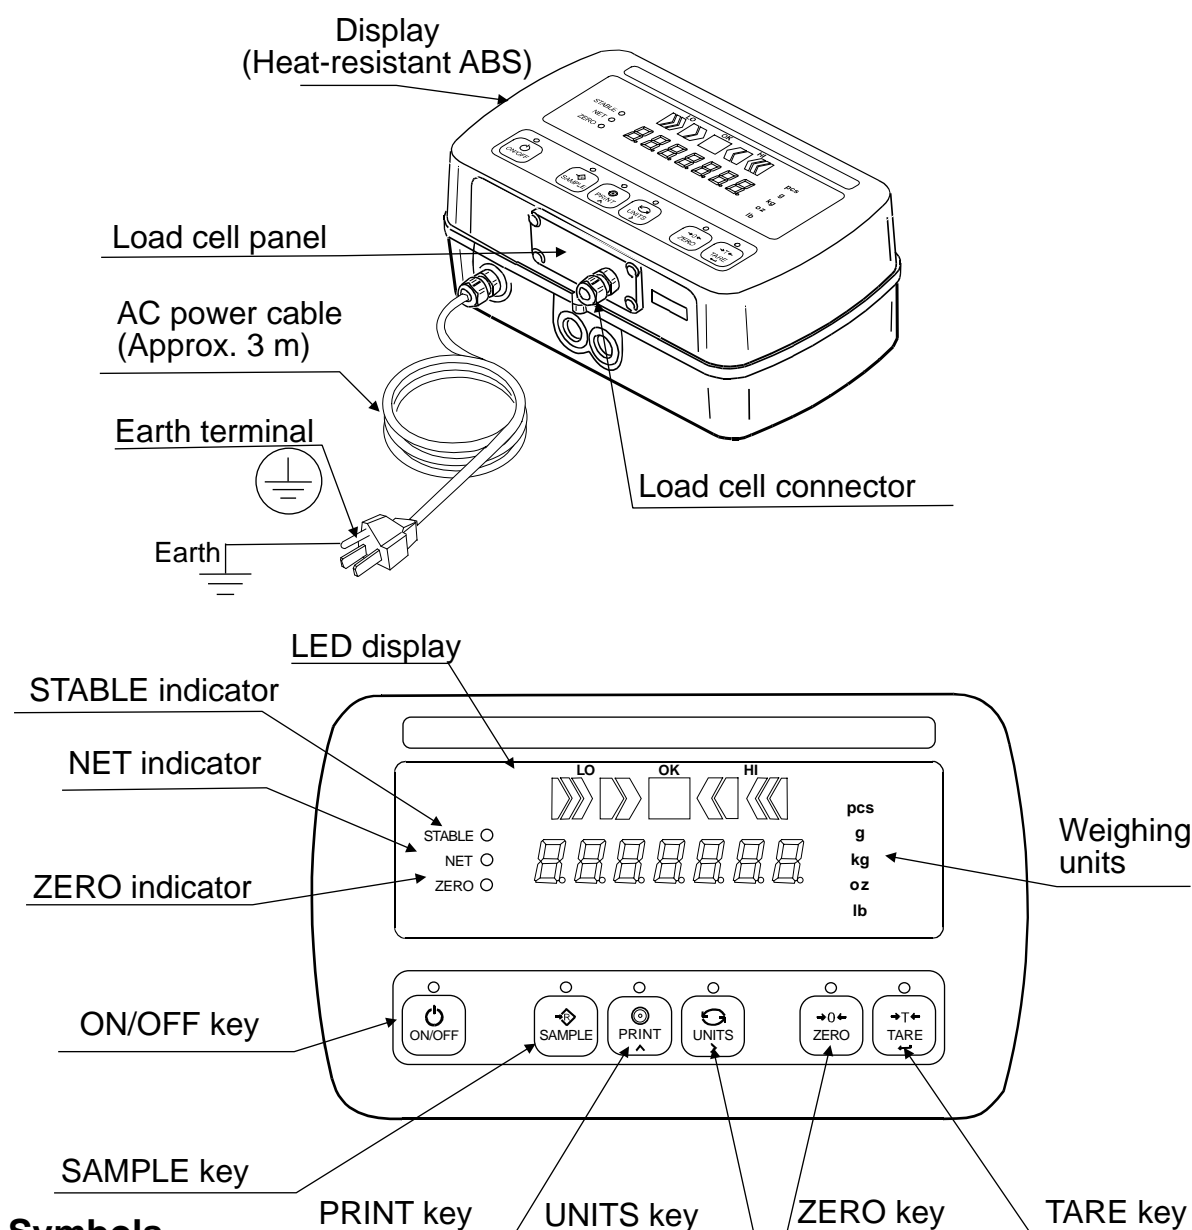6. DESCRIPTION OF EACH PART



Symbols

Symbol	Description
STABLE ○	Turns on when the weight value is stable.
NET ○	Turns on when the NET weight is displayed. (The tare operation is in progress.)
ZERO ○	Turns on when zero is displayed.
»»»□«««	Turns on when the comparator results are displayed.
Weighing units	“pcs”, “g”, “kg”, “oz” and “lb” are available. A selected unit turns on.
~	Alternating current.
⏏	Earth (ground) Terminal.


Key	Description
	<p><u>ON/OFF key</u></p> <p>Turns the power ON or OFF. When turned ON, the scale will be automatically set to zero (power-on zero). To turn the power OFF, press and hold the key.</p> <p>Note: If pressing the key does not turn the power ON immediately, keep pressing the key.</p>
	<p><u>SAMPLE key</u></p> <p>In the counting mode ("pcs"), goes to the unit weight storing mode. Press and hold to go to the comparator value setting mode.</p>
	<p><u>PRINT key</u></p> <p>Outputs the weight value to the printer.</p> <p>In the setting mode, this key is used to increase the value of the selected blinking digit by one.</p>
	<p><u>UNITS key</u></p> <p>Switches the weighing unit.</p> <p>In the setting mode, this key is used to shift the blinking digit to the right.</p>
	<p><u>ZERO key</u></p> <p>Zeroes the scale and sets the display to zero.</p>
	<p><u>TARE key</u></p> <p>Subtracts the tare (container) weight placed on the weighing pan.</p> <p>In the setting mode, this key is used to store the setting value and proceed to the next step.</p>

7. SENSITIVITY ADJUSTMENT


When calibrating, refer to this set up instructions. (The contents of SW instruction manual are not the same as this set up instructions.)

7.1. Items of the Sensitivity Adjustment mode

- ❑ The sensitivity adjustment mode has the following three functions.
 - Setting of the weighing capacity, minimum division, and decimal point position.
 - Gravity acceleration correction
 - Sensitivity adjustment using a weight
- ❑ How to enter the sensitivity adjustment mode
 1. Make sure that the scale is in the weighing mode (displaying “kg”, “g”, “lb”, “oz” or “pcs”).
 2. Remove the screw protection caps on the load cell panel on the bottom of the display. Loosen the four screws and then open the load cell panel. The (CAL) switch is located inside.
 3. Press the (CAL) switch. The indicator displays “CAL SET”. (And proceed to “7.2.”, “7.3.”, or “7.4.”)

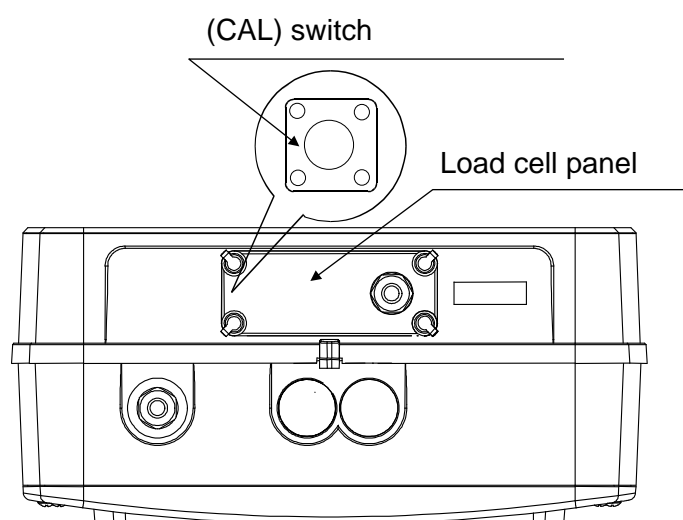

The chart below shows the relation between each item and the key operation in the sensitivity adjustment mode.

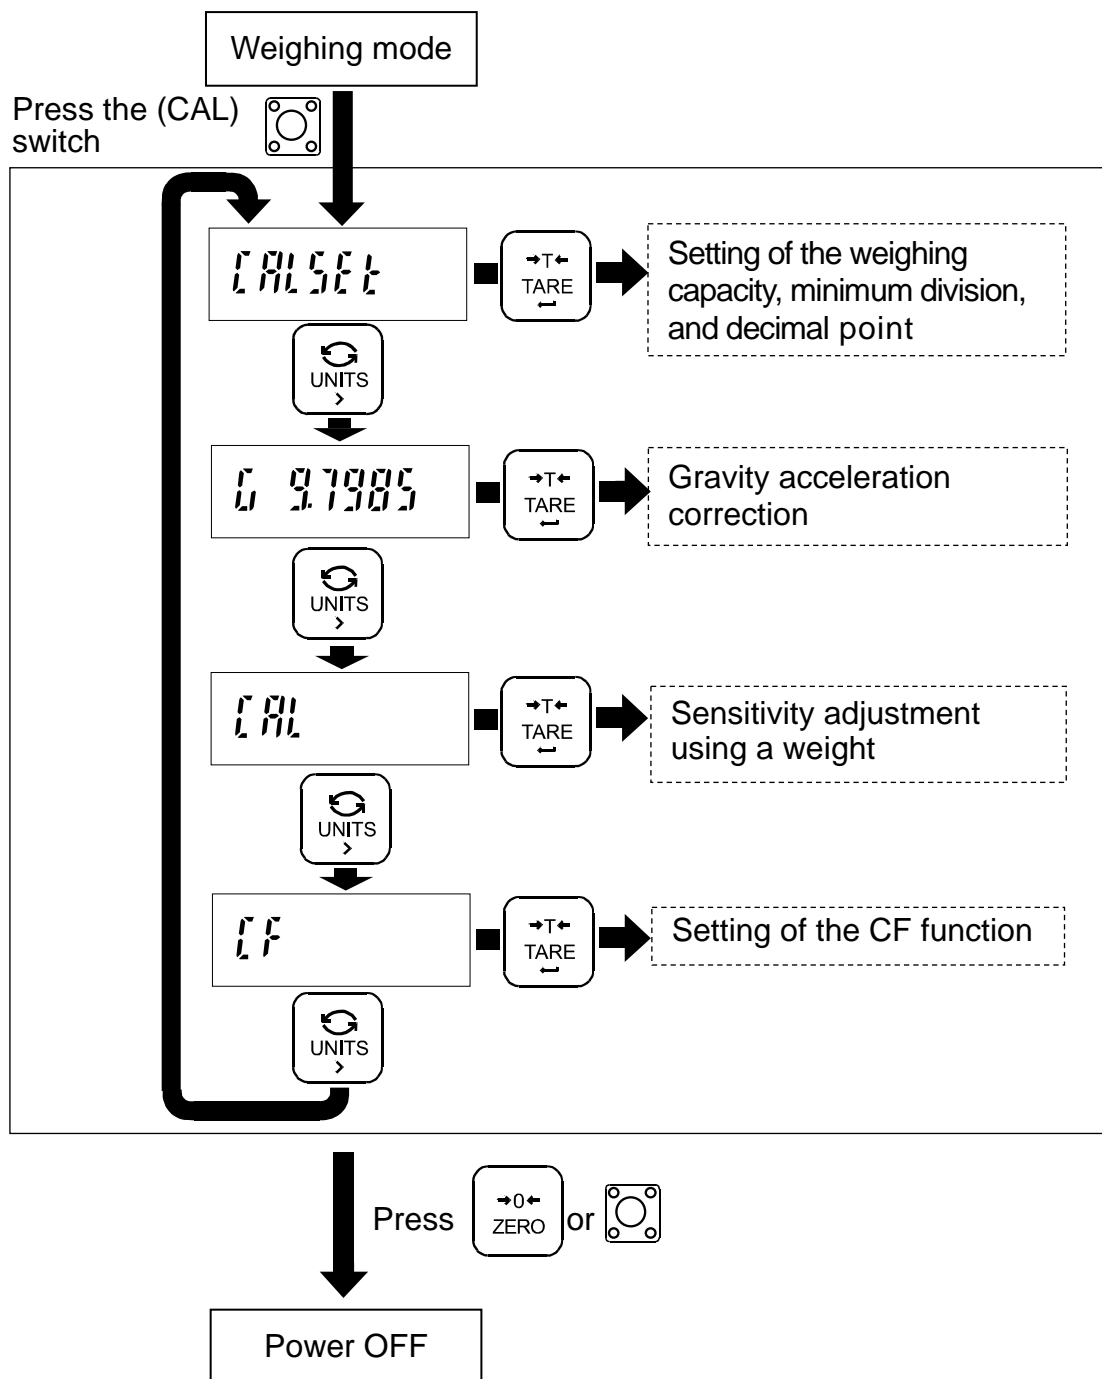

Press the **UNITS** key to select an item and press the **TARE** key to execute it. To exit from the sensitivity adjustment mode, press the **ZERO** key or the **CAL** switch. The indicator turns the power off. (Or press the **ON/OFF** key to turn the power off.)

7.2. Setting of the weighing capacity / minimum division / decimal point position

Set the weighing capacity, minimum division, and decimal point position. Be sure to perform these setting first when connecting to a load cell (base unit). The indicator does not require setting each time, if nothing is to be changed.

1. Refer to “7.2. Items of the Sensitivity Adjustment mode”, to enter the sensitivity adjustment mode. The indicator displays “CAL SET”.
2. Press the **TARE** key to enter the setting mode of the weighing capacity, minimum division, and decimal point position.
3. The indicator displays the currently set minimum division and sensitivity adjustment unit. (Display example: “d- 1 kg”) The blinking digit indicates the minimum division. Press the **PRINT** key to select 1, 2, or 5. The unit indicates the sensitivity adjustment unit. Press the **SAMPLE** key to select either “kg” or “lb”. Press the **TARE** key to store the currently set minimum division and sensitivity adjustment unit, and proceed to the next step.

4. After displaying “CAP”, the indicator displays the currently set weighing capacity and decimal point position. (Display example: “0060.00 kg”) Set the weighing capacity and decimal point position using the following keys:

MODE	Shift the blinking digit to the right.
PRINT	Increases the number (+1) at the blinking digit.


SAMPLE	Shift the decimal point position.
---------------	-----------------------------------

Press the **TARE** key to store the currently displayed weighing capacity and decimal point position, and proceed to the next step.

- Available setting range of the resolution is 60,000 or less. The resolution is the value that divides the weighing capacity by the minimum division. (Decimal point position is ignored.)

5. After displaying “End”, the indicator displays “CAL SET”, and the setting is complete.

After setting the weighing capacity, minimum division, and decimal point position, be sure to perform “7.4. Sensitivity Adjustment using a weight”.

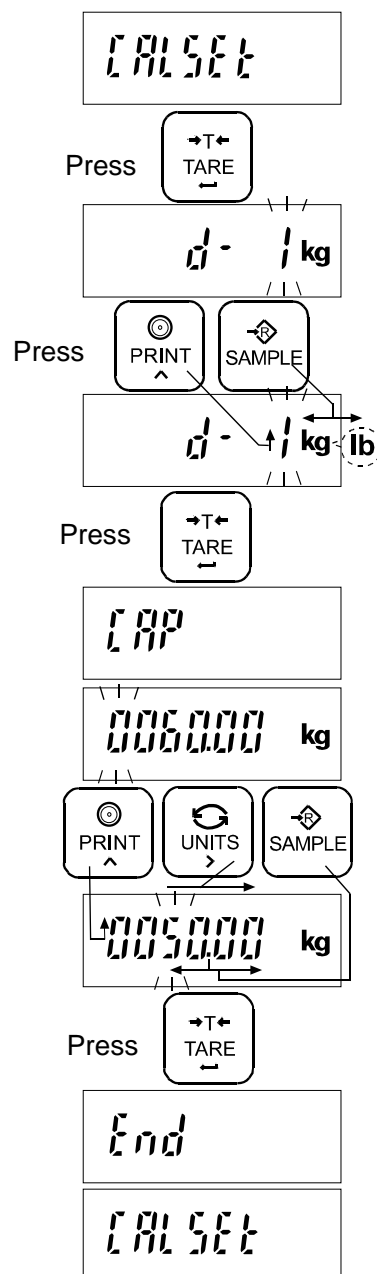

7.3. Gravity acceleration correction


When the scale is first used or has been moved to another location, it should be calibrated using a sensitivity adjustment weight.

But if a sensitivity adjustment weight is not available, the gravity acceleration correction will compensate the scale. Change the gravity acceleration value stored in the scale to the value of the area where the scale will be used. Refer to the gravity acceleration map at the end of this manual.

Note: Gravity acceleration correction is not required when the scale will be calibrated using a sensitivity adjustment weight at the place where it is to be used.

1. Refer to “[7.1. Items of the sensitivity adjustment mode](#)”, to enter the sensitivity adjustment mode. The indicator displays “CAL SET”.
2. Press the **UNITS** key to display “G 9.7985” (gravity acceleration value).
3. Press the **TARE** key to enter the gravity acceleration value setting mode.
4. Change the displayed value using the following keys.

UNITS	To shift the blinking digit to the right.
PRINT	To increase the value of the blinking digit by one.
5. Press the **TARE** key. The setting value is stored and “End” is displayed. After displaying “G 9.7985” (gravity acceleration value), the setting is complete.
6. When sensitivity adjustment using a sensitivity adjustment weight is to be performed, go to step 3 of “[7.4. Sensitivity Adjustment using a weight](#)”.
To finish the setting procedure, press the **ZERO** key or the CAL switch. The indicator turns the power off.

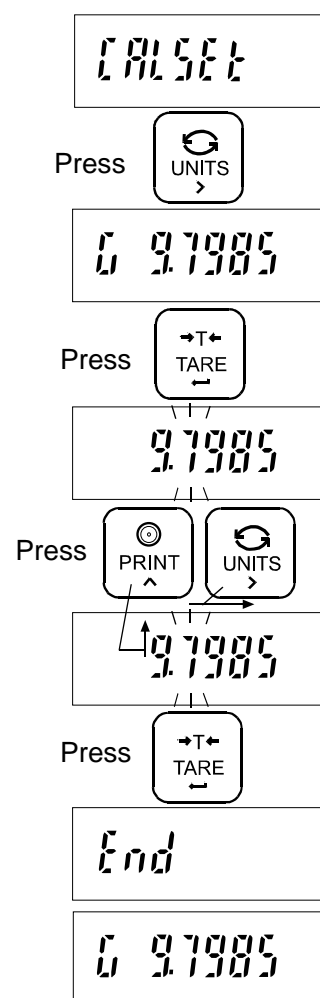

7.4. Sensitivity Adjustment using a weight

This function adjusts the scale (indicator) for accurate weighing.

Sensitivity adjustment must be done when the SW-D is initially connected to a load cell (base unit) or the combination is changed.

Sensitivity adjustment may also be required according the changes in the environment.

- ☐ When the scale (indicator) has been moved.
- ☐ When the ambient environment has significantly changed.
- ☐ For regular sensitivity adjustment.

Note: Prepare a weight, preferably a weight with the same value as the weighing capacity of the scale to be calibrated. Note that the sensitivity adjustment weight value can be changed.

1. Turn the power ON and warm up the scale for at least half an hour.

- ☐ Change the function setting “*PoFF*” or place something on the weighing pan to disable the auto power-off function.

2. Refer to “7.1. Items of the Sensitivity Adjustment mode”, to enter the sensitivity adjustment mode. The indicator displays “*CALSet*”.

3. Press the **UNITS** key twice and display “*CAL*”.

4. Press the **TARE** key. “*CAL 0*” is displayed. Confirm that nothing is placed on the weighing pan and wait for the STABLE indicator to turn on.

5. Press the **TARE** key. The scale calibrates the zero point and displays the value of the sensitivity adjustment weight (SPAN sensitivity adjustment).

- ☐ The sensitivity adjustment weight value is equal to the weighing capacity. (factory setting)


- ☐ If you want to calibrate only the zero point without calibrating SPAN, press the **ZERO** key. After “*End*” is displayed, go to step 9.

6. To calibrate with a weight different from the weighing capacity, change the displayed value using the following keys.


UNITS To shift the digit that is blinking to the right.

PRINT To increase the value of the blinking digit by one.

- ☐ Using a weight with the same value as the weighing capacity is recommended. If other weights are used, use one with a value greater than two-thirds of the capacity.

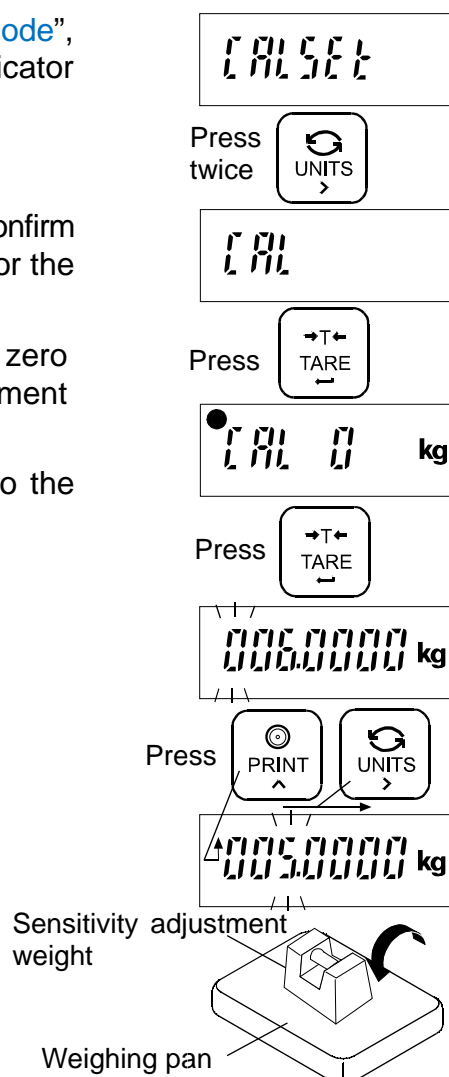

7. Place the sensitivity adjustment weight with the same value as displayed on the weighing pan, and wait for the STABLE indicator to turn on.
8. Press the TARE key. The scale calibrates SPAN and “End” is displayed. After displaying “CAL”, the setting is complete.
9. To finish the setting procedure, press the ZERO key or the CAL switch. The indicator turns the power off.

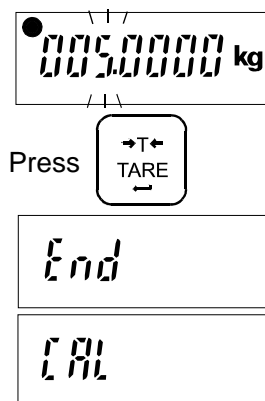

Note: If the scale will be moved to another location, set the gravity acceleration value for the new location and calibrate the scale according to the procedure above. Refer to the previous section to set the gravity acceleration value.


8. SETTING FUNCTIONS OR UNITS FOR USE

The indicator has CF function settings to specify the indicator performance.

After installing the indicator, the indicator does not require resetting or changing of this CF function as far as it is used normally.

If you want to maintain only the needed units, set using this function.

The parameters set in the CF function settings and unit setting are maintained even if the power is turned OFF.

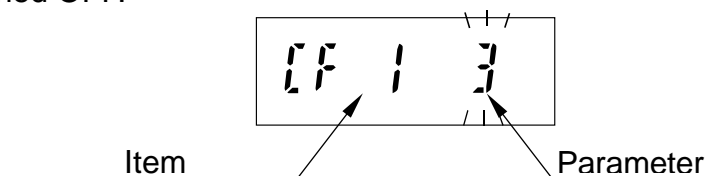

8.1. Setting of the CF function

1. Refer to “7.1. Items of the Sensitivity Adjustment mode”, to enter the sensitivity adjustment mode. The indicator displays “CAL SET”.

2. Press the **MODE** key three times to display “CF”.

3. Press the **TARE** key to display the setting item.

4. Select the setting item and parameter using the following keys:

UNITS Proceed to next setting item.

PRINT Increases the number (+1) at the blinking digit.
(Change the parameter)

- ❑ When the currently stored set is changed, the STABLE indicator “●” turns off.
- ❑ Changing the parameter using the **PRINT** key at CF1, 2, 8 or 12 is not available.


5. Press the **TARE** key to store the setting. After displaying “End”, the indicator displays “Unit” and proceeds to the unit setting mode.

- ❑ To proceed, without storing the CF function setting, press the **ZERO** key. After displaying “Unit”, proceed to the use unit setting mode. (Display example: “1110000 pcs”)

6. When the unit setting is to be performed, go to step 5 of “8.2. Setting unit for use”.

When the unit setting is not to be performed, press the **ZERO** key. After displaying “CF”, the setting is complete.

- ❑ To adjust to the designed scale specification, set other items by following the procedure described above.

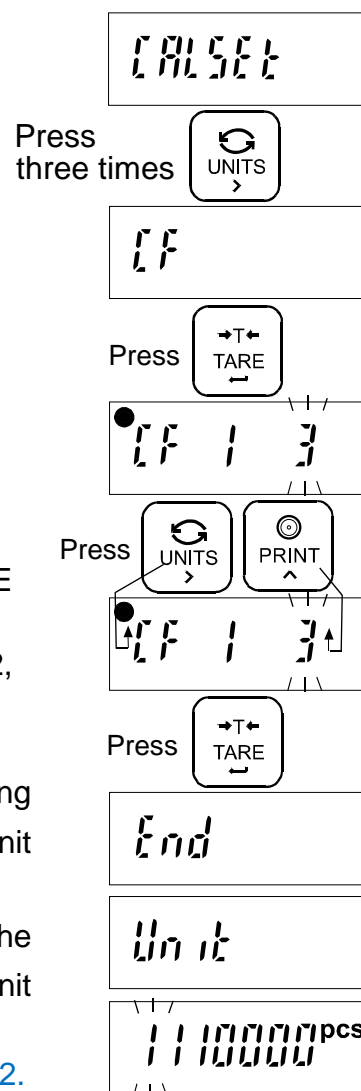

8.2. Setting unit for use

1. Refer to “7.1. Items of the Sensitivity Adjustment mode”, to enter the sensitivity adjustment mode. The indicator displays “CAL SET”.

2. Press the **MODE** key three times to display “CF”.

3. Press the **TARE** key to display the setting item.

4. To proceed without storing this setting item, press the **ZERO** key.

After displaying “Unit”, proceed to the unit setting mode.
(Display example: “1110000 pcs”)

5. Select the unit to be used, using the following keys.

UNITS Select the unit (Shift the blinking unit to the right)

PRINT Set whether the selected unit is available (0) or not available (1). (Change the number of the blinking digit to “0” or “1”.)

□ About the unit setting mode

Each of the display digits are assigned to a unit setting.

(The setting at the first and fourth digit is not available.)

Display assignment	7	6	5	4	3	2	1
Unit	pcs	g	kg	Set disabled	oz	lb	Set disabled

-The unit during selection is indicated.

-With each digit, if setting to “0”, its unit is not available, and if setting to “1”, its unit is available.


(Only when set to “1”, is a unit available.)

Even if a unit is stored, availability for use depends on the weighing capacity and resolution.

Example) When setting to “1010000 pcs”, only “pcs” and “kg” are available as units.

6. Press the **TARE** key to store the setting. After displaying “End”, the indicator displays “CF”, and the setting is complete.

- If you want to proceed without storing the setting of the unit setting mode, press the **ZERO** key. After displaying “CF”, the setting is complete.

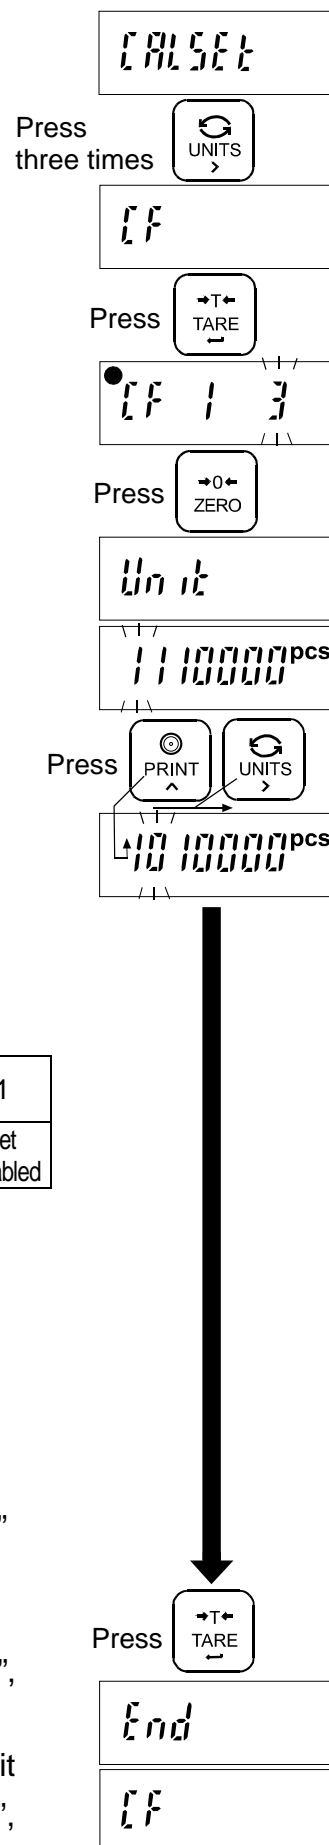

8.3. CF Function list

Item	Parameter	Description	
Used internally [F 1]	♦ 3	Not available for setting change	
Used internally [F 2]	♦ 0	Not available for setting change	
Zero tracking [F 3]	0	Not available for setting of function "t r c" (It is fixed to "t r c 1")	When "[F 3 0]", "t r c" has no function.
	♦ 1	Available for setting of function "t r c"	
Power on zero range [F 4]	0	None	Sensitivity adjustment zero reference
	1	±10% of weighing capacity	
	♦ 2	±50% of weighing capacity	
	3	±100% of weighing capacity	
Calculation of tare [F 5]	0	Tare by displayed division	
	♦ 1	Tare by internal count	
Stable indicator of during tare [F 6]	0	During tare, stable indicator has no function	
	♦ 1	During tare, stable indicator turns on	
Tare clear by zero operation [F 7]	0	Tare is not cleared by zero operation	
	♦ 1	Tare is cleared by zero operation	
Used internally [F 8]	♦ 3	Not available for setting change	
Minus and printing limit [F 9]	♦ 0	Non-limit	Refer to below note.
	1	Limit has function	
Auto tare function [F 10]	0	No auto tare function	When "[F 10 0]", "A t" "A t - t" "A t - F" has no function.
	♦ 1	Auto tare function	
Stable detection range [F 11]	0	Not available for setting of function "St - b" (It is fixed to "St - b 0")	When "[F 11 0]", "St - b" has no function.
	♦ 1	Available for setting of function "St - b"	
Used internally [F 12]	♦ 0	Not available for setting change	

♦ Factory setting

Note: About minus and printing limit setting ("[F 9]")

When setting "[F 9]" to "1", the indicator has the following limit.

When the total weight is -19d or less, the indicator displays "-E".

(*d = minimum division)

When the total weight is minus, the indicator does not perform the printing.

9. OPTIONS

- ❑ For details of HC-02i, SW-03, and SW-04, refer to the “OPTIONS” in the SW series instruction manual.


9.1. SW-11 Display stand / Wall-mount

- ❑ SW-11 provides the function as a display stand or a wall-mount for the SW-D.

Attaching to SW-11

1. Attach the SW-11 to the display using the four screws provided.
2. Adjust the display angle using the two clamps on the SW-11.

After loosening the two clamps on the SW-11, adjust the display angle, and re-tighten the two clamps.

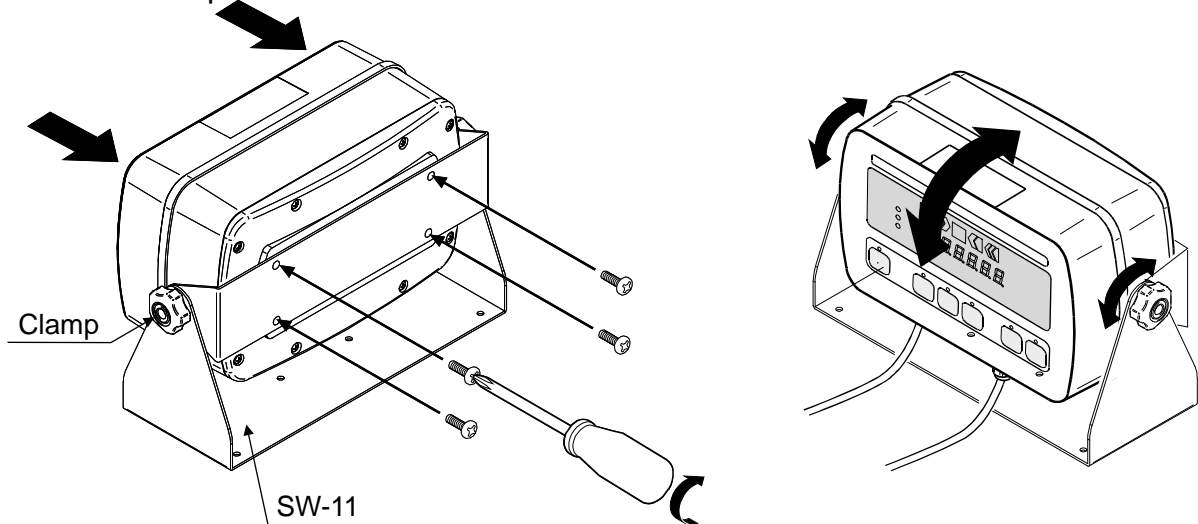

3. If you want to use the SW-11 as wall-mount bracket, after fixing only the stand part of the SW-11 on the flat wall by using the screws, attach the display to the SW-11. (These screws are not provided.)

For details of the installing dimension, refer to “[11.2. External dimensions](#)”.

10. MAINTENANCE

10.1. Notes on maintenance

- ☐ Do not disassemble the indicator. Contact your local A&D dealer if the indicator needs service or repair.
- ☐ Use the original packaging for transportation.
- ☐ Do not use organic solvents to clean the indicator. Use a warm lint free cloth dampened with a mild detergent.
- ☐ Calibrate the indicator periodically to maintain the weighing accuracy.

 
10.2. Error codes

Overload error




Indicates that an object beyond the weighing capacity has been placed on the weighing pan.
Remove the object from the weighing pan.

Over range error




When setting “**CF 9**” to “**1**”, indicates that total weight is –19d or less. (d = minimum division)
(In the case of turning on the stable indicator, setting the display to zero by pressing the **ZERO** key is available.)

 Unit weight error




Indicates that the sample weight is too light to set the unit weight in the counting mode.

 CAL error




Indicates that the sensitivity adjustment procedure is canceled because the sensitivity adjustment weight is too light.
Check that the weighing pan is installed properly and the mass of the sensitivity adjustment weight.

 Low battery



Indicates that the HC-02i battery is depleted.
Charge the battery immediately.

 Other



There may be an internal malfunction.
(* indicates an error number.)

Note: If the error persists or other errors occur, contact your local A&D dealer.

11. SPECIFICATIONS

11.1. Specifications

Input sensitivity		0.2 μ V / d min. (d: minimum division)
Input signal range		-16 mV ~ 16 mV
Load cell excitation voltage		5 V DC \pm 5% (no remote sensing)
Load cell drive capacity		Up to 4 x 350 ohm load cells
Temperature coefficient	Zero	\pm (0.2 μ V \pm 0.001% of zero adjustment voltage) / °C (typ.)
	Span	\pm 0.001% / °C of reading (typ.)
linearity		\pm 0.01 % of full scale
Maximum display resolution		60,000
Display		Weight display: 7 segment LED display (Character height 14.6 mm) Comparison result: red / yellow / green / yellow / red LED
Display update		Approximately 10 times per second
Dust and water protection		Complies with IP68 / IP69K
Operating conditions		-10°C ~ 40°C / 14°F ~ 104°F
Installation environment		Indoor use only
Altitude		Altitude up to 2,000 m
Power supply		AC main (100V +10%/-15%, 50/60 Hz 20VA) or SLA Battery (option), available use time approximately 70 hours* Main power cord length: Approximately 3 m
Overvoltage category		II
Pollution degree		2
Dimension		255 (W) x 119 (D) x 179 (H) mm
Weight		Approximately 2.1 kg

* In the case of one 350 ohm load cell, no other option, and turning on comparator LED
(The available use times depend on the condition of the battery, how the battery is used and the environment.)

Options

HC-02i SLA Sealed Lead Acid battery (YUASA NP4-6 recommended)


SW-03 RS-232C / Relay output

SW-04 RS-422 / 485


SW-11 Display stand / Wall-mount

Note: The options, SW-03 and SW-04, can not be used at the same time.

11.2. External dimensions

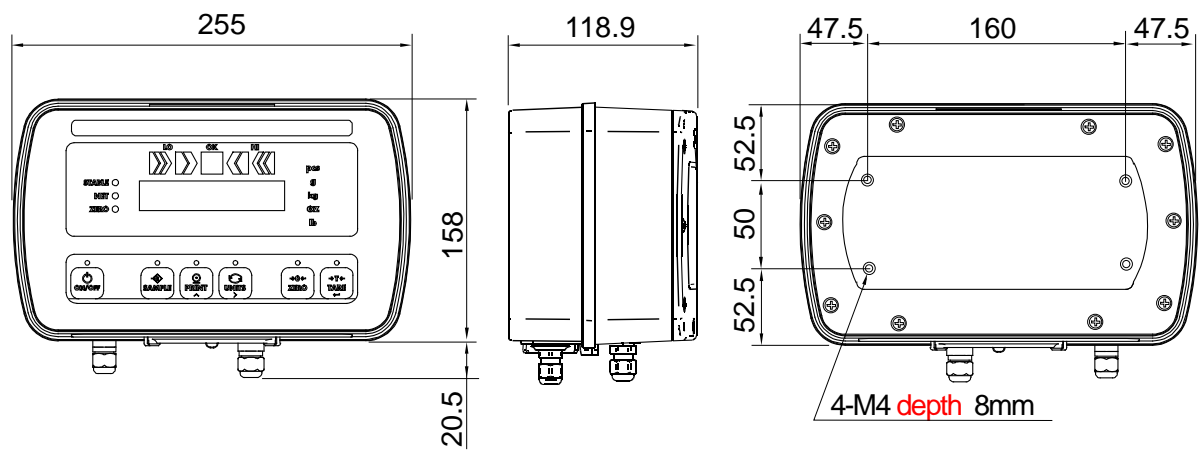

● When attaching to SW-11

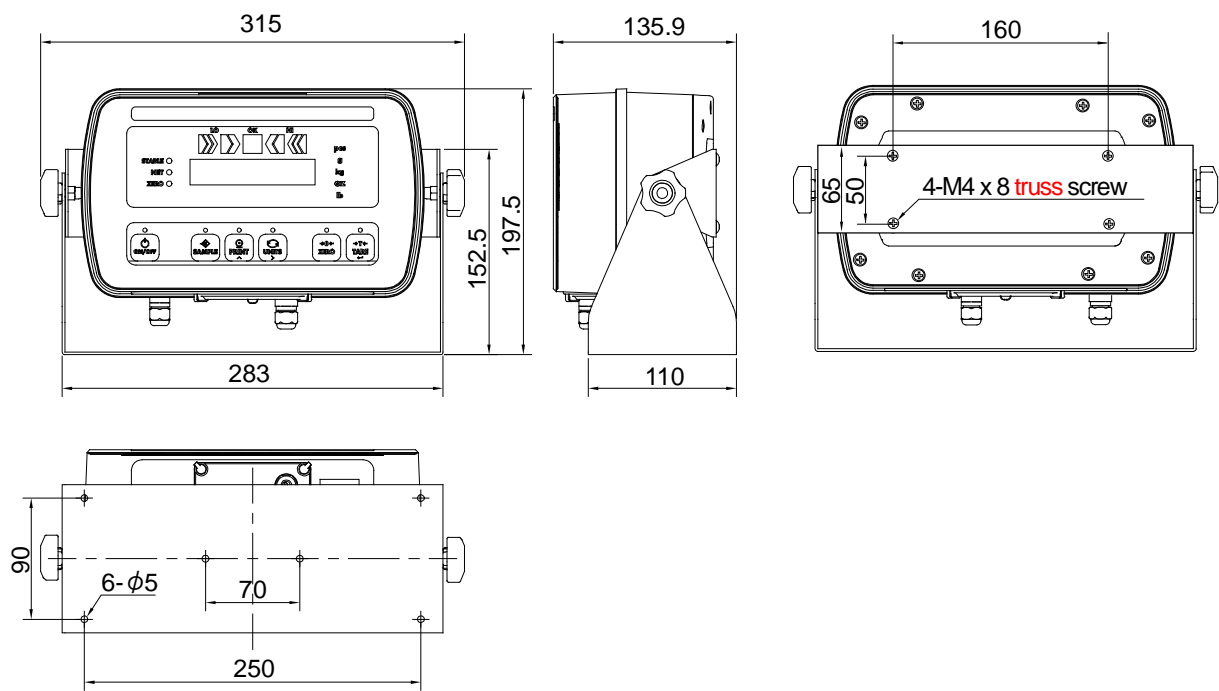


Unit: mm


12. GRAVITY ACCELERATION MAP

Values of gravity at various locations

Amsterdam	9.813 m/s ²	Manila	9.784 m/s ²
Athens	9.807 m/s ²	Melbourne	9.800 m/s ²
Auckland NZ	9.799 m/s ²	Mexico City	9.779 m/s ²
Bangkok	9.783 m/s ²	Milan	9.806 m/s ²
Birmingham	9.813 m/s ²	New York	9.802 m/s ²
Brussels	9.811 m/s ²	Oslo	9.819 m/s ²
Buenos Aires	9.797 m/s ²	Ottawa	9.806 m/s ²
Calcutta	9.788 m/s ²	Paris	9.809 m/s ²
Cape Town	9.796 m/s ²	Rio de Janeiro	9.788 m/s ²
Chicago	9.803 m/s ²	Rome	9.803 m/s ²
Copenhagen	9.815 m/s ²	San Francisco	9.800 m/s ²
Cyprus	9.797 m/s ²	Singapore	9.781 m/s ²
Djakarta	9.781 m/s ²	Stockholm	9.818 m/s ²
Frankfurt	9.810 m/s ²	Sydney	9.797 m/s ²
Glasgow	9.816 m/s ²	Taichung	9.789 m/s ²
Havana	9.788 m/s ²	Tainan	9.788 m/s ²
Helsinki	9.819 m/s ²	Taipei	9.790 m/s ²
Kuwait	9.793 m/s ²	Tokyo	9.798 m/s ²
Lisbon	9.801 m/s ²	Vancouver, BC	9.809 m/s ²
London (Greenwich)	9.812 m/s ²	Washington DC	9.801 m/s ²
Los Angeles	9.796 m/s ²	Wellington NZ	9.803 m/s ²
Madrid	9.800 m/s ²	Zurich	9.807 m/s ²

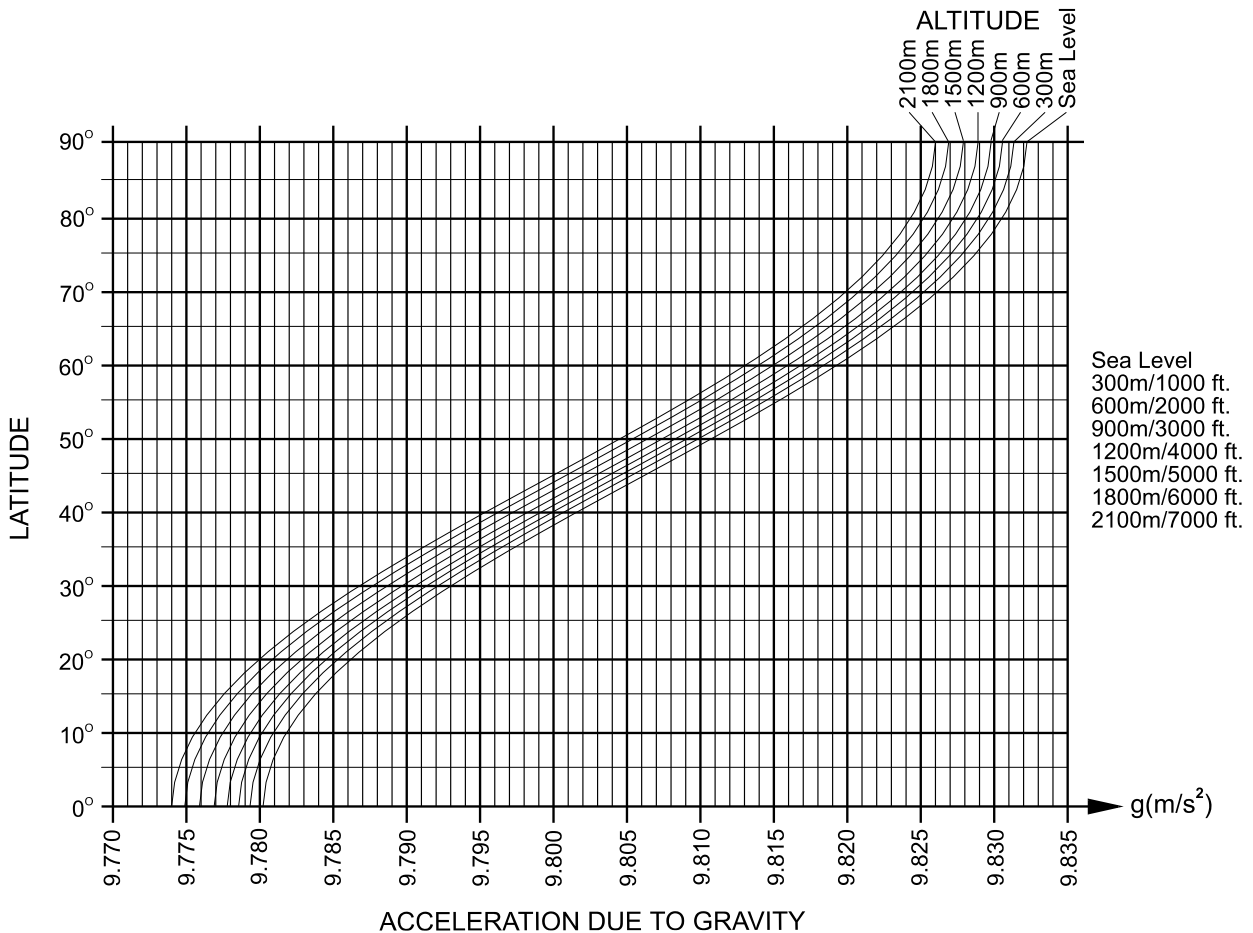

World map

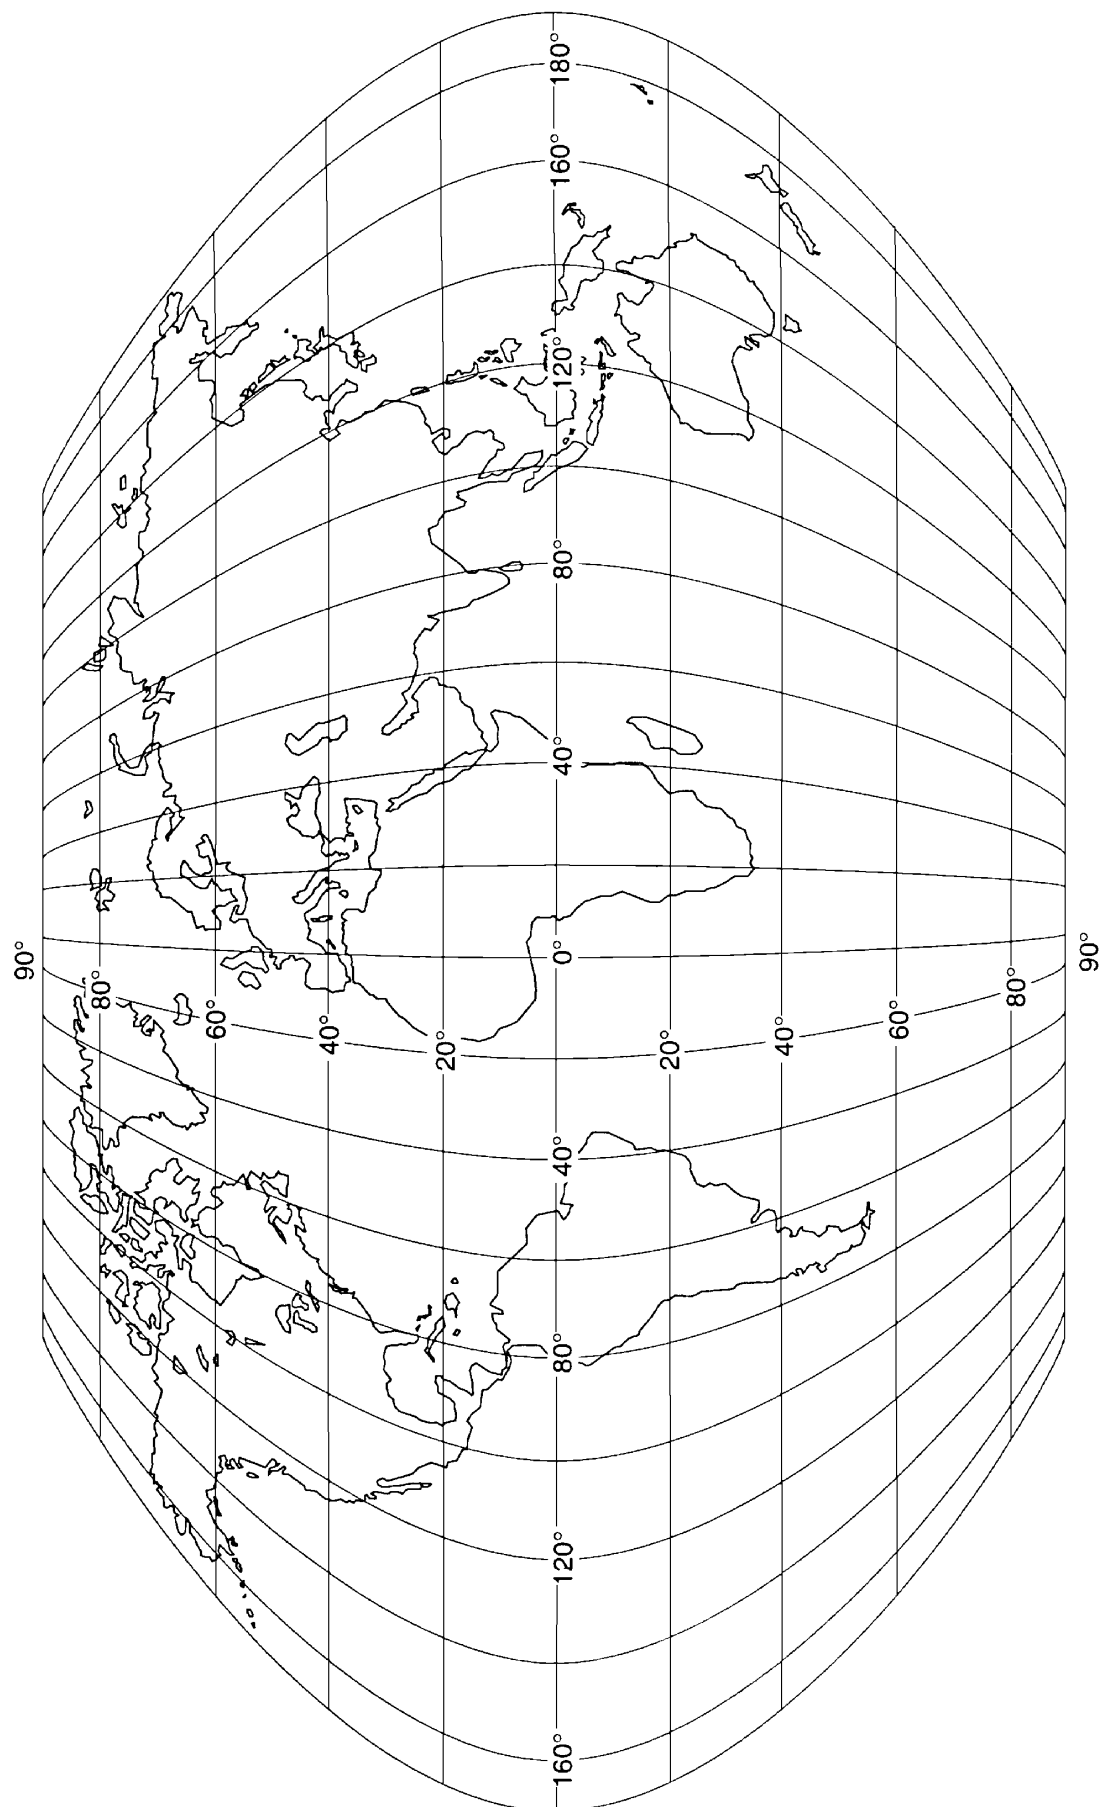

THIS PAGE INTENTIONALLY LEFT BLANK



A&D Company, Limited

3-23-14 Higashi-Ikebukuro, Toshima-ku, Tokyo 170-0013, JAPAN
Telephone: [81] (3) 5391-6132 Fax: [81] (3) 5391-1566

A&D ENGINEERING, INC.

47747 Warm Springs Blvd, Fremont, California 94539, U.S.A.
Tel: [1] (800) 726-3364 Weighing Support:[1] (888) 726-5931 Inspection Support:[1] (855) 332-8815

A&D INSTRUMENTS LIMITED

Unit 24/26 Blacklands Way, Abingdon Business Park, Abingdon, Oxfordshire OX14 1DY United Kingdom
Telephone: [44] (1235) 550420 Fax: [44] (1235) 550485

A&D AUSTRALASIA PTY LTD

32 Dew Street, Thebarton, South Australia 5031, AUSTRALIA
Telephone: [61] (8) 8301-8100 Fax: [61] (8) 8352-7409

A&D KOREA Limited

한국에이.엔.디(주)
서울특별시 영등포구 국제금융로6길33 (여의도동) 맨하탄빌딩 817 우편 번호 07331
(817, Manhattan Bldg., 33. Gukjegeumyung-ro 6-gil, Yeongdeungpo-gu, Seoul, 07331 Korea)
전화: [82] (2) 780-4101 팩스: [82] (2) 782-4264

ООО A&D RUS

ООО "Эй энд Ди Рус"

Почтовый адрес: 121357, Российская Федерация, г. Москва, ул. Вереysкая, дом 17
Юридический адрес: 117545, Российская Федерация, г. Москва, ул. Дорожная, д.3, корп.6, комн. 86
(121357, Russian Federation, Moscow, Vereyskaya Street 17)
тел.: [7] (495) 937-33-44 факс: [7] (495) 937-55-66

A&D Instruments India Private Limited

ऐ&डी इन्स्ट्रुमेन्ट्स इण्डिया प्रा० लिमिटेड

D-48, उद्योग विहार , फेस -5, गुडगांव - 122016, हरियाणा , भारत
(D-48, Udyog Vihar, Phase-V, Gurgaon - 122016, Haryana, India)
फोन : [91] (124) 4715555 फैक्स : [91] (124) 4715599

A&D SCIENTECH TAIWAN LIMITED. A&D台灣分公司 艾安得股份有限公司

台灣台北市中山區南京東路2段206號11樓之2
(11F-2, No.206, Sec.2, Nanjing E.Rd., Zhongshan Dist., Taipei City 10489, Taiwan, R.O.C.)
Tel : [886](02) 2322-4722 Fax : [886](02) 2392-1794

A&D INSTRUMENTS (THAILAND) LIMITED

บริษัท เอ แอนด์ ดี อินสตรูमेंท์ (ไทยแลนด์) จำกัด

168/16 หมู่ที่ 1 ตำบลรังสิต อำเภอธัญบุรี จังหวัดปทุมธานี 12110 ประเทศไทย
(168/16 Moo 1, Rangsit, Thanyaburi, Pathumthani 12110 Thailand)
Tel : [66] 20038911